

Light measurement report



Laboratory and Equipment

Test lab	n/a
Spectrometer Manufacturer and Model	n/a, n/a – n/a
Measurement date	6/25/2026

Measurement Conditions

Tested c-planes	8
Tested gamma angles	181 – 1.00°
Input Power	29.2 W


Tested Light Source

Luminaire	2021/6/4 9:55:24
Basic Luminous Shape	PANEL
Item No.	
Manufacturer	Moon On Noon


Main Light Measurement Results

Output – Total Lumen (Up% / Down%)	2122 lm – 0.0021% / 100%
Efficiency	72.67 lm/W
Peak Intensity	6947 cd
Correlated Color Temperature, CCT	2700 K
Color Rendering Index	CRI 85.0

Polar light distribution diagram

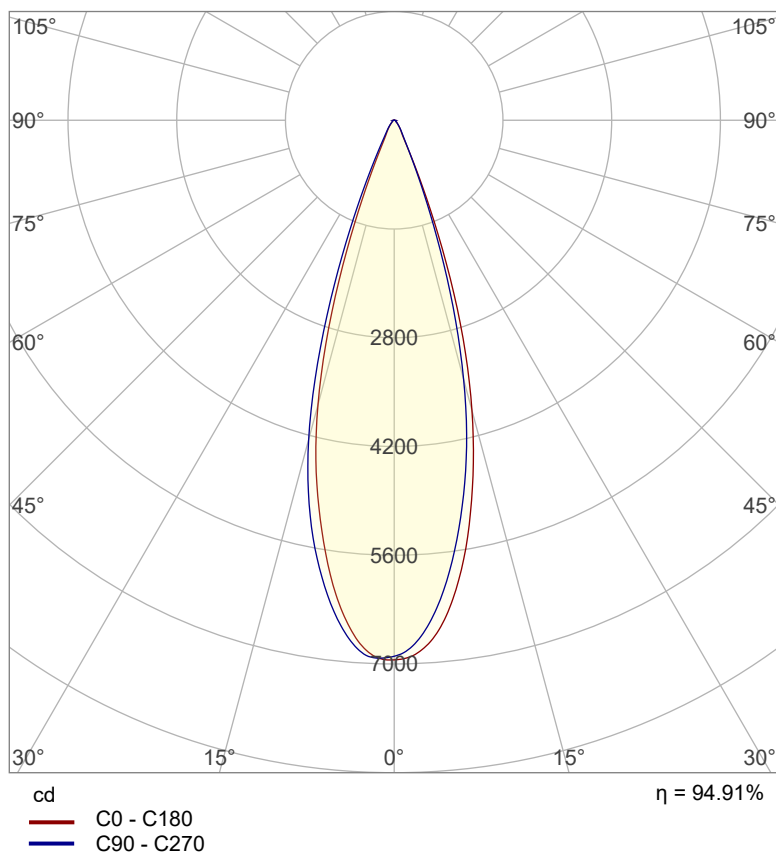


Beam details

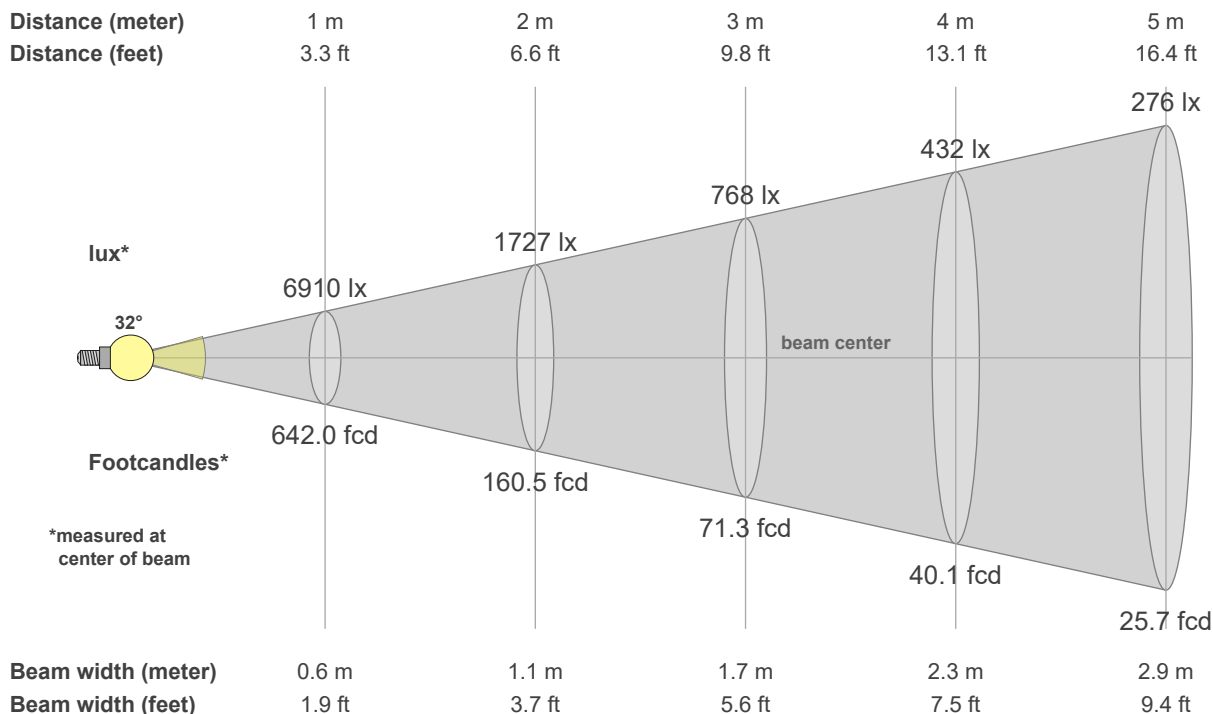


Luminaire budgetary diagram


LAMPS (number of lamps)

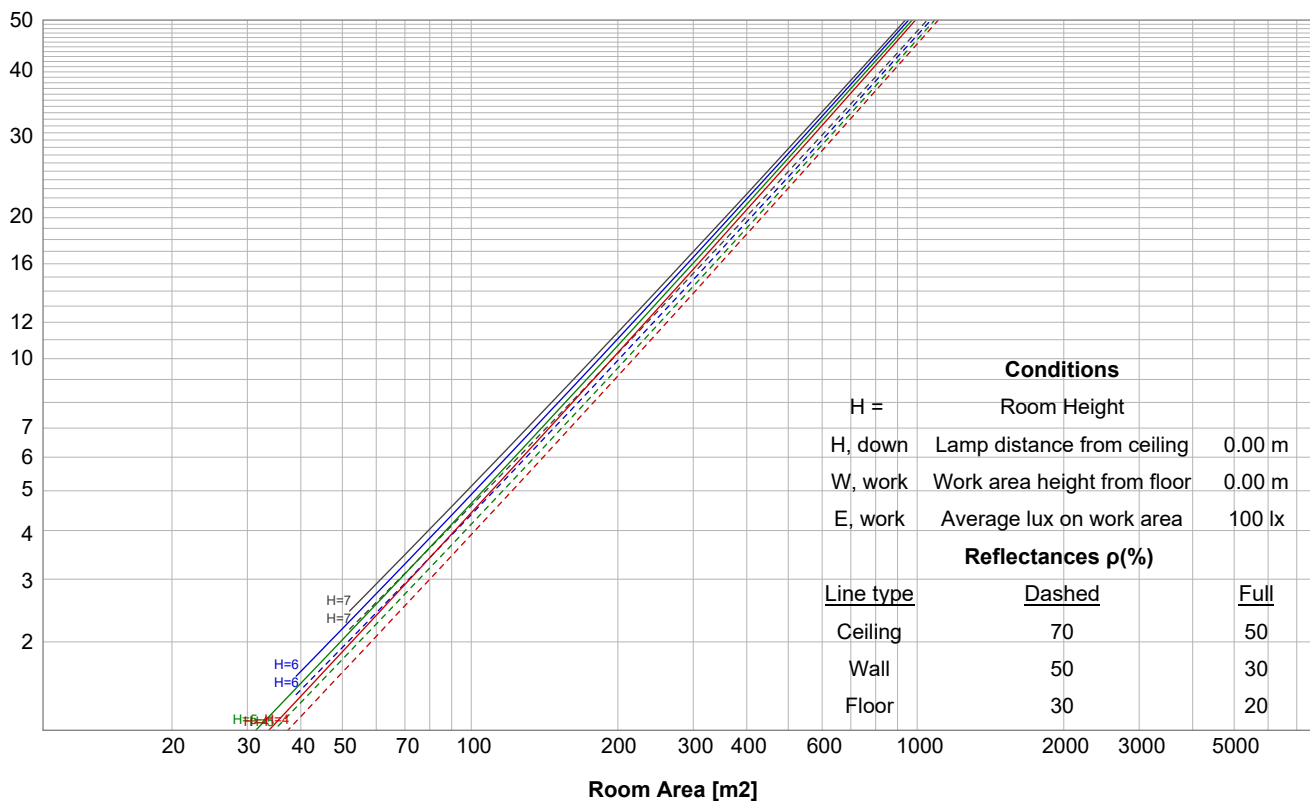


Iso-intensity Diagram (Iso-candela)

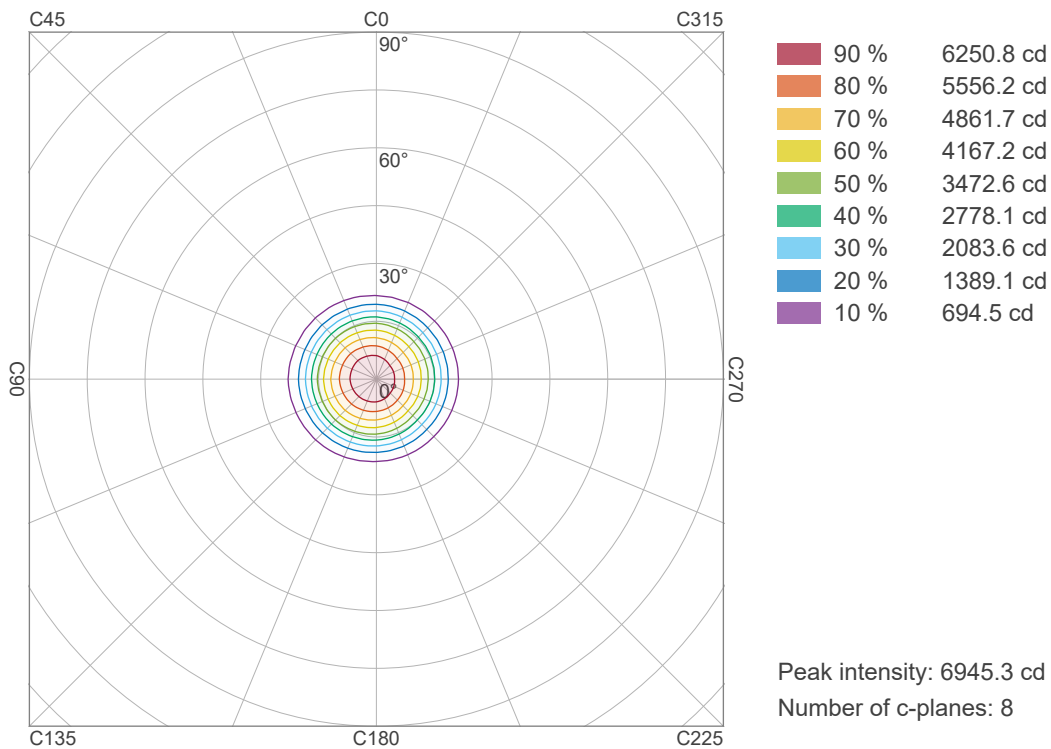

Iso-illuminance Diagram (Iso-lux)

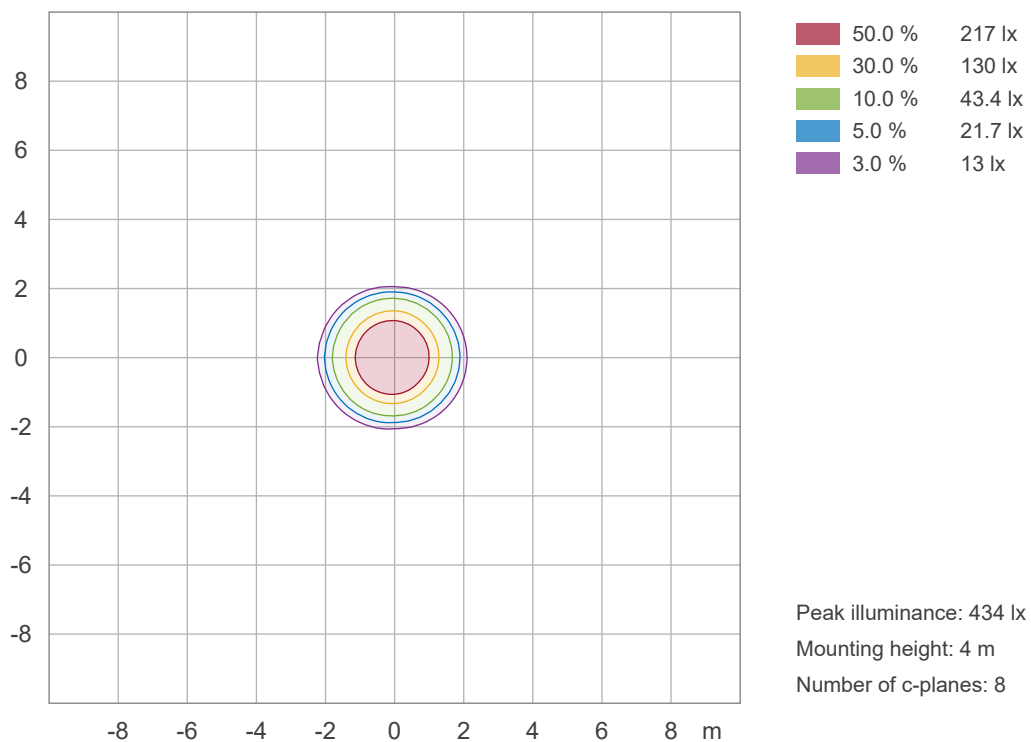


Linear intensity distribution diagram

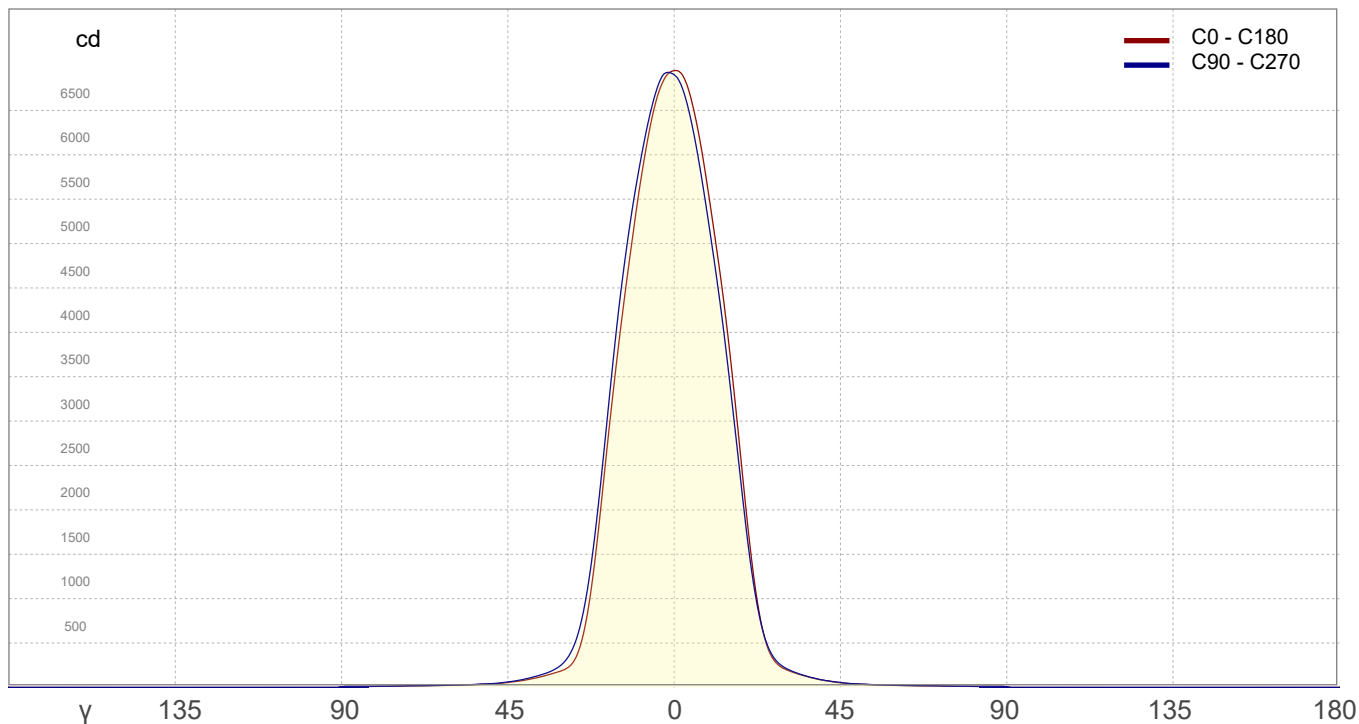

IESNA TM-15-07 Luminaire Classification System For Outdoor Luminaires

BUG rating B2 U0 G0

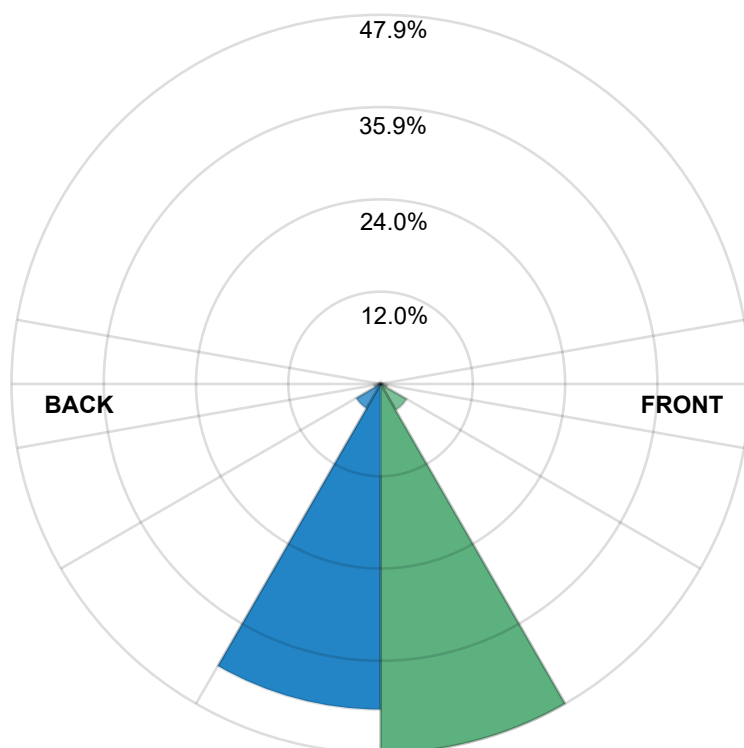

Forward Light

Low (0-30°)	1017.1 lm	47.9%
Medium (30-60°)	83.0 lm	3.9%
High (60-80°)	17.8 lm	0.8%
Very High (80-90°)	6.1 lm	0.3%

Back Light

Low (0-30°)	897.0 lm	42.3%
Medium (30-60°)	77.7 lm	3.7%
High (60-80°)	17.2 lm	0.8%
Very High (80-90°)	6.1 lm	0.3%

Uplight

Low (90-100°)	0.0 lm	0.00%
High (100-180°)	0.0 lm	0.0%

Total

Sum	2122.0 lm	100,0%
-----	-----------	--------