

Light measurement report



Laboratory and Equipment

Test lab	n/a
Spectrometer Manufacturer and Model	n/a, n/a – n/a
Measurement date	7/6/2026

Measurement Conditions

Tested c-planes	8
Tested gamma angles	181 – 1.00°
Input Power	3.29 W


Tested Light Source

Luminaire	2021/4/8 18:57:53
Basic Luminous Shape	PANEL
Item No.	
Manufacturer	Moon On Noon


Main Light Measurement Results

Output – Total Lumen (Up% / Down%)	138.8 lm – 0.0007% / 100%
Efficiency	42.18 lm/W
Peak Intensity	328.5 cd
Correlated Color Temperature, CCT	3000 K
Color Rendering Index	CRI 85.0

Polar light distribution diagram

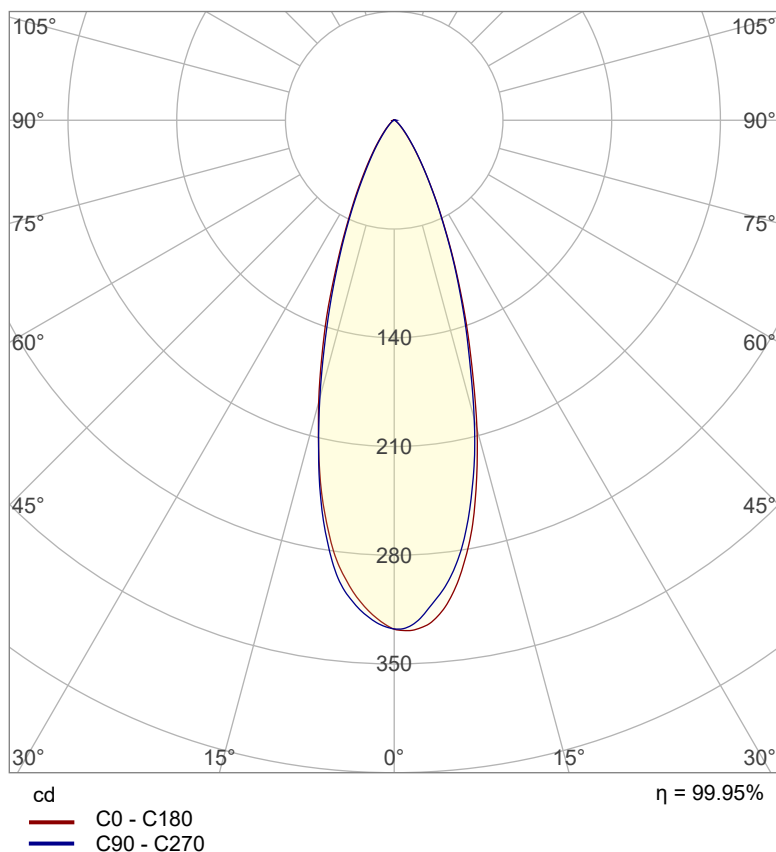


Beam details

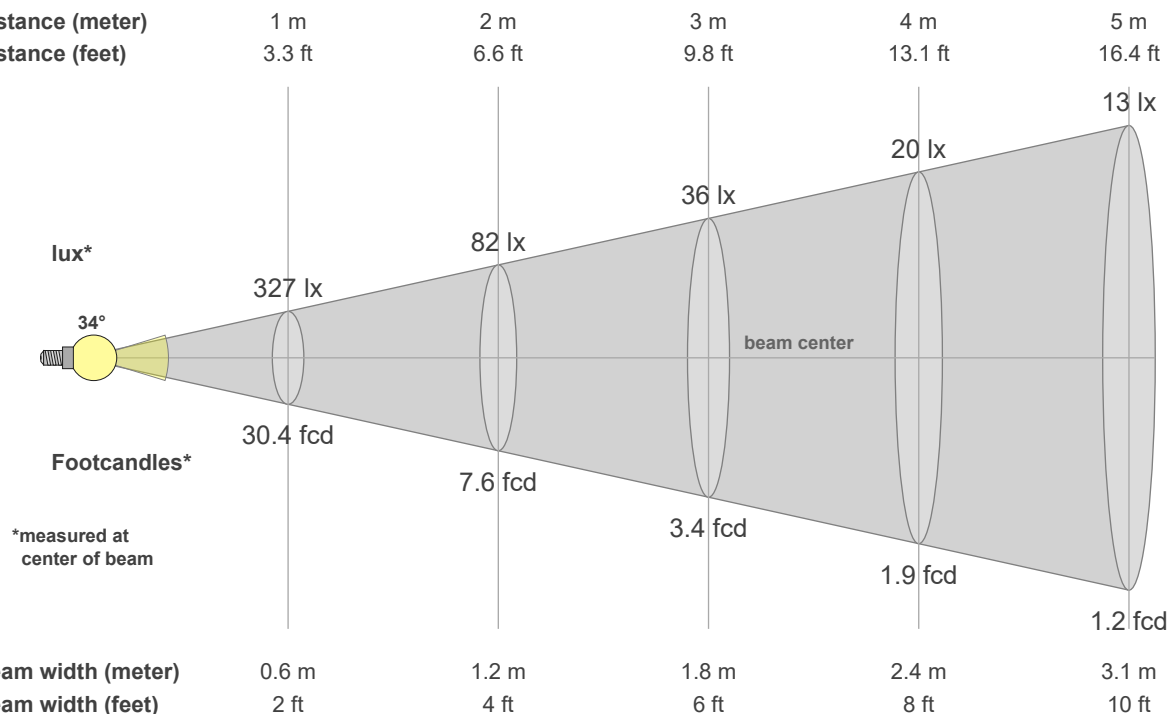


Luminaire budgetary diagram


LAMPS (number of lamps)

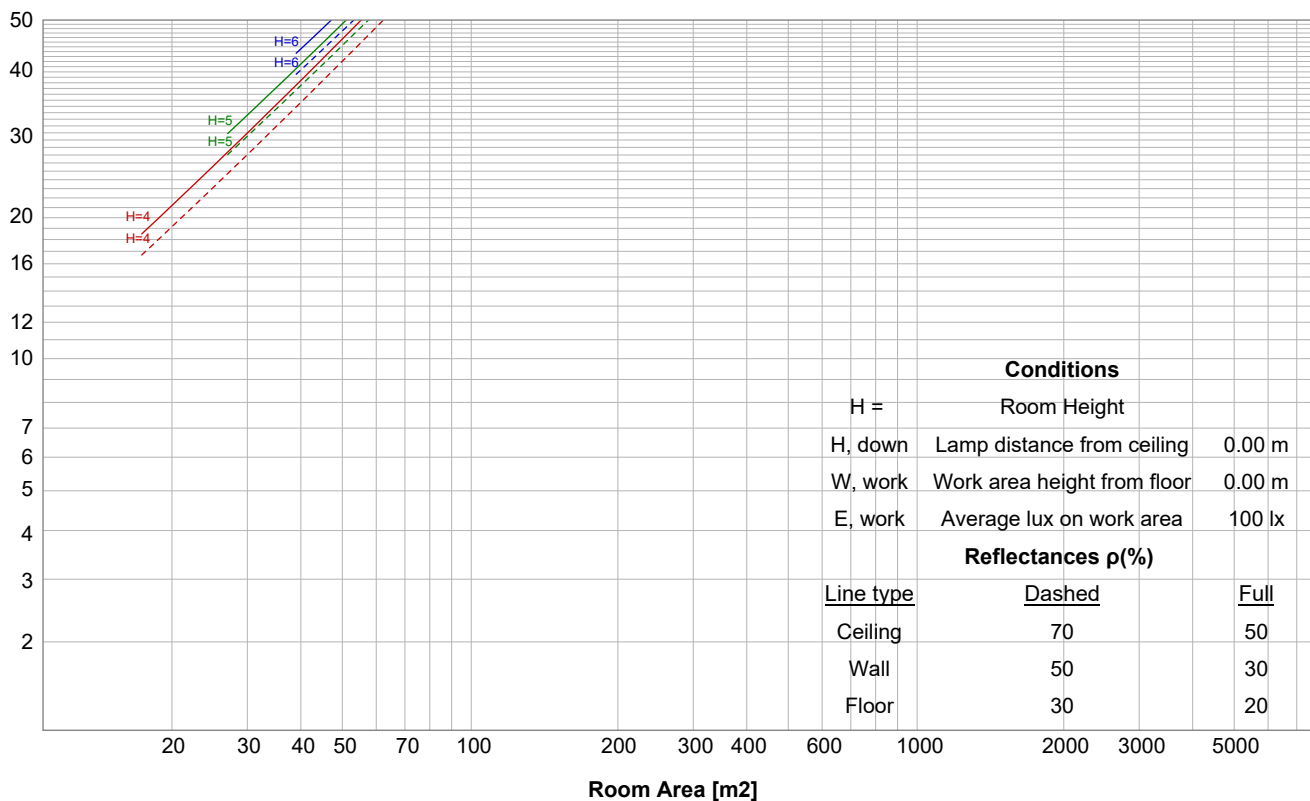


Iso-intensity Diagram (Iso-candela)

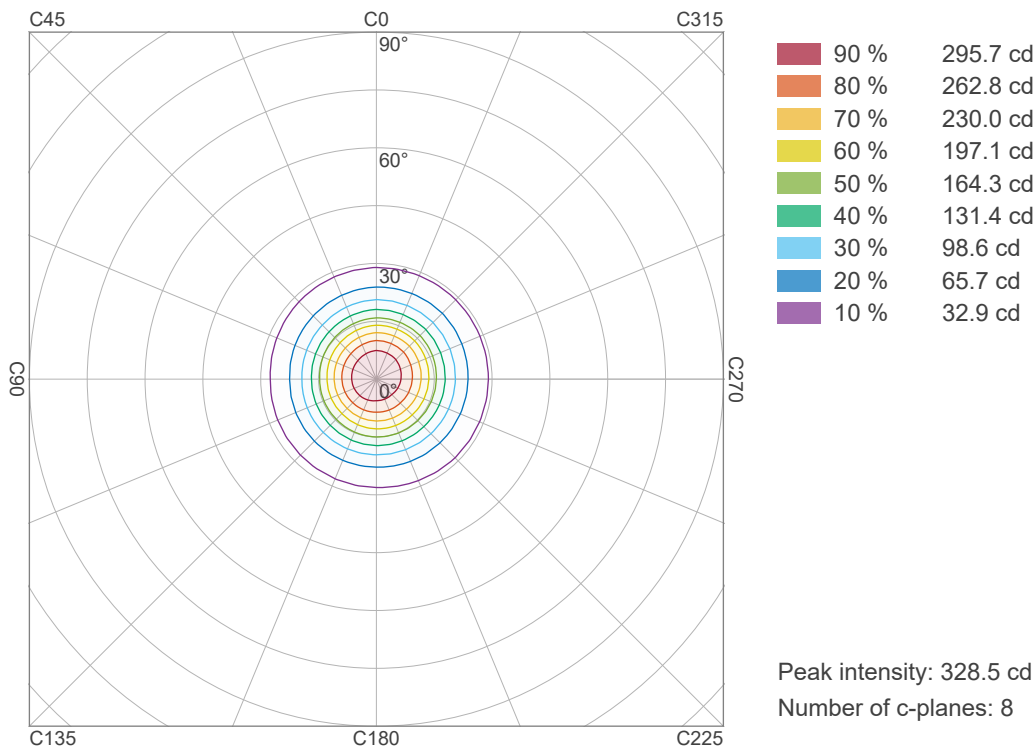

Iso-illuminance Diagram (Iso-lux)

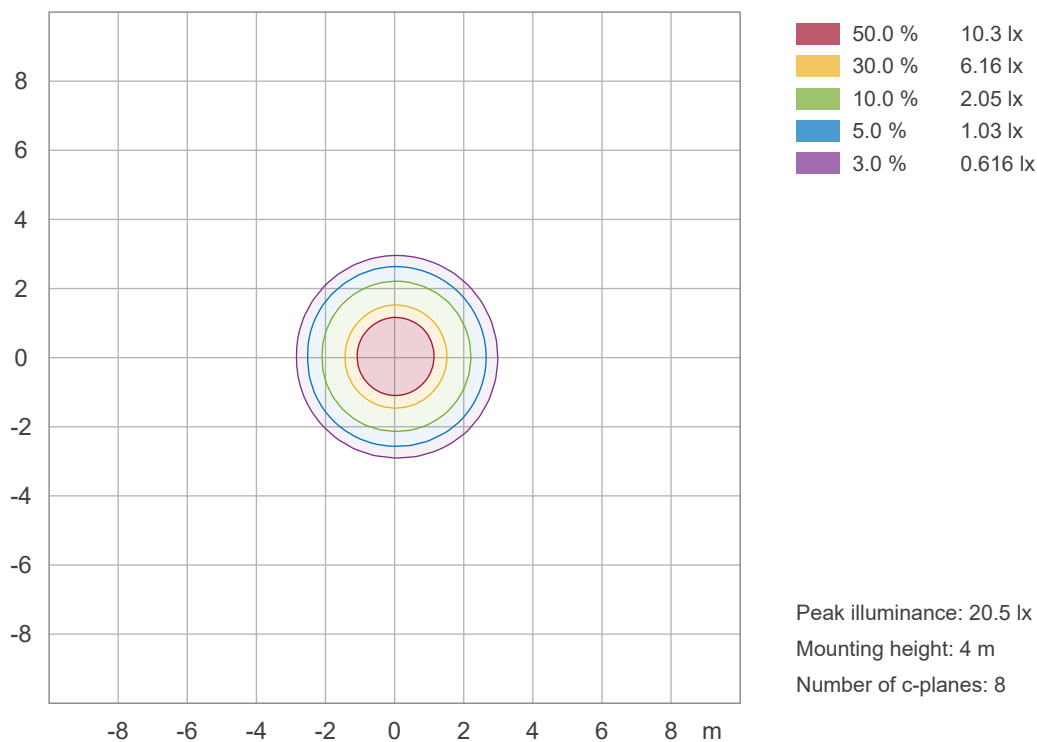


Linear intensity distribution diagram

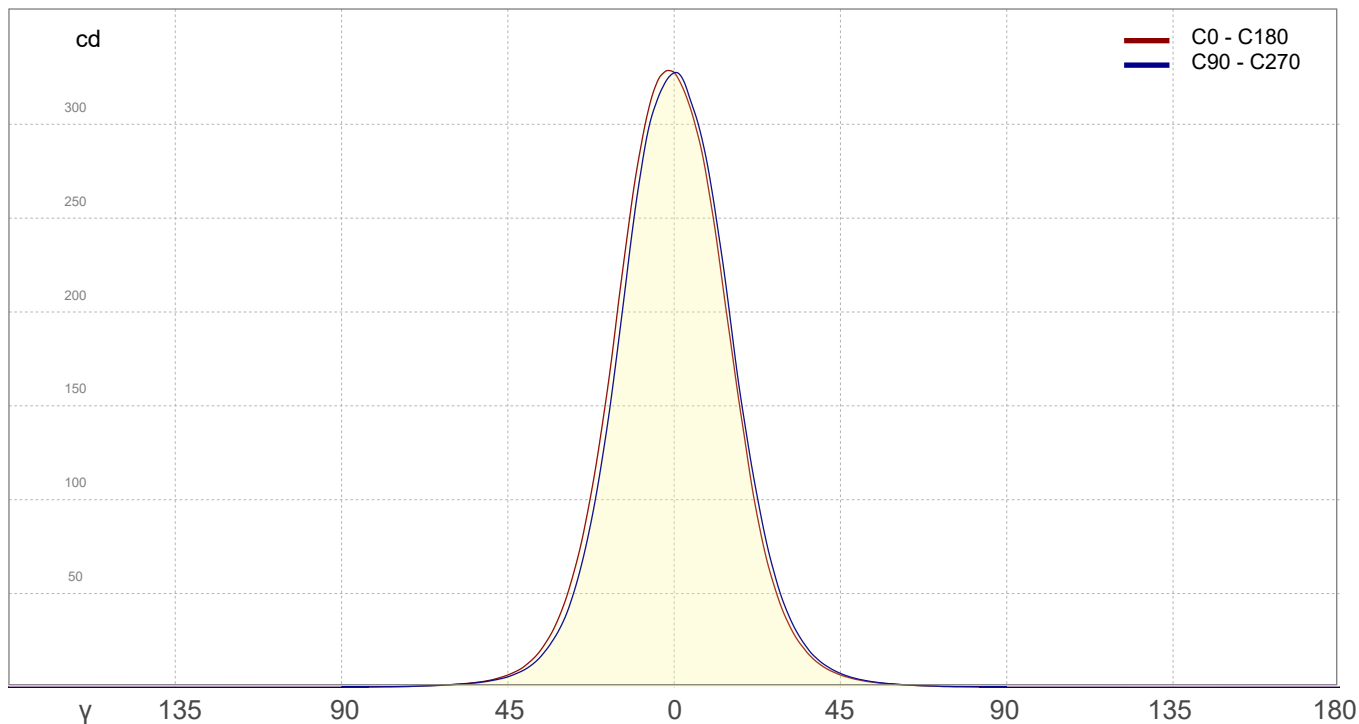

IESNA TM-15-07 Luminaire Classification System For Outdoor Luminaires

BUG rating B0 U0 G0

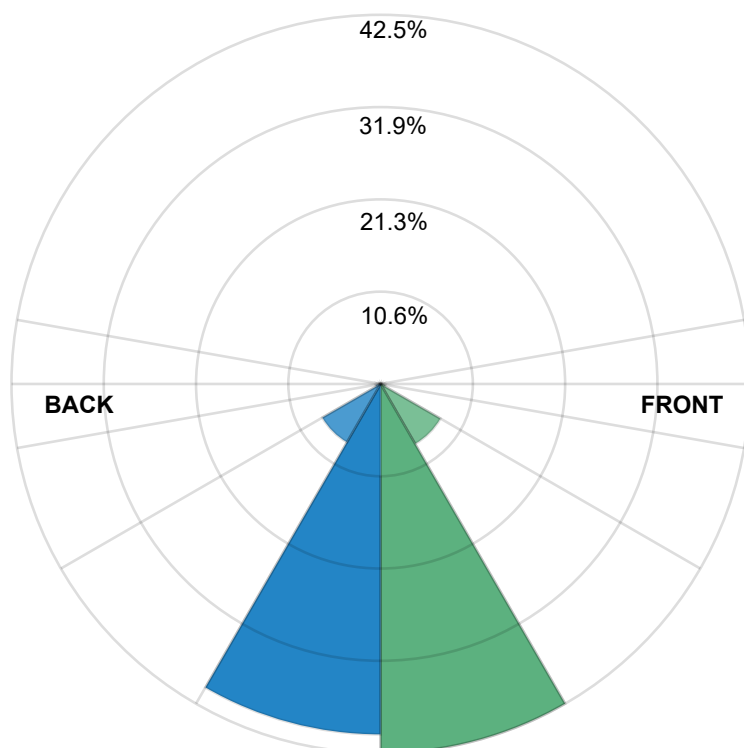

Forward Light

Low (0-30°)	59.1 lm	42.5%
Medium (30-60°)	11.1 lm	8.0%
High (60-80°)	0.8 lm	0.5%
Very High (80-90°)	0.2 lm	0.1%

Back Light

Low (0-30°)	56.1 lm	40.4%
Medium (30-60°)	10.8 lm	7.8%
High (60-80°)	0.8 lm	0.6%
Very High (80-90°)	0.2 lm	0.1%

Uplight

Low (90-100°)	0.0 lm	0.00%
High (100-180°)	0.0 lm	0.0%

Total

Sum	138.8 lm	100,0%
-----	----------	--------