

Light measurement report



Laboratory and Equipment

Test lab	n/a
Spectrometer Manufacturer and Model	n/a, n/a – n/a
Measurement date	7/14/2026

Measurement Conditions

Tested c-planes	12
Tested gamma angles	181 – 1.00°
Input Power	4.725 W


Tested Light Source

Luminaire	2022/10/24 8:29:48
Basic Luminous Shape	PANEL
Item No.	
Manufacturer	Moon On Noon


Main Light Measurement Results

Output – Total Lumen (Up% / Down%)	130.8 lm – 0.0004% / 100%
Efficiency	27.68 lm/W
Peak Intensity	719.6 cd
Correlated Color Temperature, CCT	3000 K
Color Rendering Index	CRI 85.0

Polar light distribution diagram

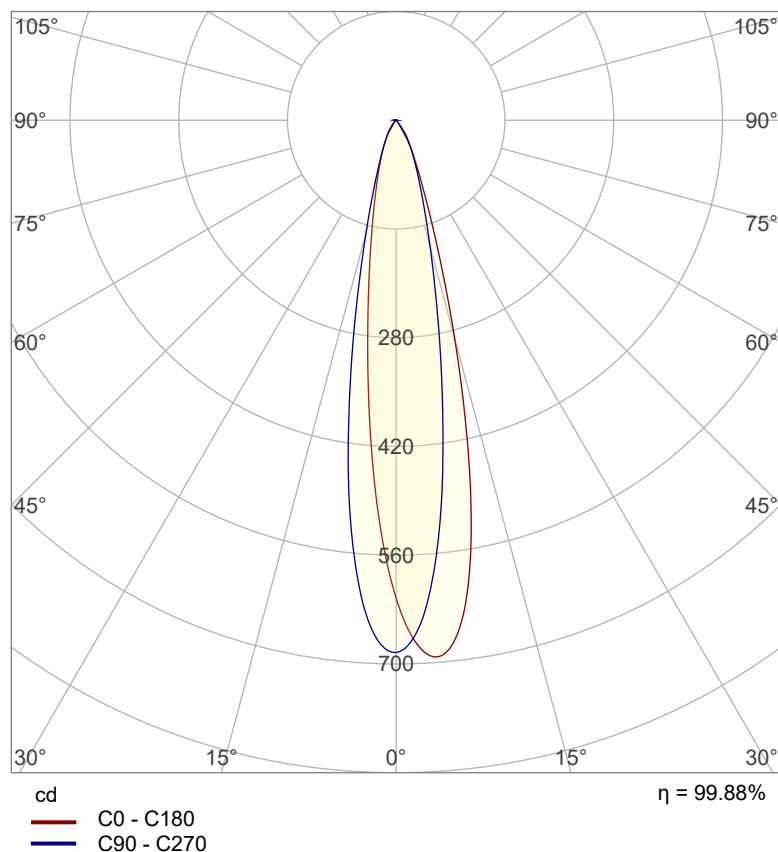


Beam details

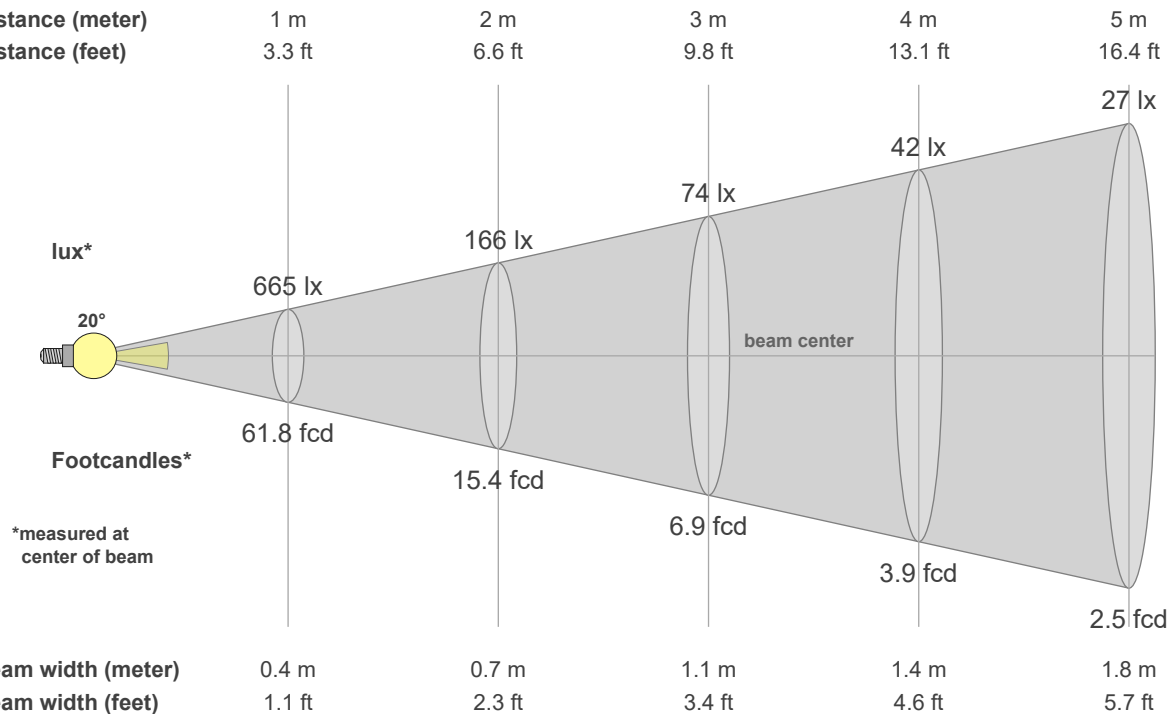


Luminaire budgetary diagram


LAMPS (number of lamps)

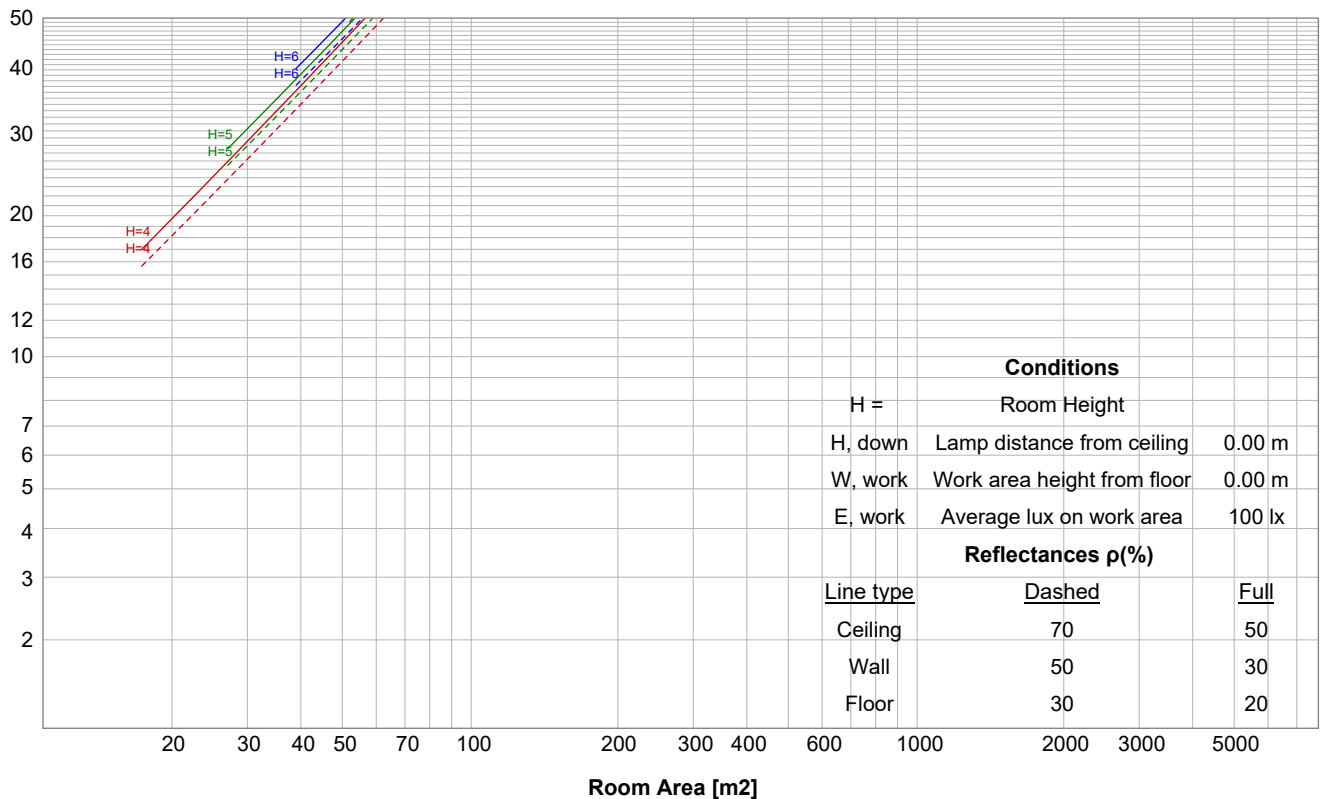


Iso-intensity Diagram (Iso-candela)

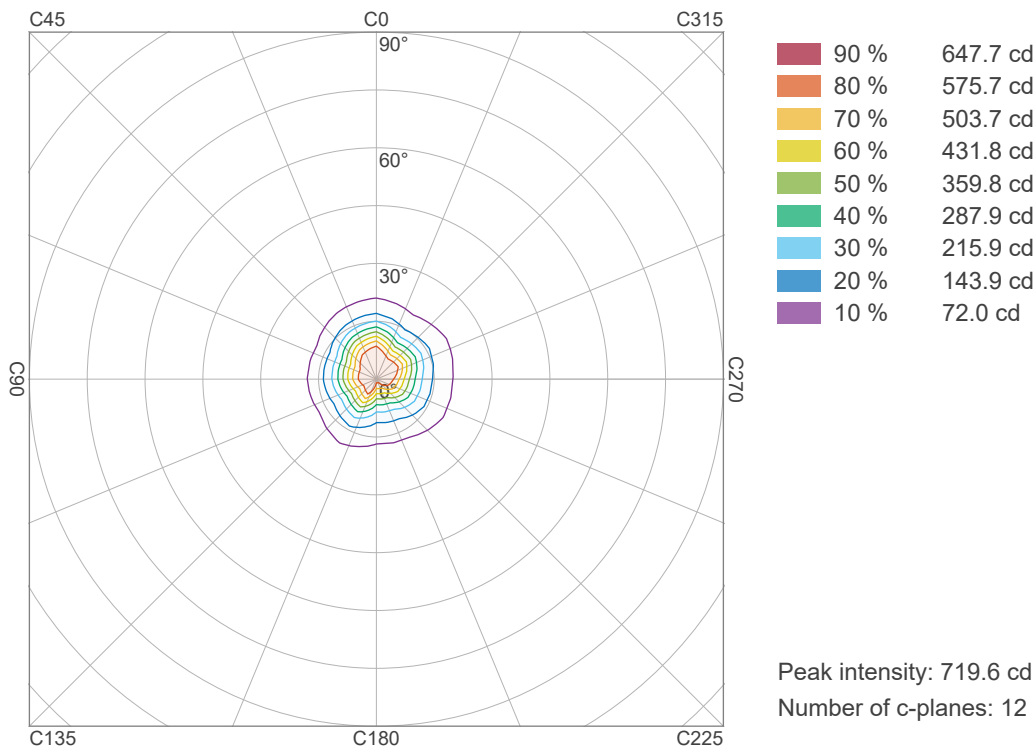

Iso-illuminance Diagram (Iso-lux)

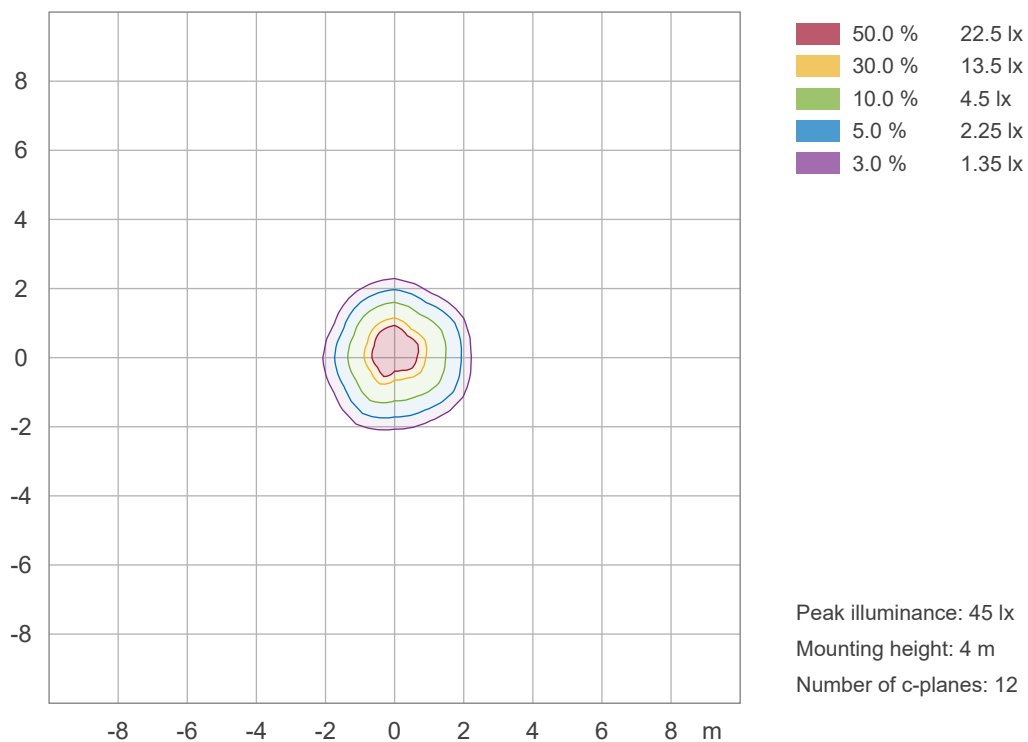


Linear intensity distribution diagram

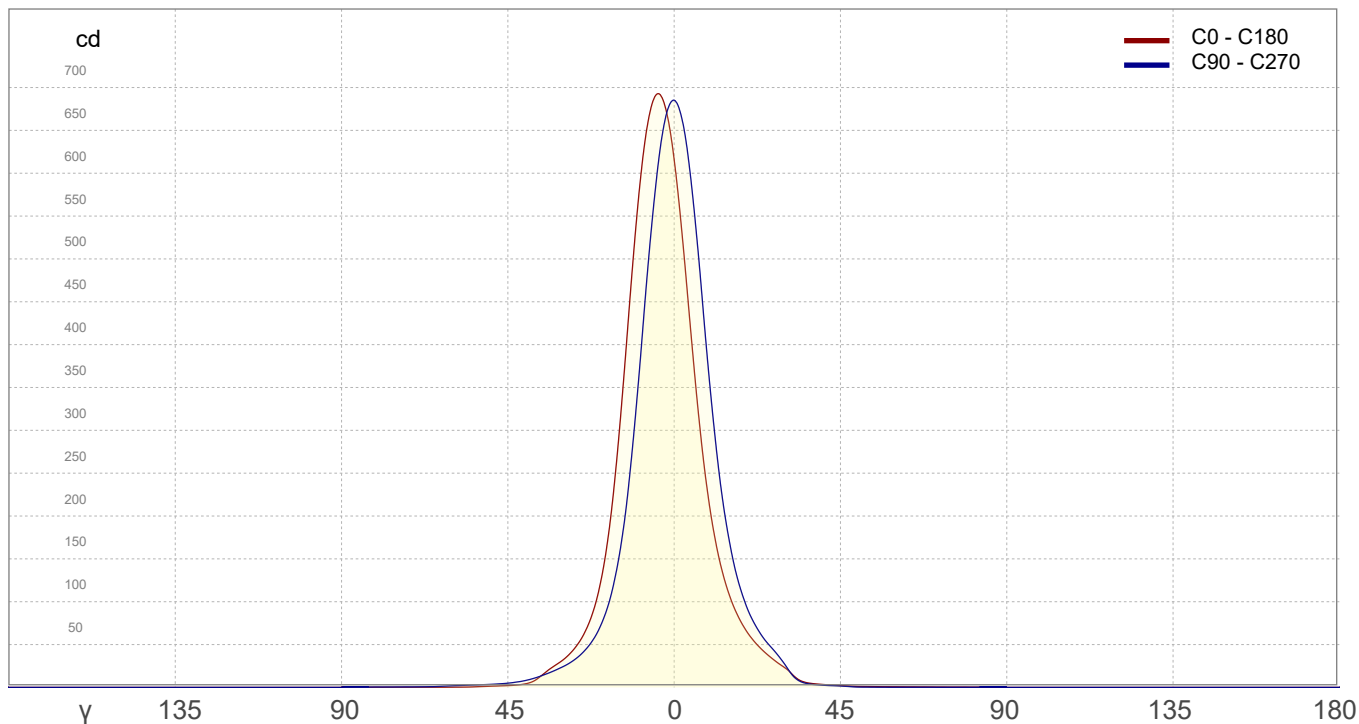

IESNA TM-15-07 Luminaire Classification System For Outdoor Luminaires

BUG rating B0 U0 G0

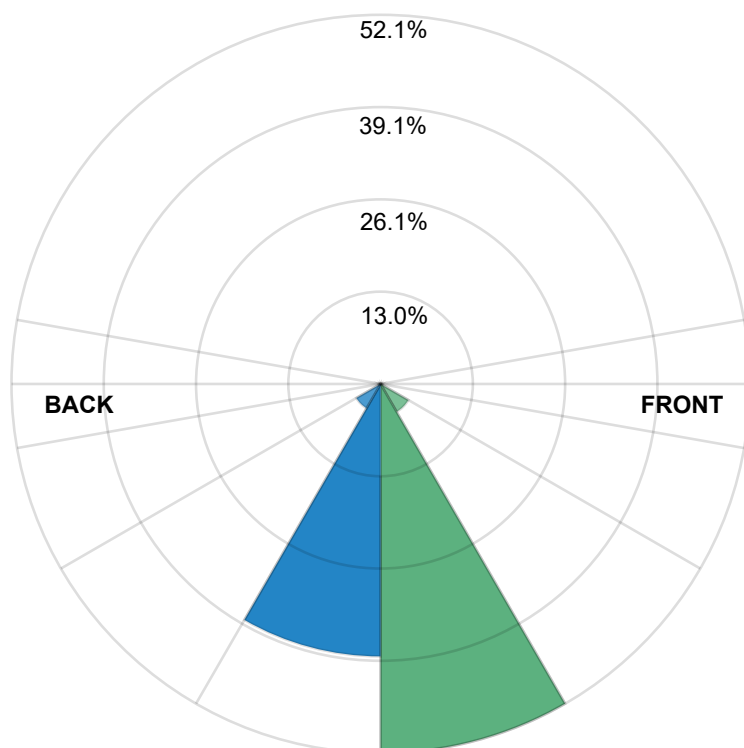

Forward Light

Low (0-30°)	68.2 lm	52.1%
Medium (30-60°)	5.9 lm	4.5%
High (60-80°)	0.4 lm	0.3%
Very High (80-90°)	0.2 lm	0.1%

Back Light

Low (0-30°)	50.3 lm	38.5%
Medium (30-60°)	5.2 lm	4.0%
High (60-80°)	0.4 lm	0.3%
Very High (80-90°)	0.2 lm	0.1%

Uplight

Low (90-100°)	0.0 lm	0.00%
High (100-180°)	0.0 lm	0.0%

Total

Sum	130.8 lm	100,0%
-----	----------	--------