

Light measurement report



Laboratory and Equipment

Test lab	n/a
Spectrometer Manufacturer and Model	n/a, n/a – n/a
Measurement date	7/6/2026

Measurement Conditions

Tested c-planes	8
Tested gamma angles	181 – 1.00°
Input Power	6.337 W


Tested Light Source

Luminaire	2021/4/5 19:48:22
Basic Luminous Shape	PANEL
Item No.	
Manufacturer	Moon On Noon


Main Light Measurement Results

Output – Total Lumen (Up% / Down%)	460.3 lm – 0.0072% / 99.99%
Efficiency	72.63 lm/W
Peak Intensity	2313 cd
Correlated Color Temperature, CCT	3000 K
Color Rendering Index	CRI 85.0

Polar light distribution diagram

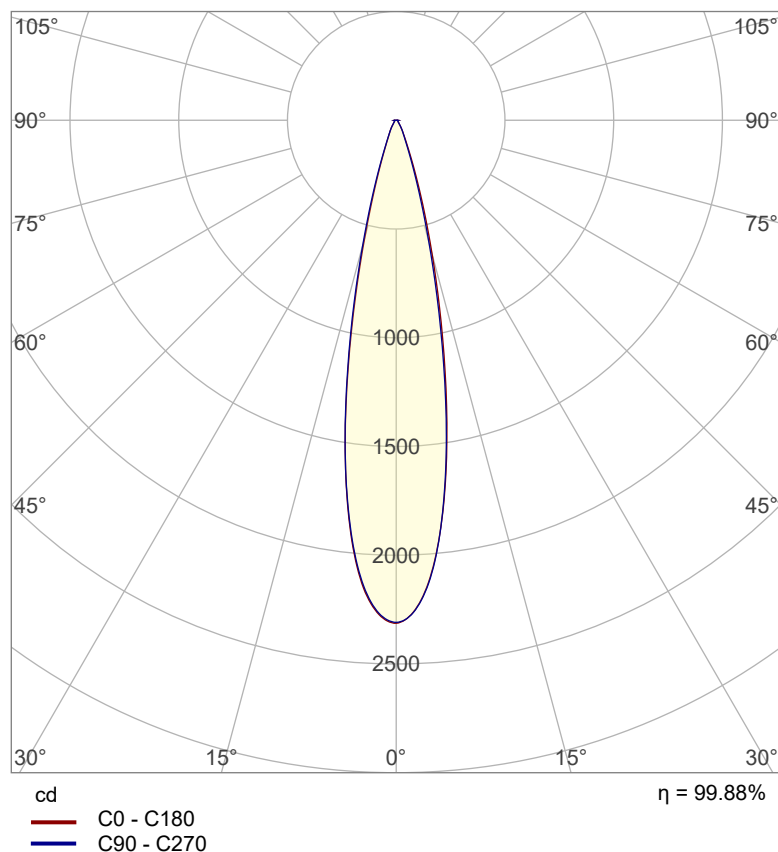


Beam details

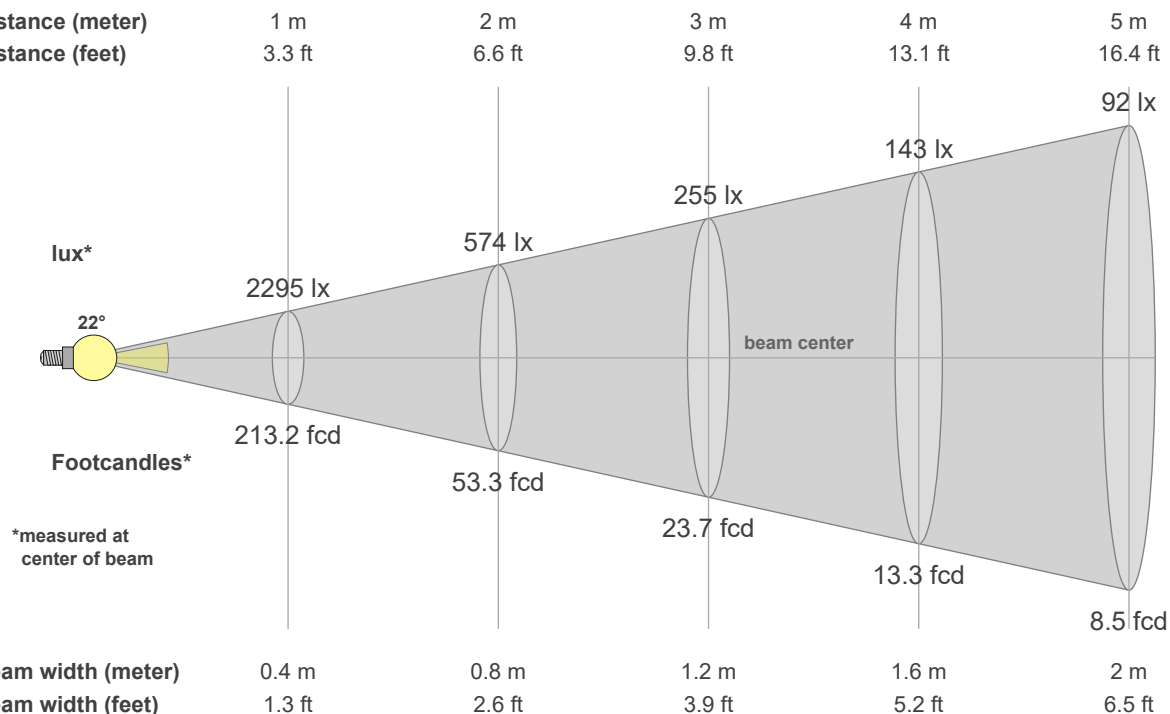


Luminaire budgetary diagram


LAMPS (number of lamps)

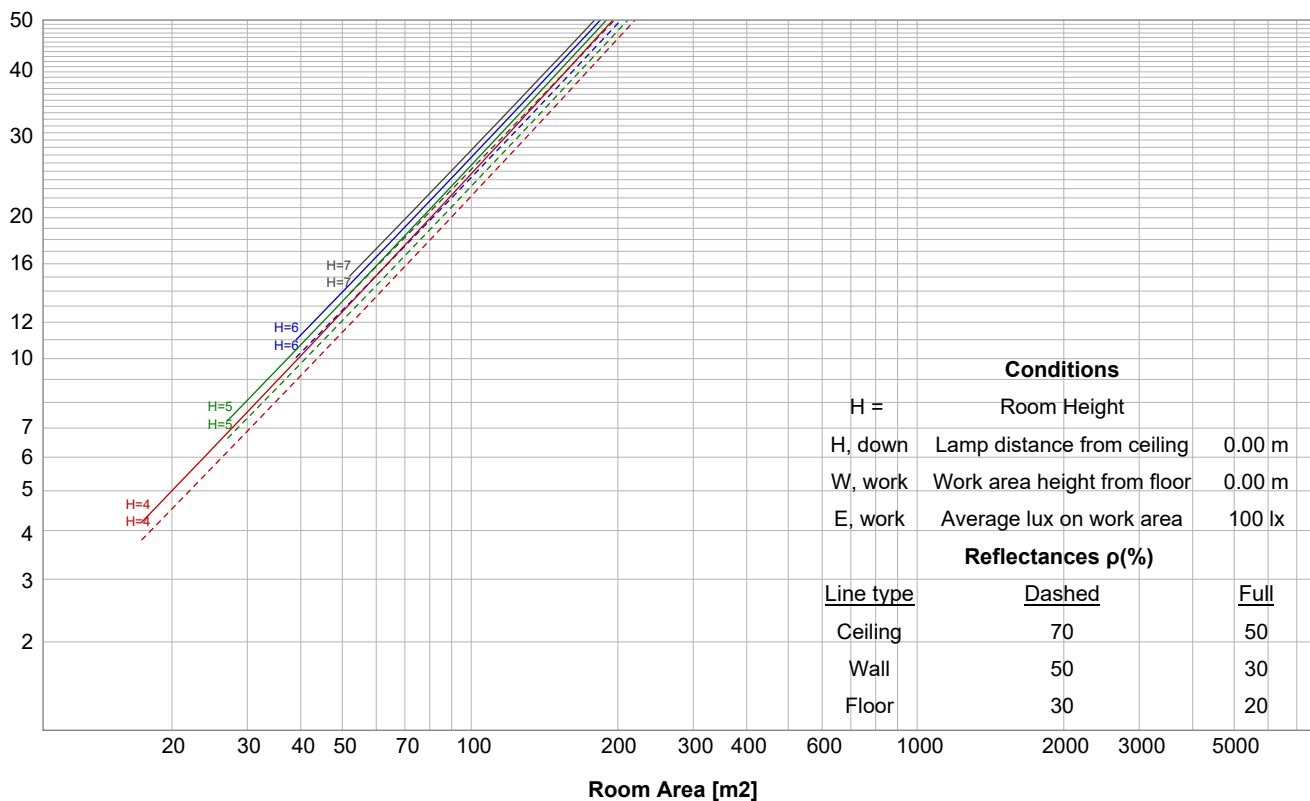


Iso-intensity Diagram (Iso-candela)

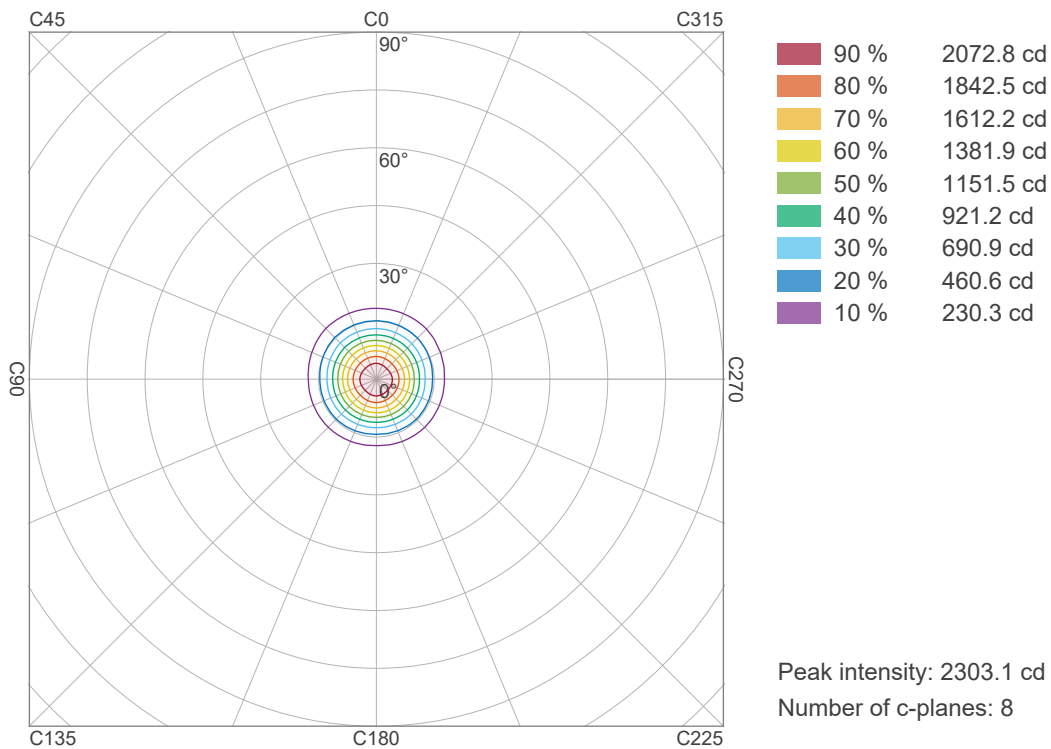

Iso-illuminance Diagram (Iso-lux)

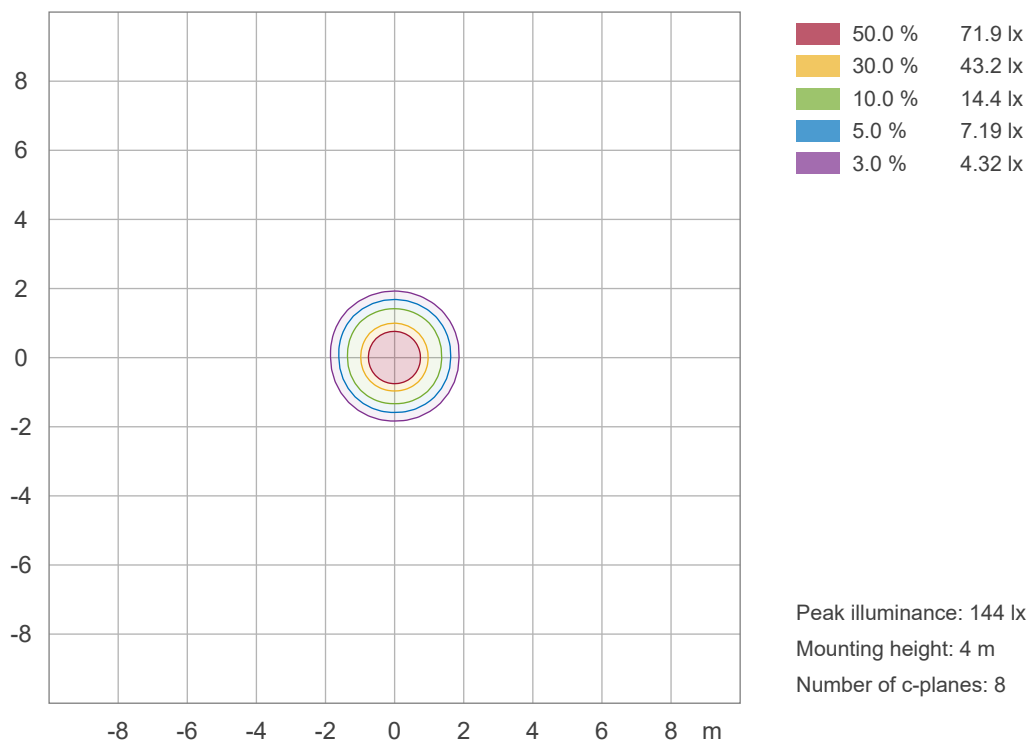


Linear intensity distribution diagram

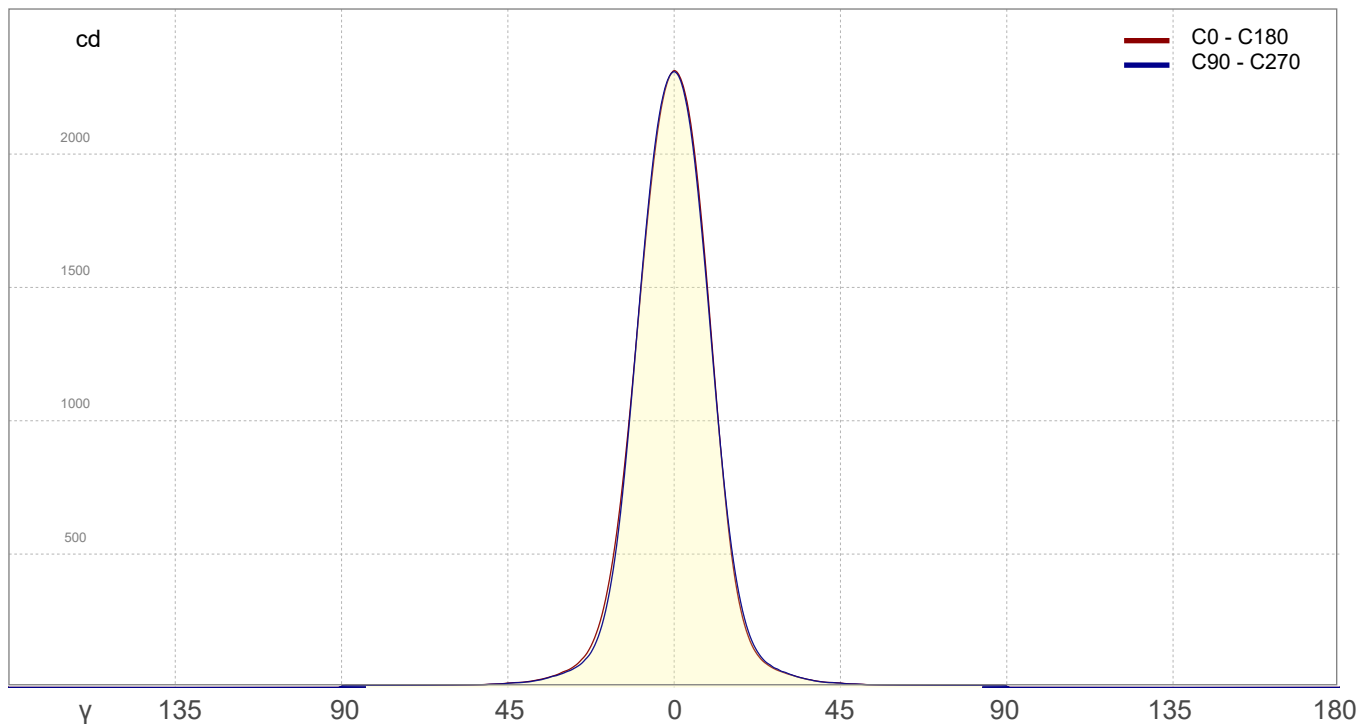

IESNA TM-15-07 Luminaire Classification System For Outdoor Luminaires

BUG rating B1 U0 G0

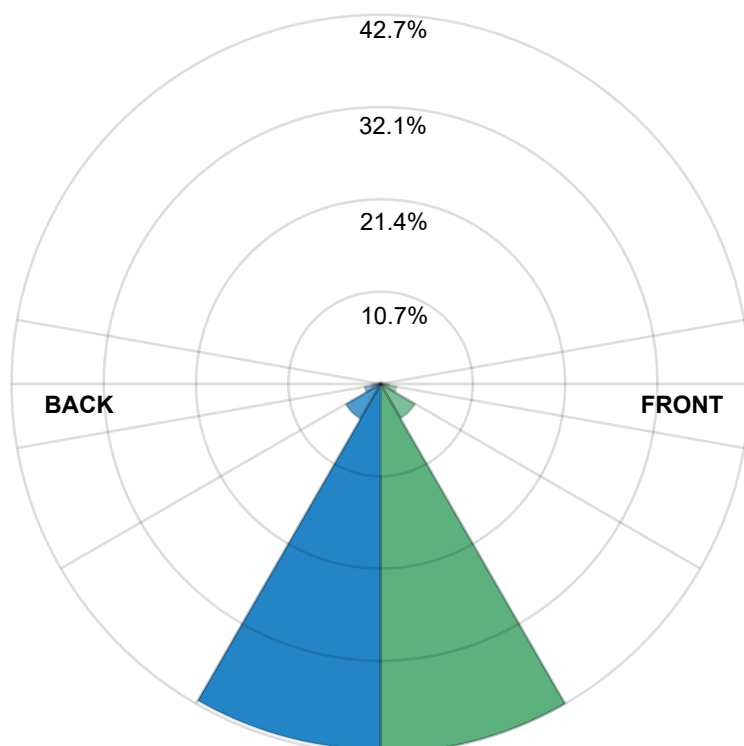

Forward Light

Low (0-30°)	196.7 lm	42.7%
Medium (30-60°)	21.2 lm	4.6%
High (60-80°)	8.6 lm	1.9%
Very High (80-90°)	4.3 lm	0.9%

Back Light

Low (0-30°)	194.8 lm	42.3%
Medium (30-60°)	21.5 lm	4.7%
High (60-80°)	8.6 lm	1.9%
Very High (80-90°)	4.4 lm	0.9%

Uplight

Low (90-100°)	0.0 lm	0.00%
High (100-180°)	0.0 lm	0.0%

Total

Sum	460.3 lm	100,0%
-----	----------	--------