

Light measurement report



Laboratory and Equipment

Test lab	n/a
Spectrometer Manufacturer and Model	n/a, n/a – n/a
Measurement date	7/6/2026

Measurement Conditions

Tested c-planes	8
Tested gamma angles	181 – 1.00°
Input Power	10.94 W


Tested Light Source

Luminaire	2021/4/6 8:16:51
Basic Luminous Shape	PANEL
Item No.	
Manufacturer	Moon On Noon


Main Light Measurement Results

Output – Total Lumen (Up% / Down%)	690.6 lm – 0.0029% / 100%
Efficiency	63.13 lm/W
Peak Intensity	3814 cd
Correlated Color Temperature, CCT	3000 K
Color Rendering Index	CRI 85.0

Polar light distribution diagram

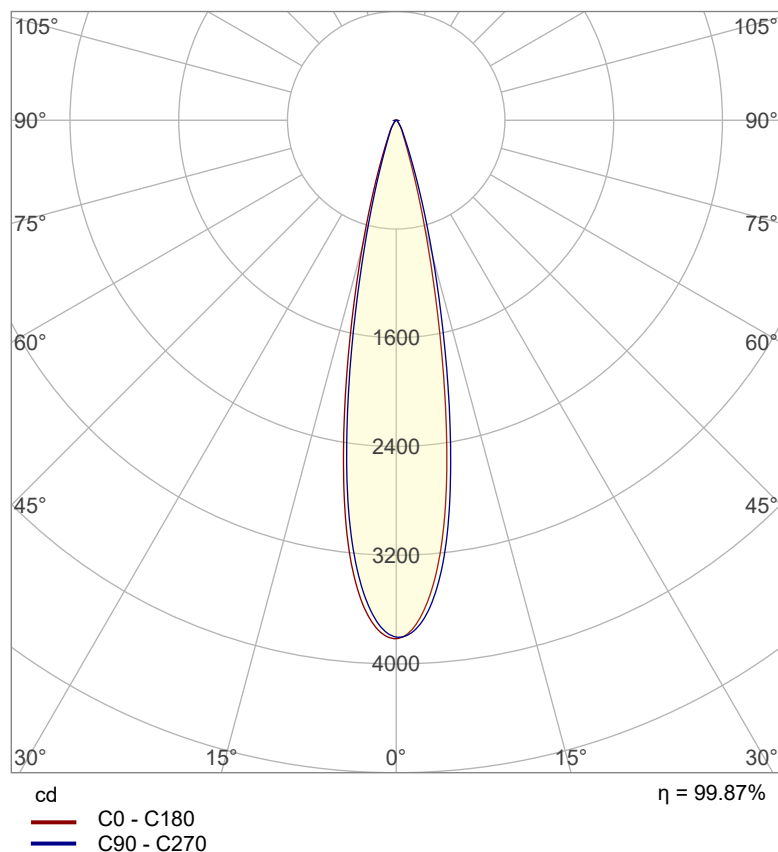


Beam details

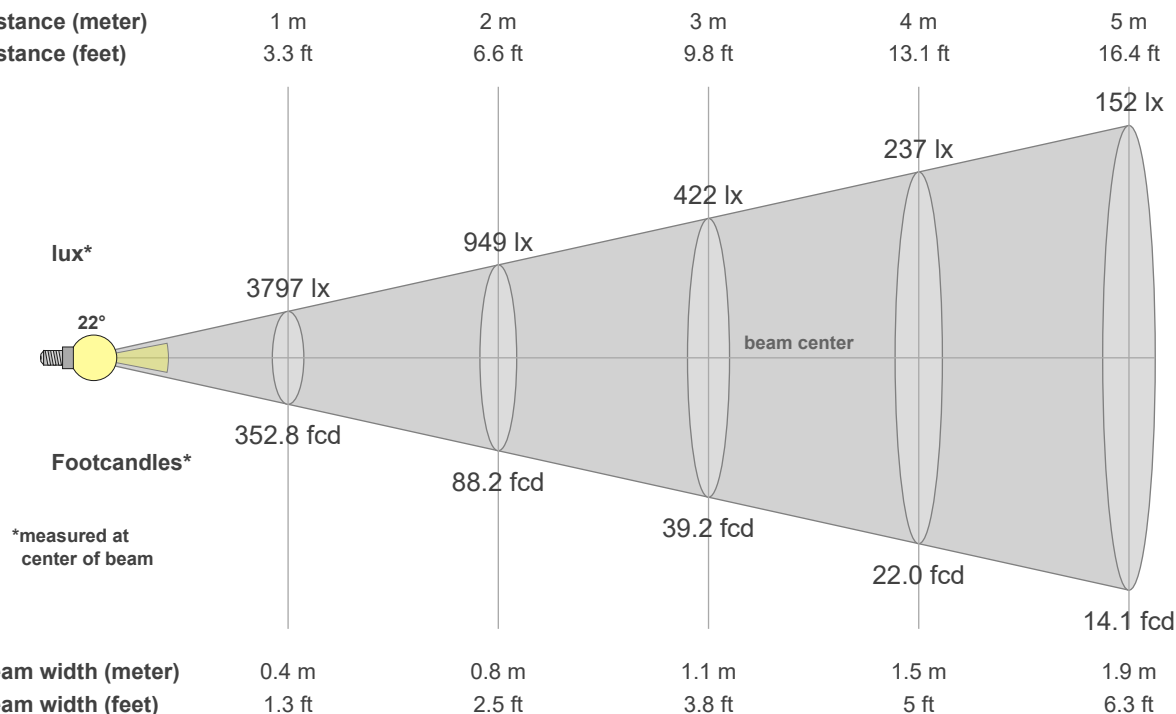


Luminaire budgetary diagram


LAMPS (number of lamps)

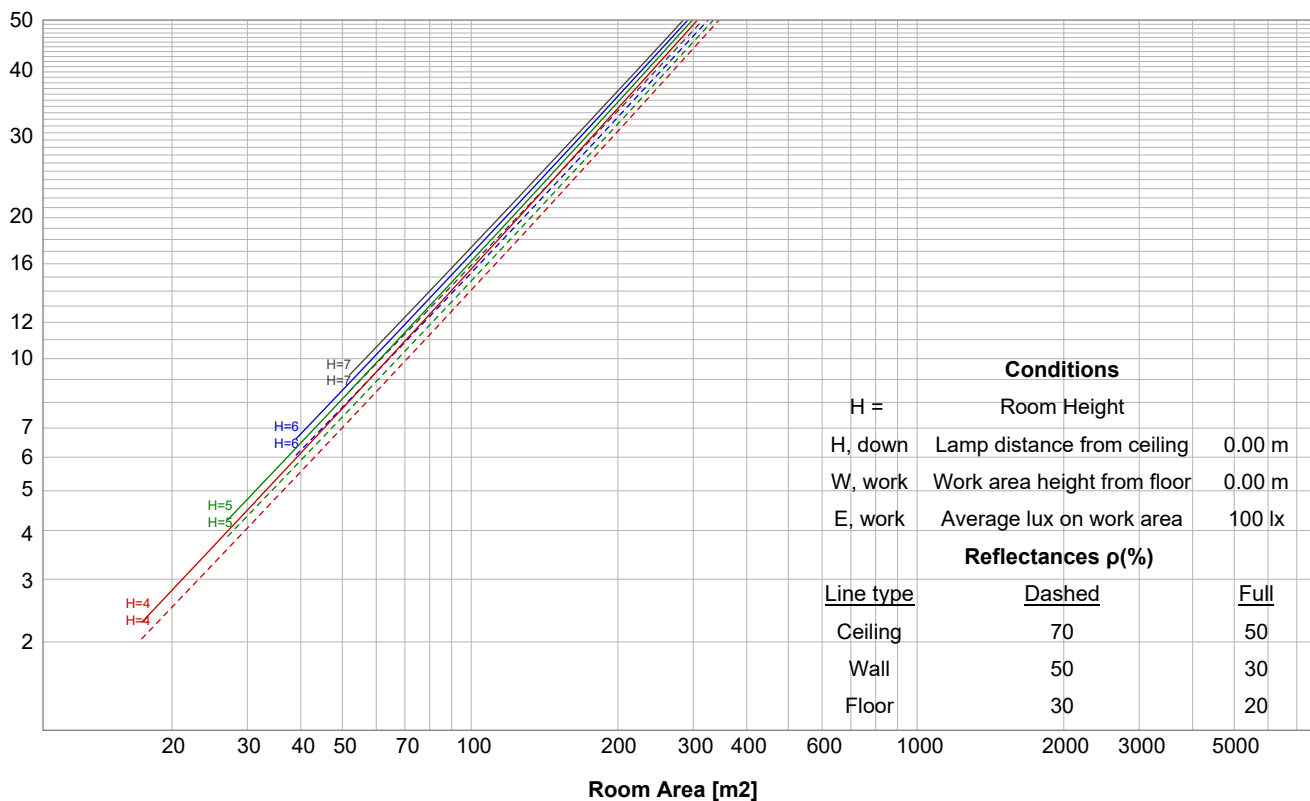


Iso-intensity Diagram (Iso-candela)

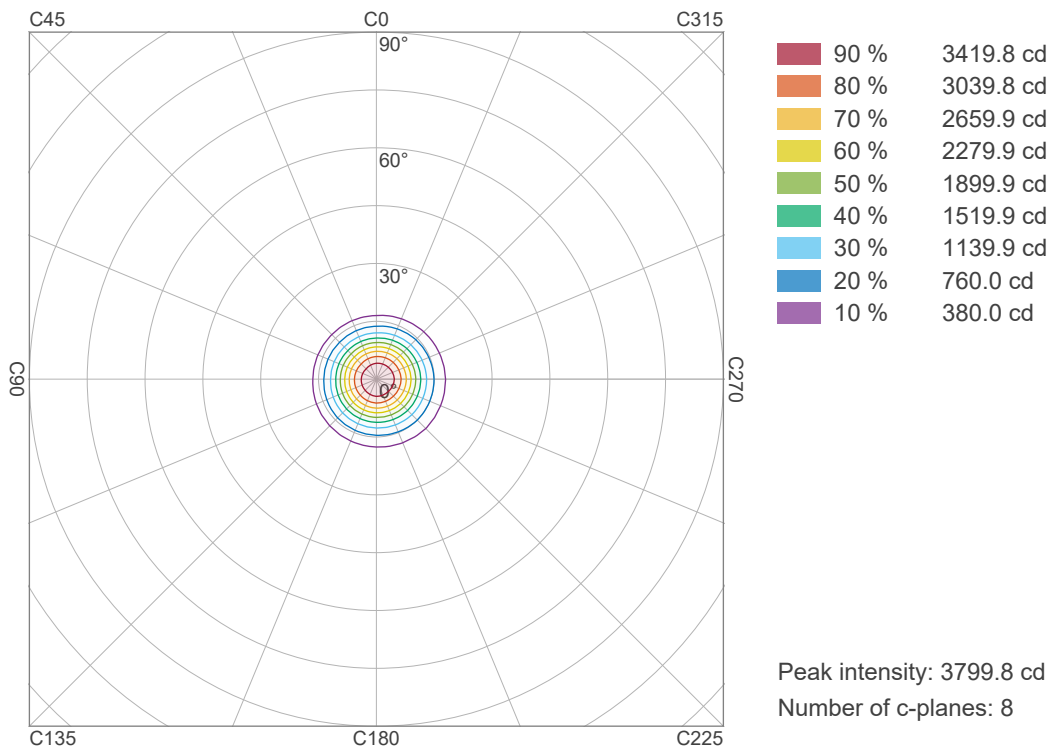

Iso-illuminance Diagram (Iso-lux)

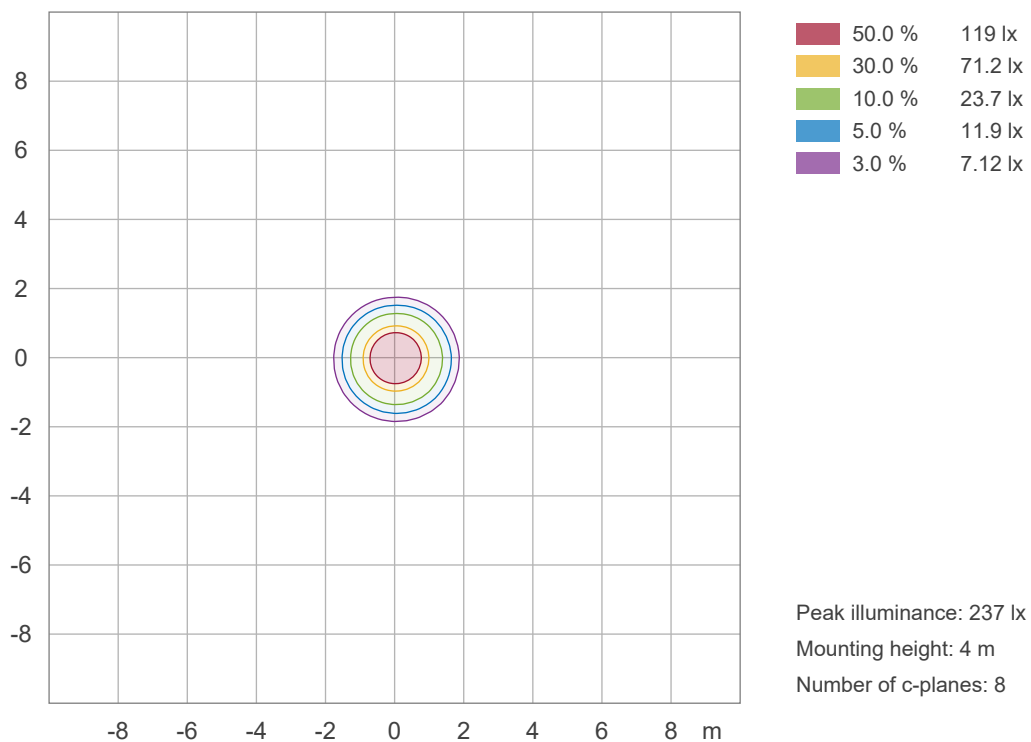


Linear intensity distribution diagram

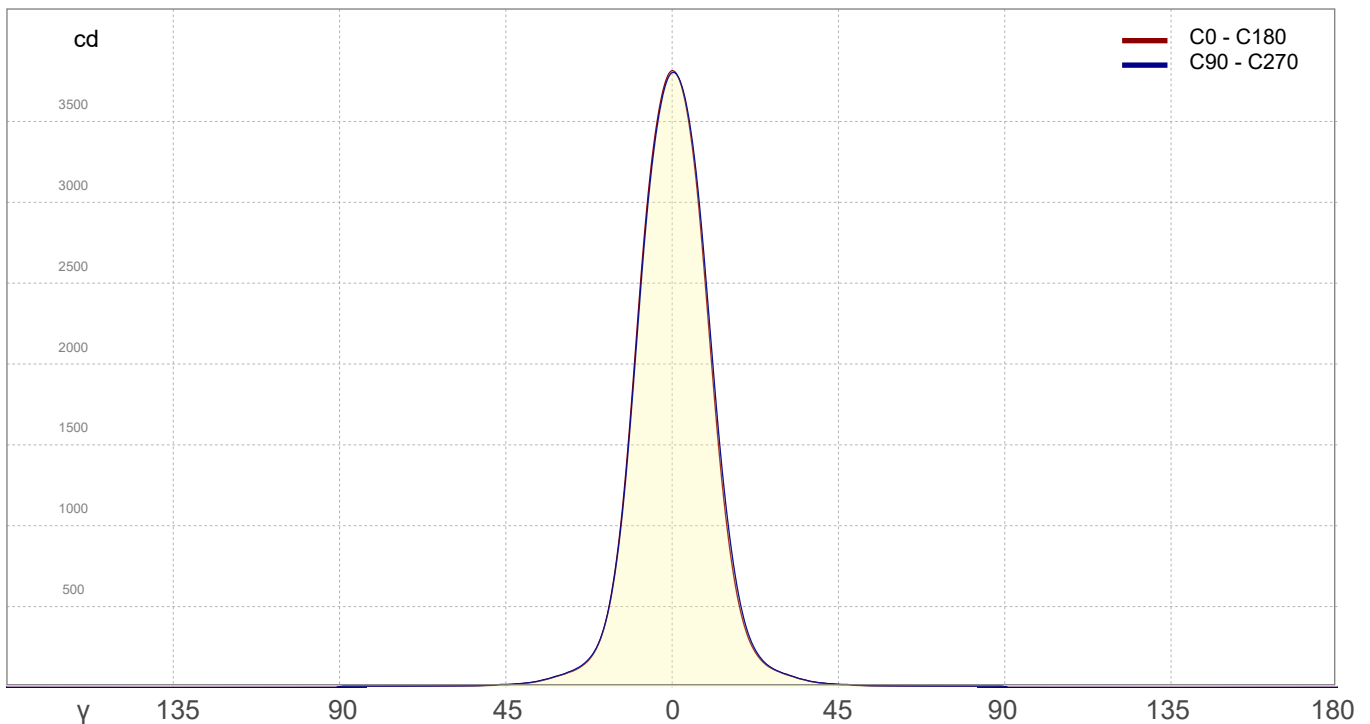

IESNA TM-15-07 Luminaire Classification System For Outdoor Luminaires

BUG rating B1 U0 G0

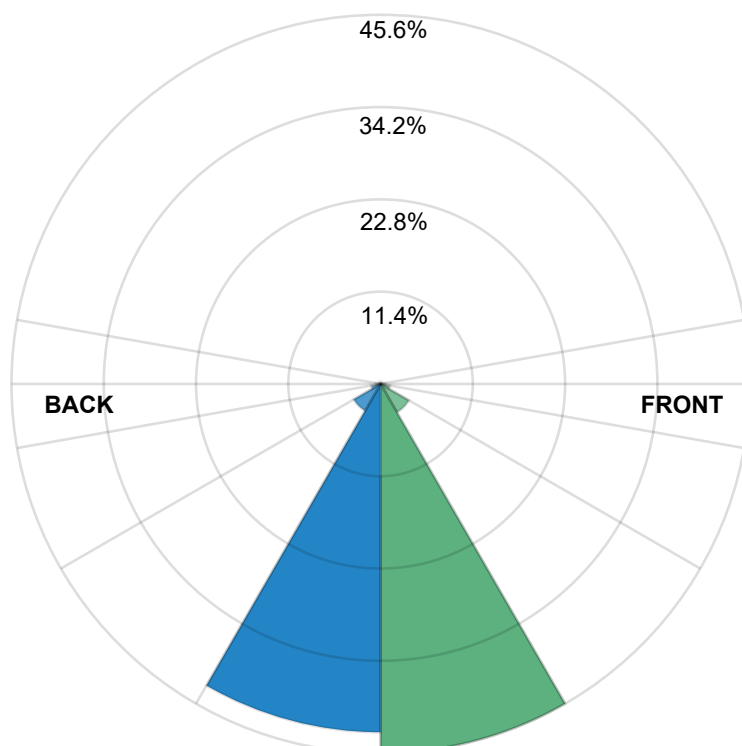

Forward Light

Low (0-30°)	314.9 lm	45.6%
Medium (30-60°)	27.9 lm	4.0%
High (60-80°)	8.1 lm	1.2%
Very High (80-90°)	4.0 lm	0.6%

Back Light

Low (0-30°)	297.1 lm	43.0%
Medium (30-60°)	26.5 lm	3.8%
High (60-80°)	8.1 lm	1.2%
Very High (80-90°)	4.0 lm	0.6%

Uplight

Low (90-100°)	0.0 lm	0.00%
High (100-180°)	0.0 lm	0.0%

Total

Sum	690.6 lm	100,0%
-----	----------	--------