

Light measurement report



Laboratory and Equipment

Test lab	n/a
Spectrometer Manufacturer and Model	n/a, n/a – n/a
Measurement date	7/6/2026

Measurement Conditions

Tested c-planes	8
Tested gamma angles	181 – 1.00°
Input Power	7.14 W


Tested Light Source

Luminaire	2021/7/5 8:49:37
Basic Luminous Shape	PANEL
Item No.	
Manufacturer	Moon On Noon


Main Light Measurement Results

Output – Total Lumen (Up% / Down%)	363.1 lm – 0.001% / 100%
Efficiency	50.86 lm/W
Peak Intensity	651.9 cd
Correlated Color Temperature, CCT	3000 K
Color Rendering Index	CRI 85.0

Polar light distribution diagram

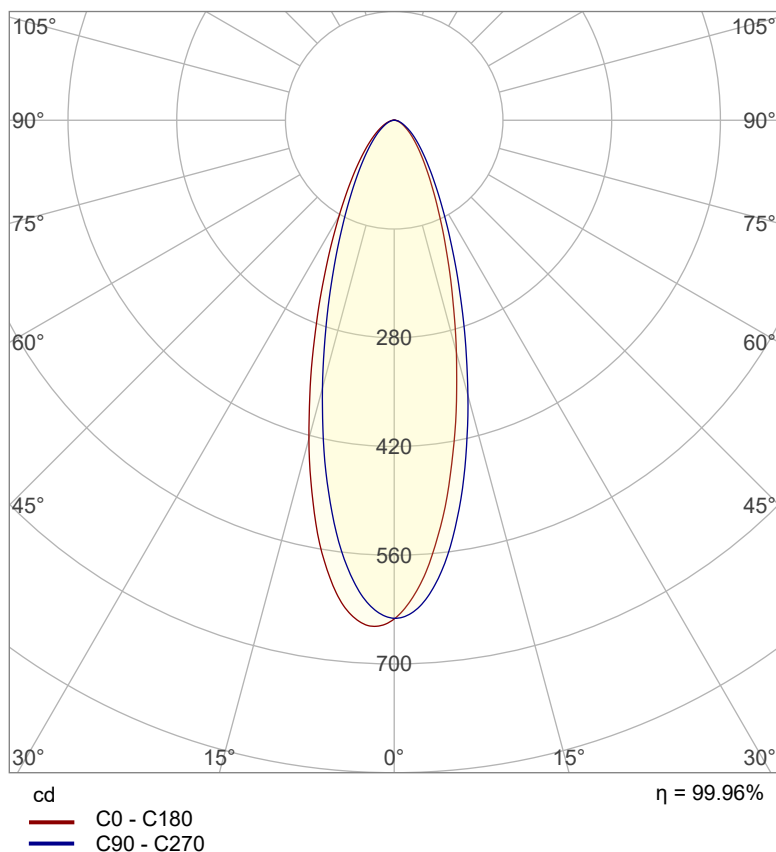


Beam details

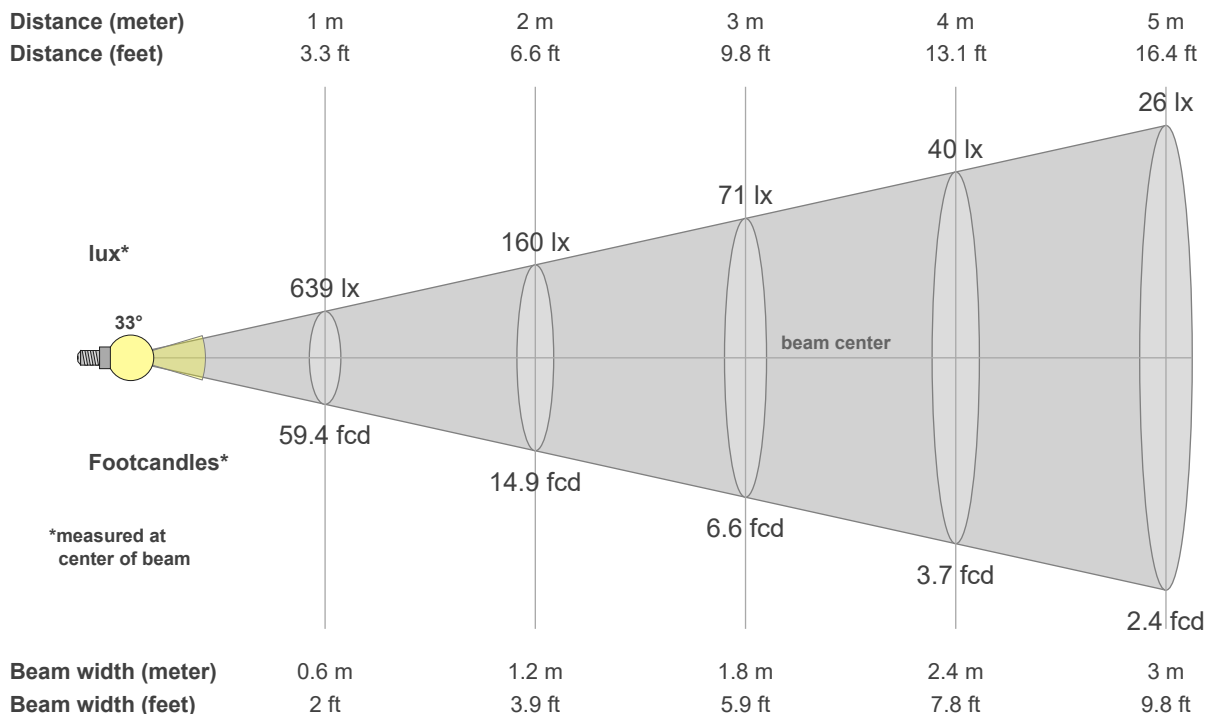


Luminaire budgetary diagram


LAMPS (number of lamps)

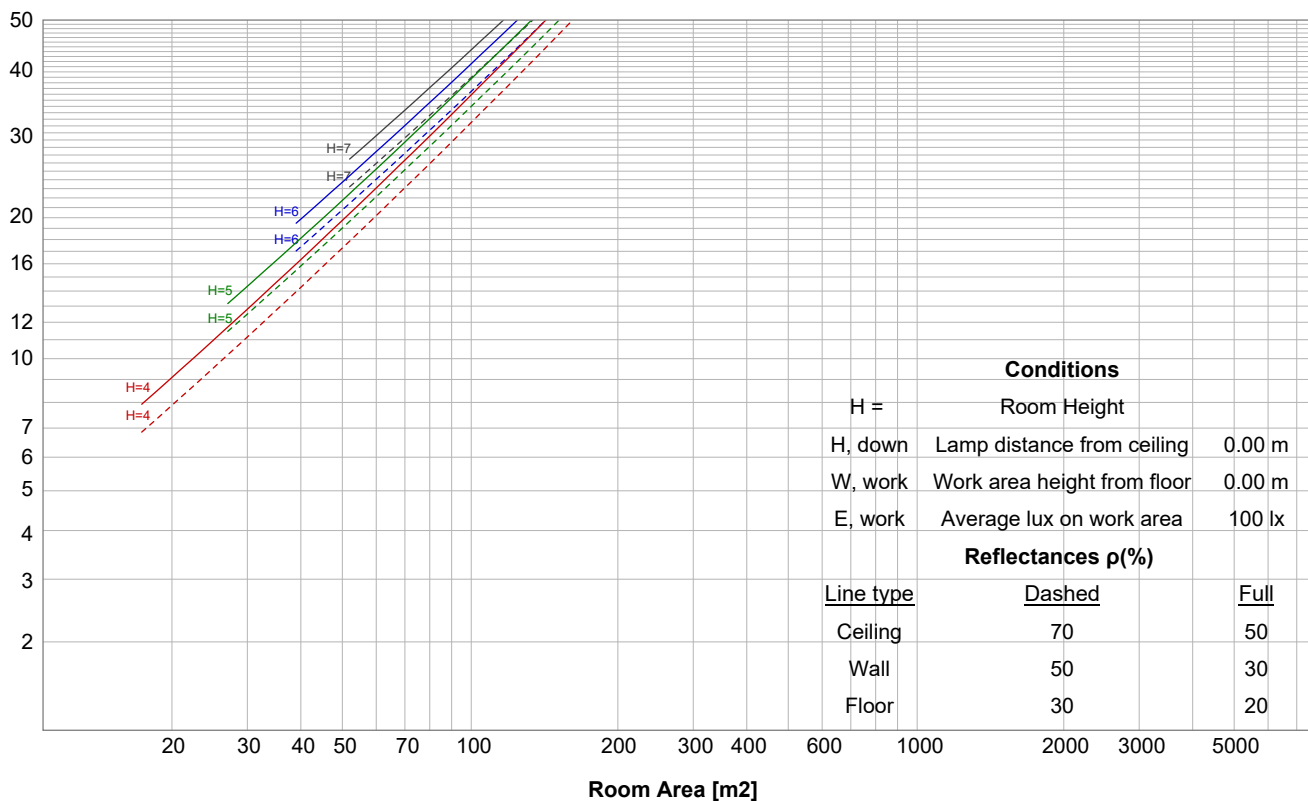


Iso-intensity Diagram (Iso-candela)

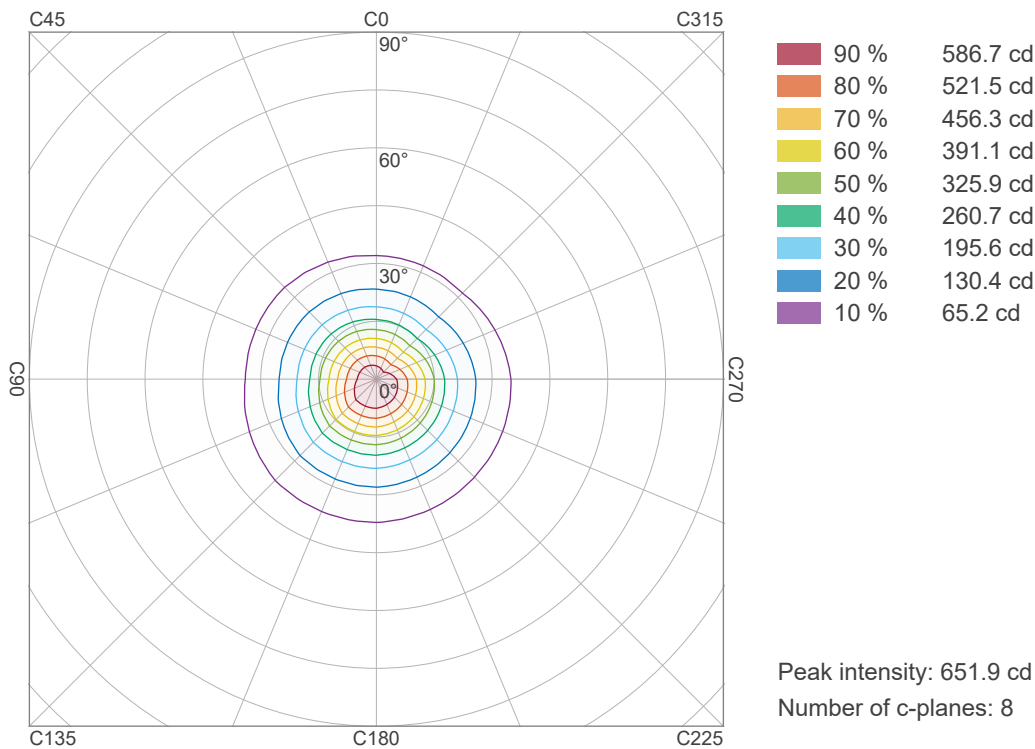

Iso-illuminance Diagram (Iso-lux)

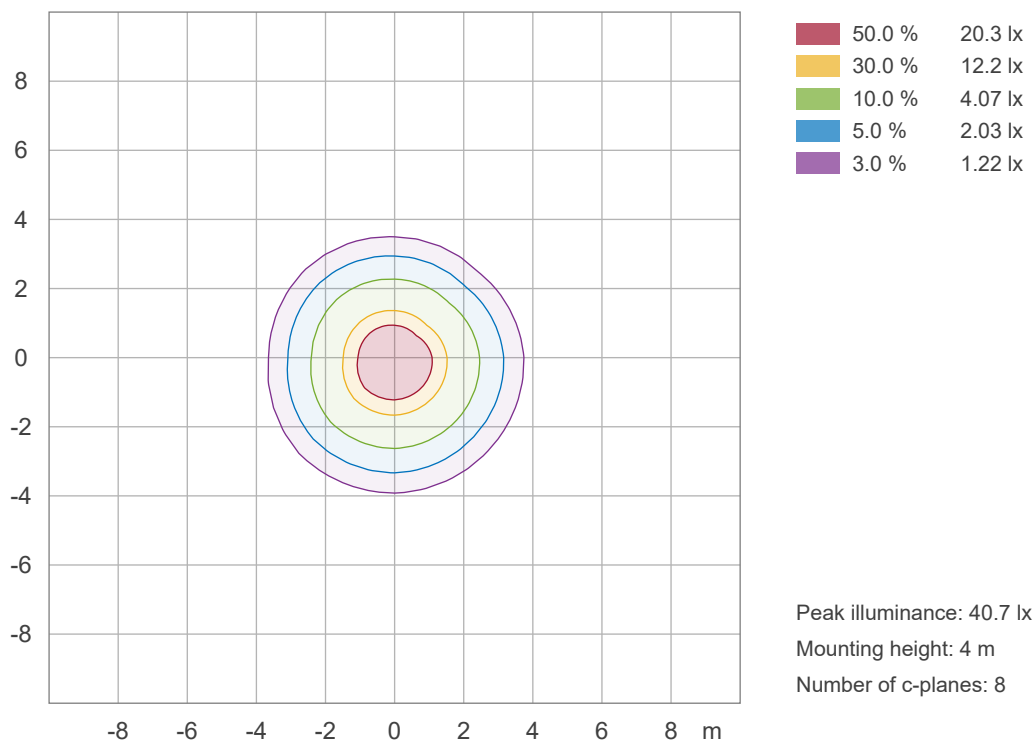


Linear intensity distribution diagram

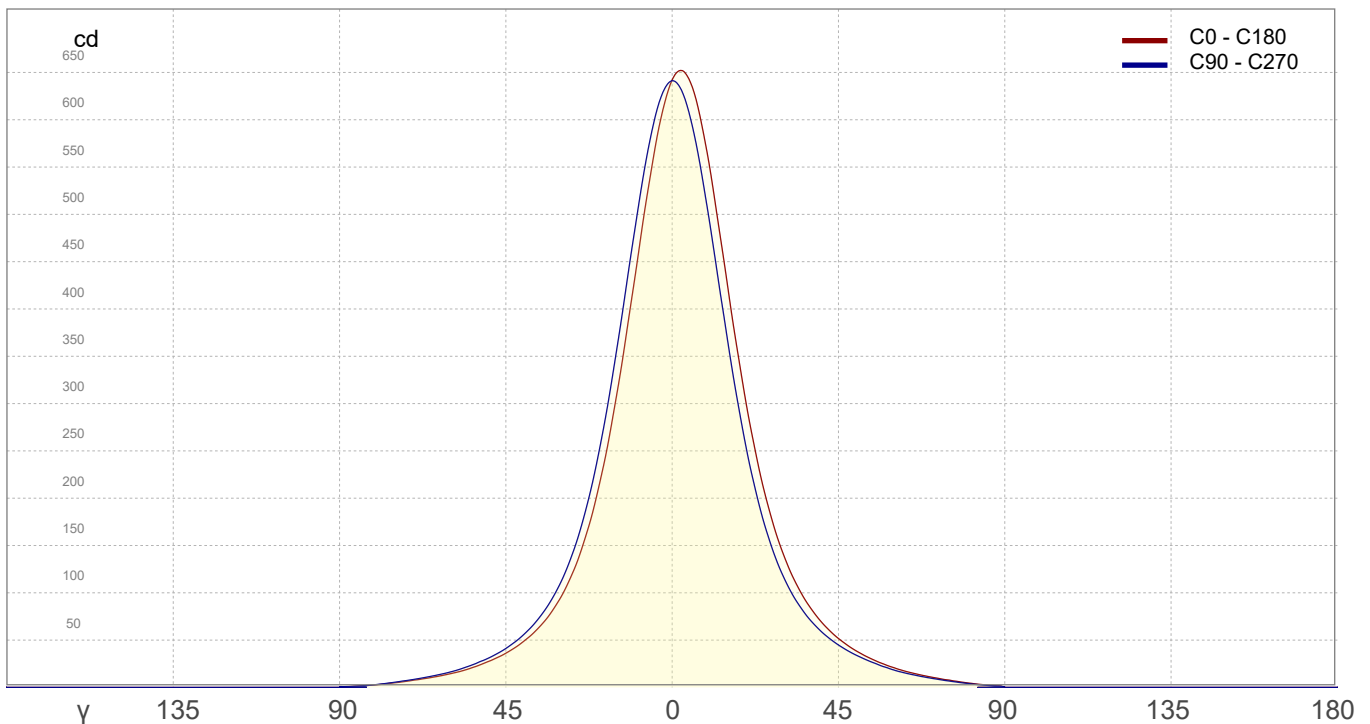

IESNA TM-15-07 Luminaire Classification System For Outdoor Luminaires

BUG rating B0 U0 G0

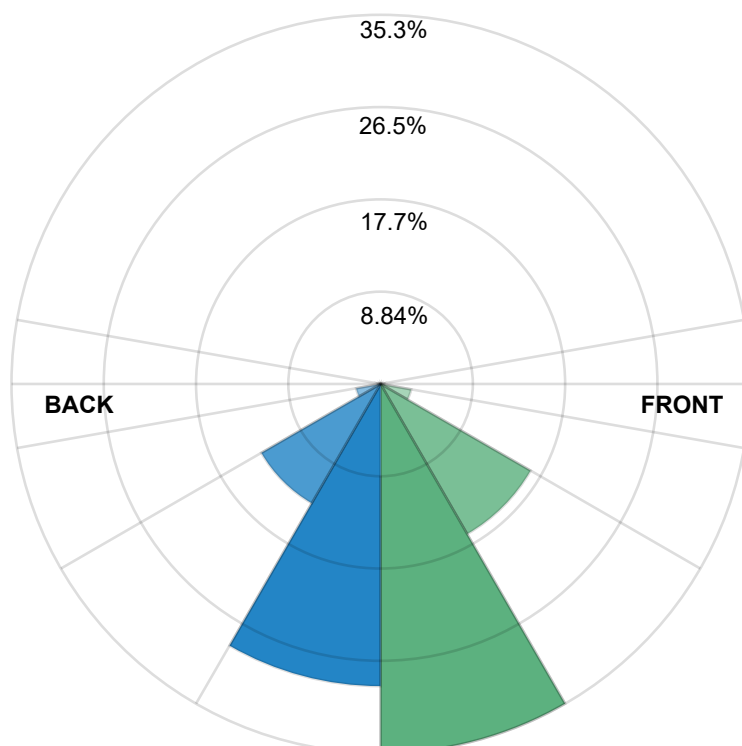

Forward Light

Low (0-30°)	128.3 lm	35.3%
Medium (30-60°)	60.2 lm	16.6%
High (60-80°)	10.8 lm	3.0%
Very High (80-90°)	1.3 lm	0.3%

Back Light

Low (0-30°)	105.0 lm	28.9%
Medium (30-60°)	47.9 lm	13.2%
High (60-80°)	8.6 lm	2.4%
Very High (80-90°)	0.9 lm	0.3%

Uplight

Low (90-100°)	0.0 lm	0.00%
High (100-180°)	0.0 lm	0.0%

Total

Sum	363.1 lm	100,0%
-----	----------	--------