

Light measurement report



Laboratory and Equipment

Test lab	n/a
Spectrometer Manufacturer and Model	n/a, n/a – n/a
Measurement date	7/6/2026

Measurement Conditions

Tested c-planes	8
Tested gamma angles	181 – 1.00°
Input Power	7.25 W


Tested Light Source

Luminaire	2021/7/5 9:50:47
Basic Luminous Shape	PANEL
Item No.	
Manufacturer	Moon On Noon


Main Light Measurement Results

Output – Total Lumen (Up% / Down%)	342.4 lm – 0.0006% / 100%
Efficiency	47.23 lm/W
Peak Intensity	1717 cd
Correlated Color Temperature, CCT	3000 K
Color Rendering Index	CRI 85.0

Polar light distribution diagram

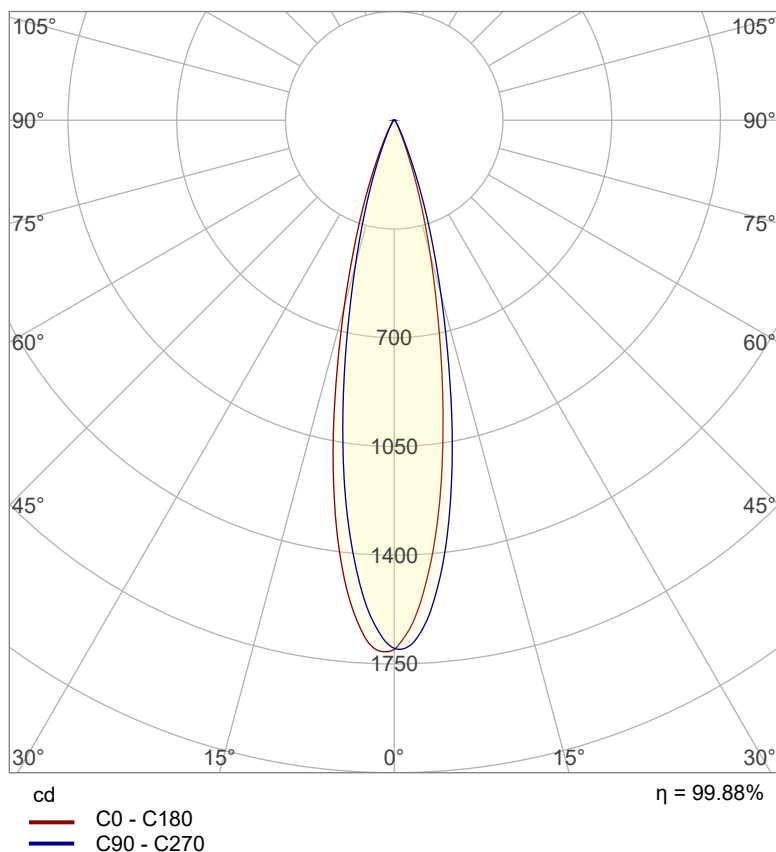


Beam details

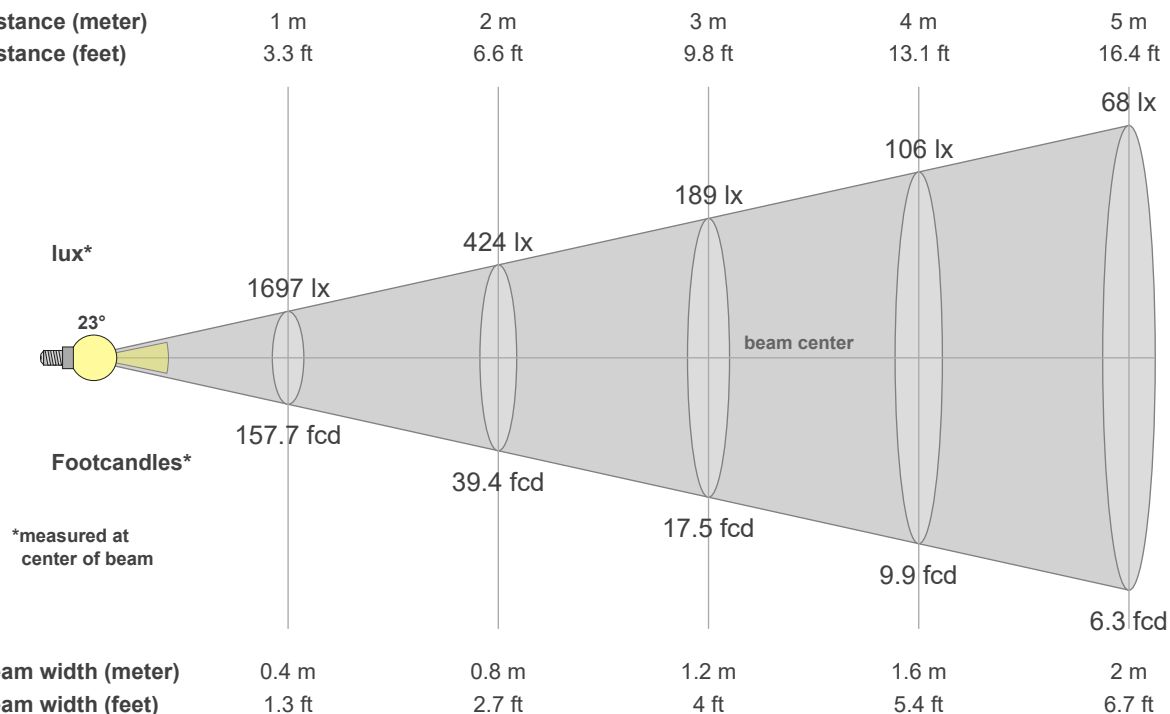


Luminaire budgetary diagram


LAMPS (number of lamps)

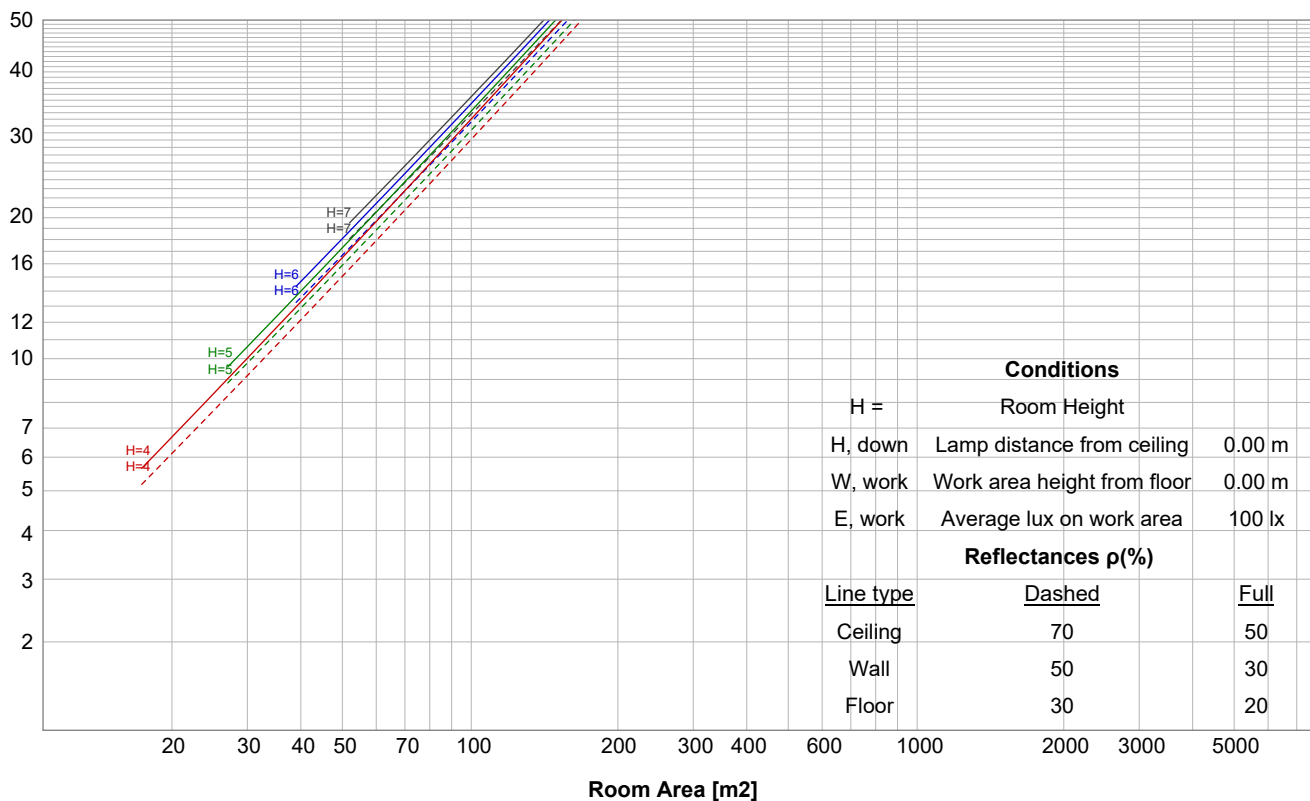


Iso-intensity Diagram (Iso-candela)

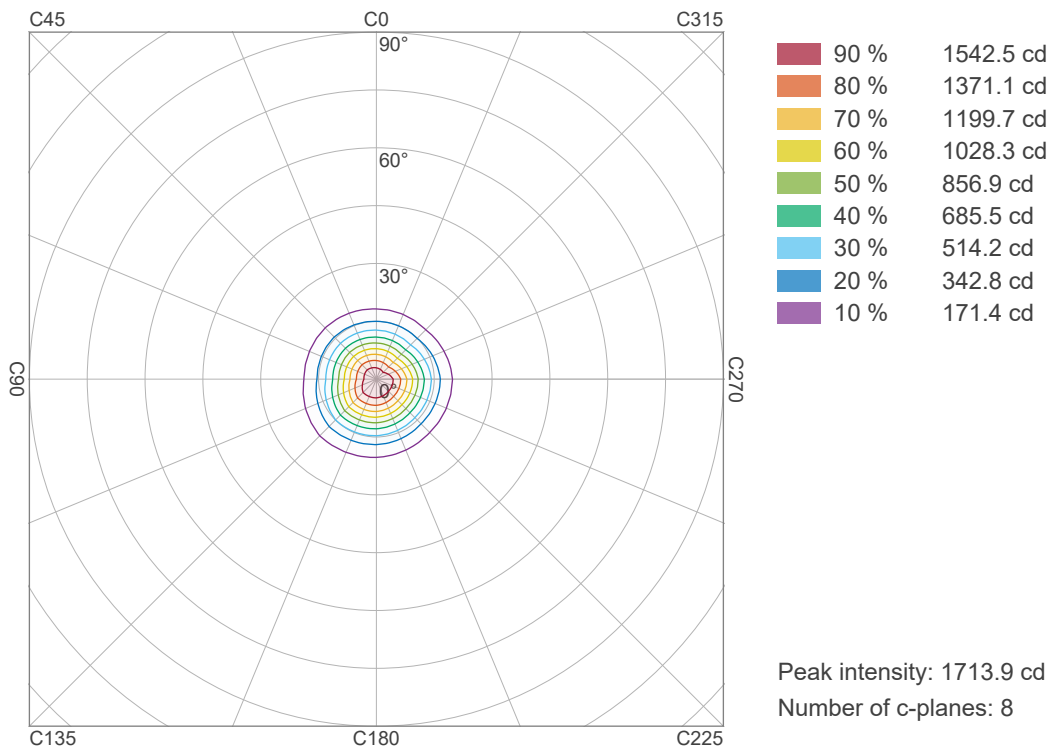

Iso-illuminance Diagram (Iso-lux)

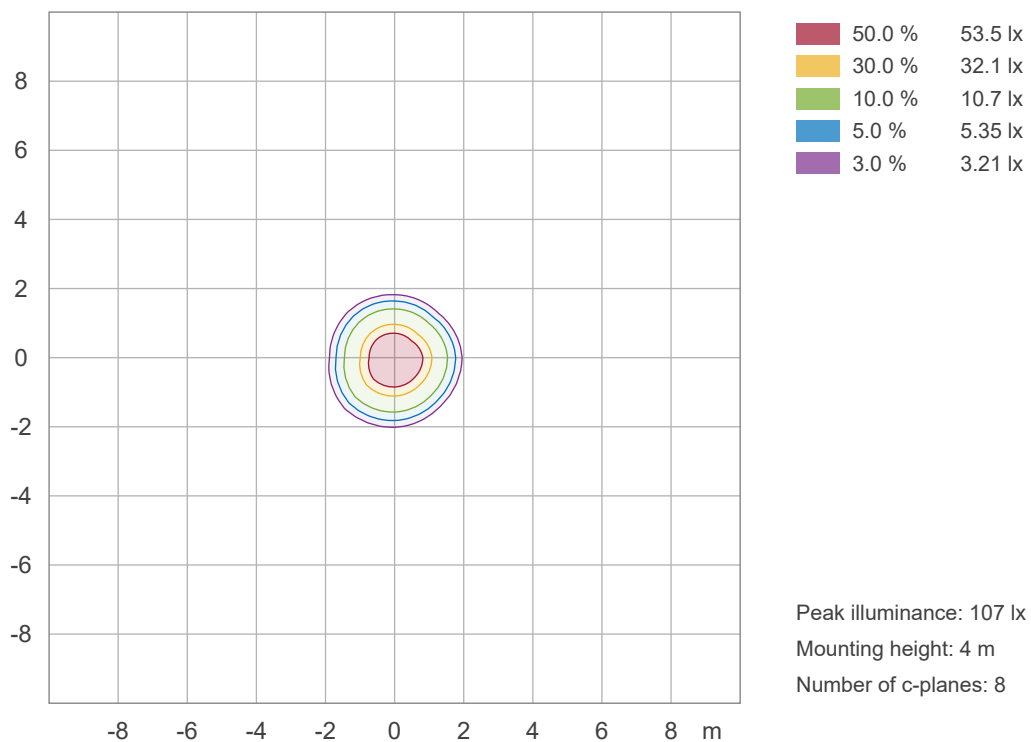


Linear intensity distribution diagram

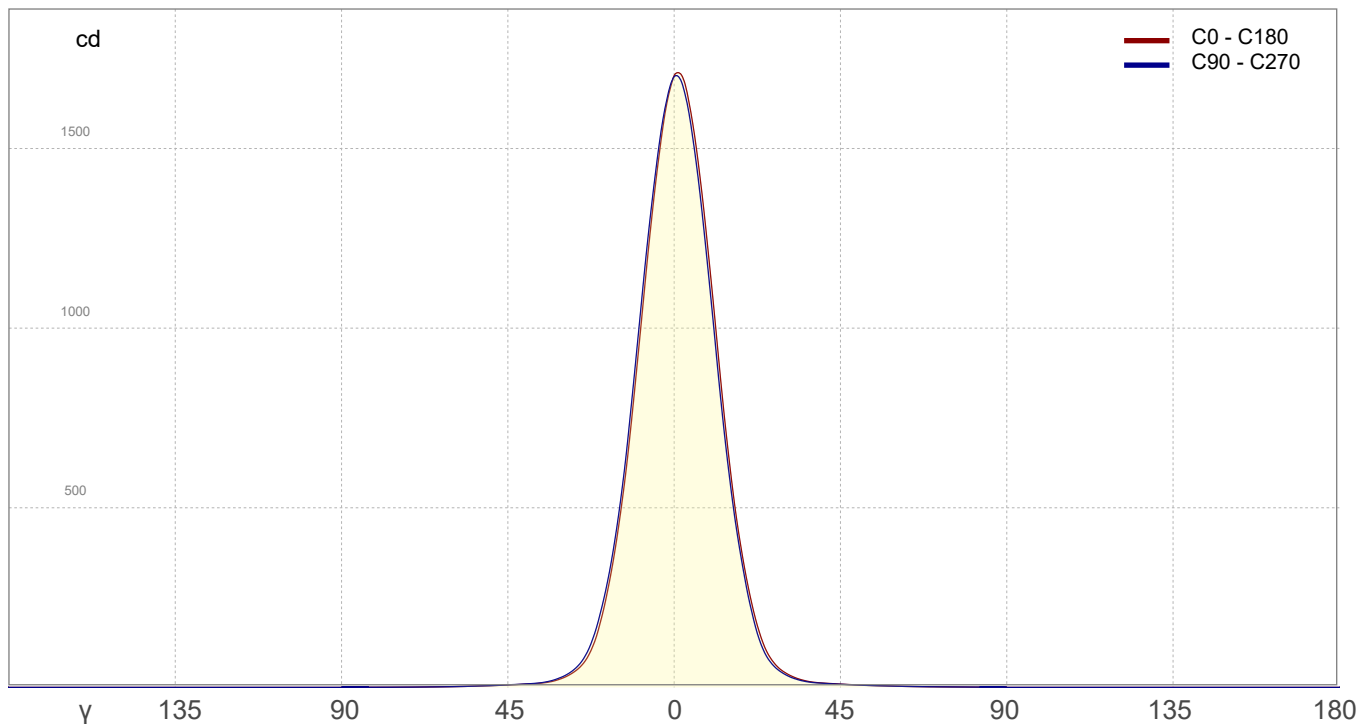

IESNA TM-15-07 Luminaire Classification System For Outdoor Luminaires

BUG rating B1 U0 G0

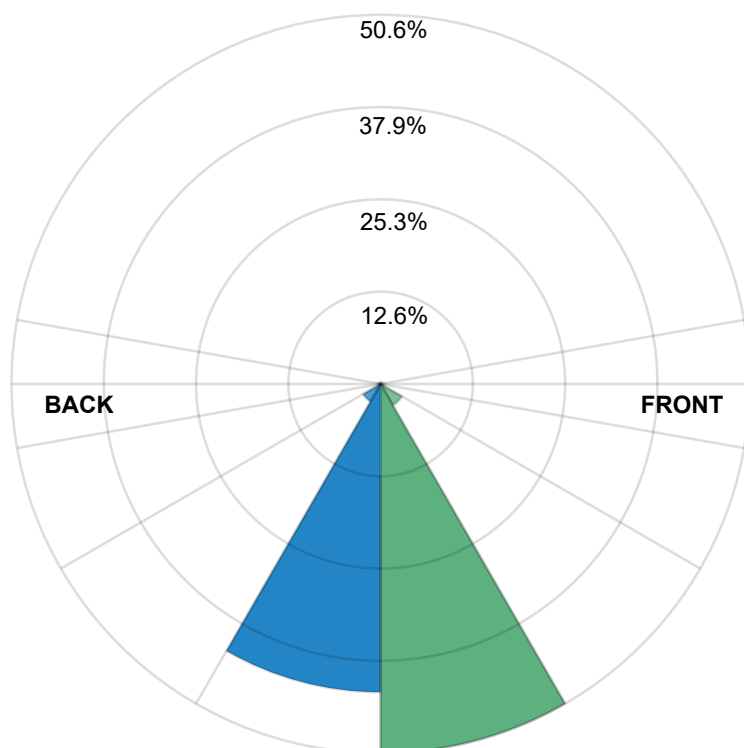

Forward Light

Low (0-30°)	173.1 lm	50.6%
Medium (30-60°)	11.6 lm	3.4%
High (60-80°)	1.6 lm	0.5%
Very High (80-90°)	0.3 lm	0.1%

Back Light

Low (0-30°)	144.6 lm	42.2%
Medium (30-60°)	9.6 lm	2.8%
High (60-80°)	1.3 lm	0.4%
Very High (80-90°)	0.3 lm	0.1%

Uplight

Low (90-100°)	0.0 lm	0.00%
High (100-180°)	0.0 lm	0.0%

Total

Sum	342.4 lm	100,0%
-----	----------	--------