

Light measurement report



Laboratory and Equipment

Test lab	n/a
Spectrometer Manufacturer and Model	n/a, n/a – n/a
Measurement date	7/14/2026

Measurement Conditions

Tested c-planes	12
Tested gamma angles	181 – 1.00°
Input Power	1.71 W


Tested Light Source

Luminaire	2022/10/20 14:05:25
Basic Luminous Shape	PANEL
Item No.	
Manufacturer	Moon On Noon


Main Light Measurement Results

Output – Total Lumen (Up% / Down%)	49.01 lm – 0.0005% / 100%
Efficiency	28.66 lm/W
Peak Intensity	239.7 cd
Correlated Color Temperature, CCT	3000 K
Color Rendering Index	CRI 85.0

Polar light distribution diagram

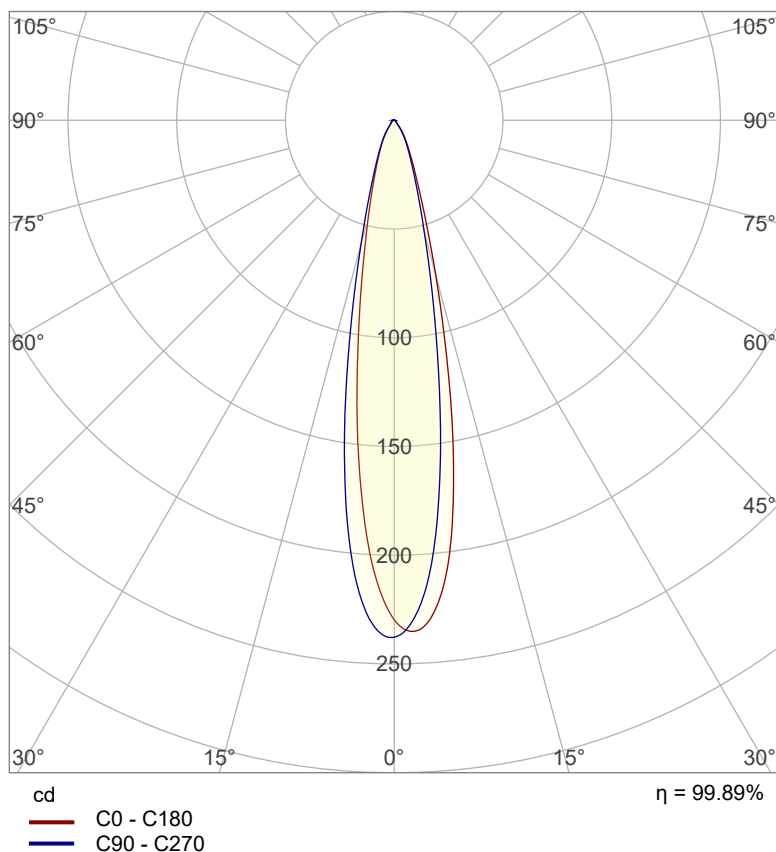


Beam details

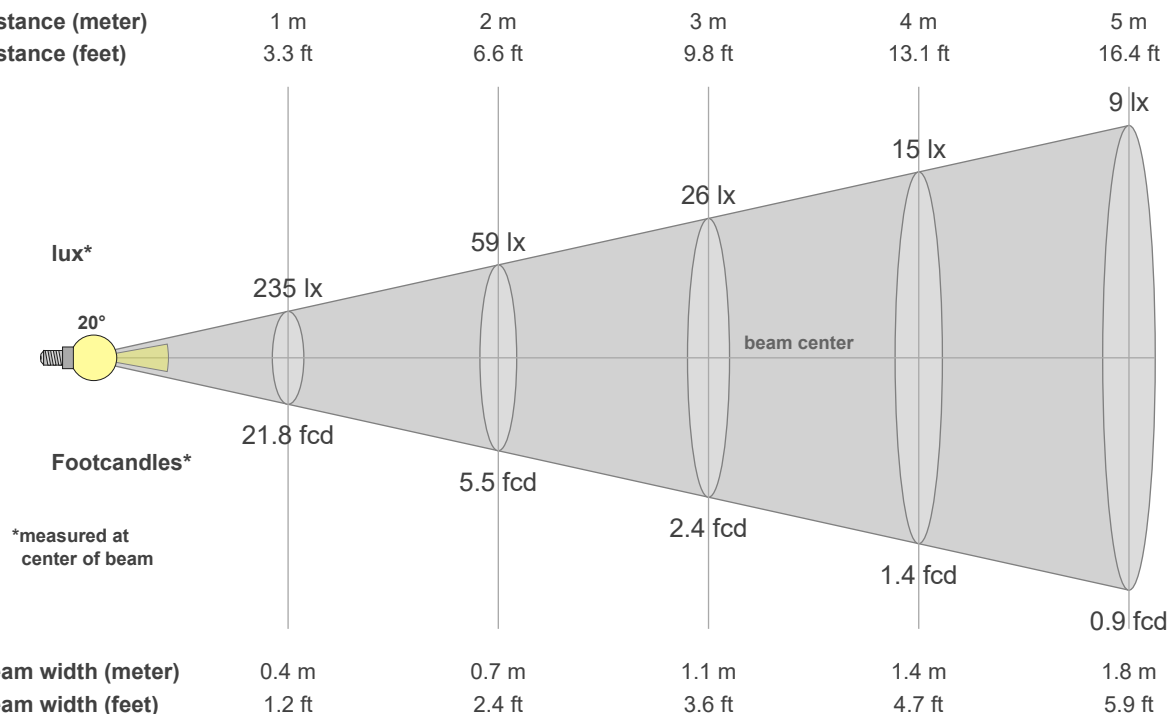


Luminaire budgetary diagram


LAMPS (number of lamps)

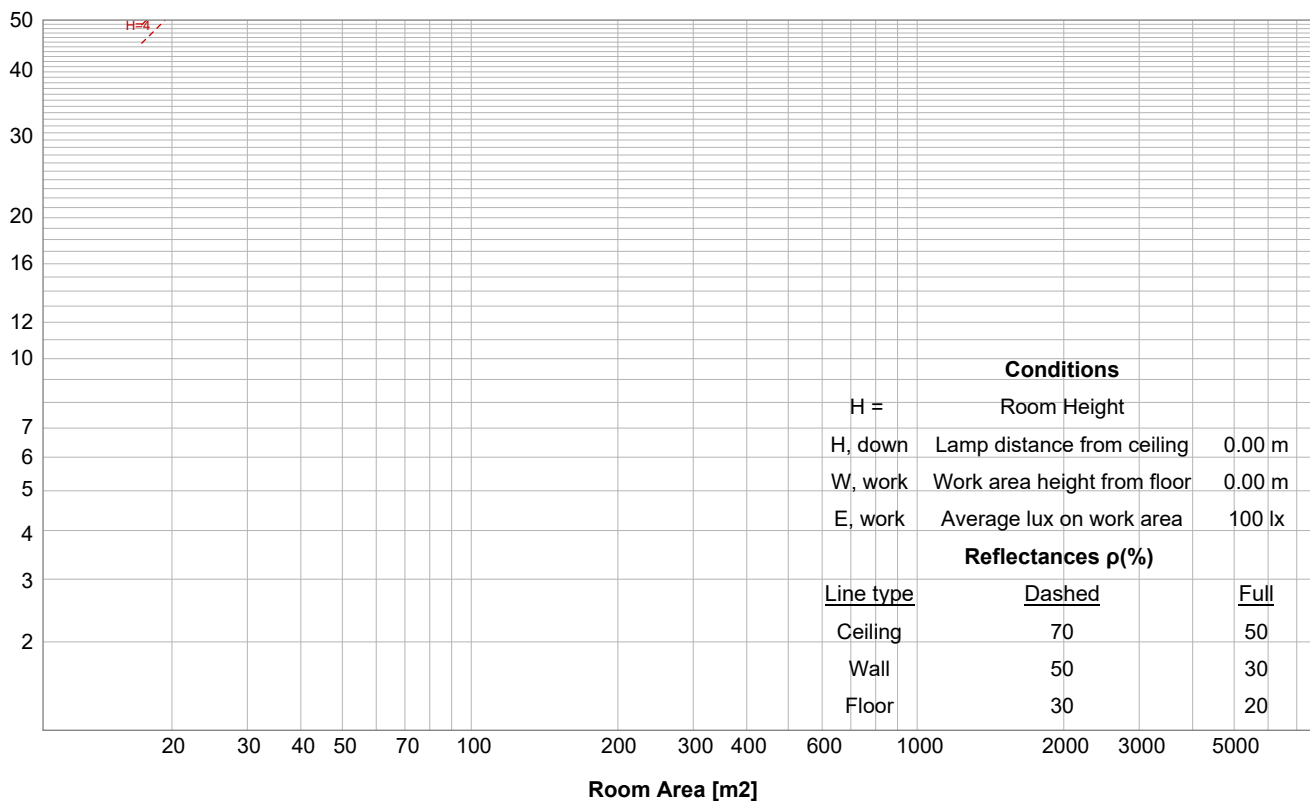


Iso-intensity Diagram (Iso-candela)

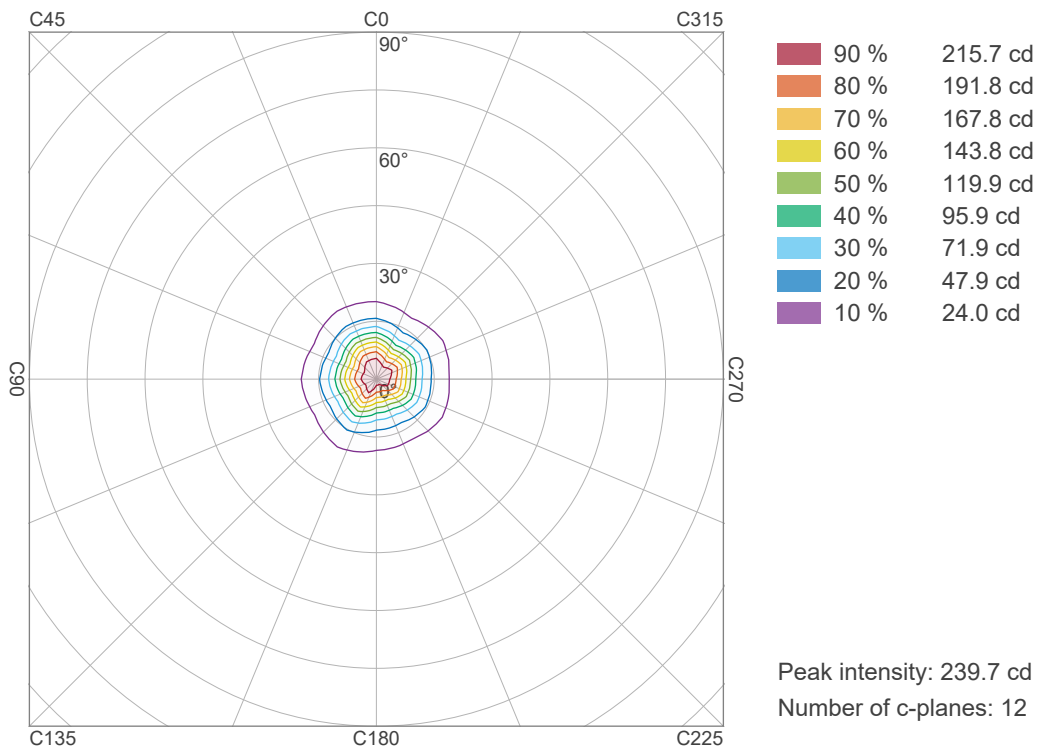

Iso-illuminance Diagram (Iso-lux)

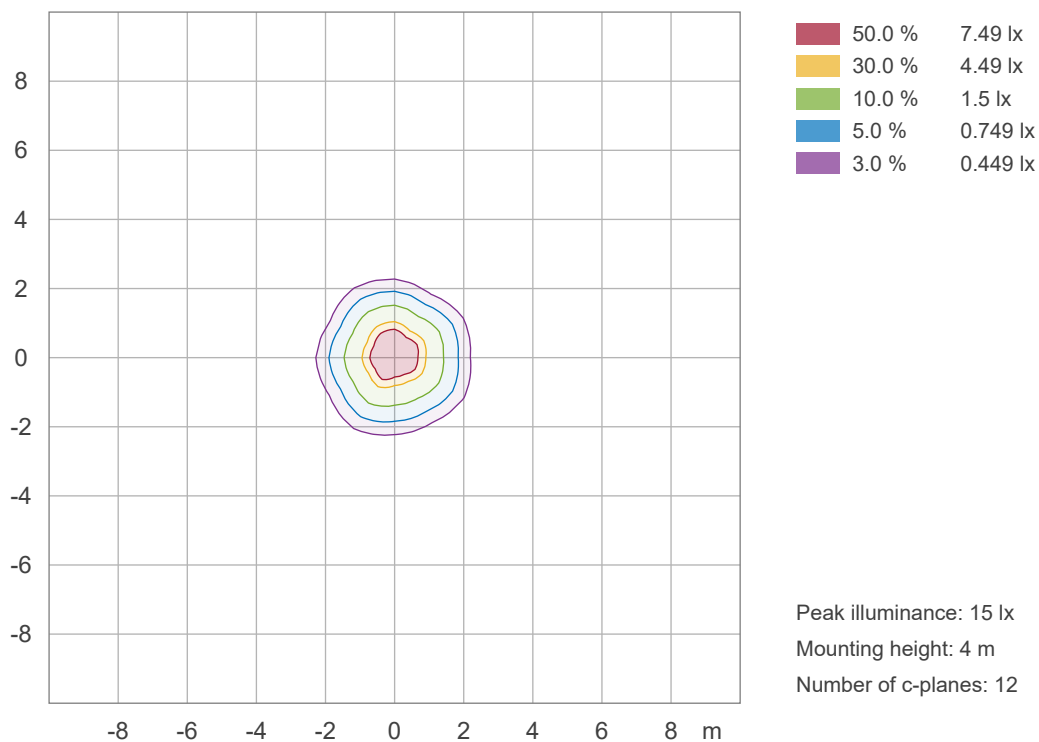


Linear intensity distribution diagram

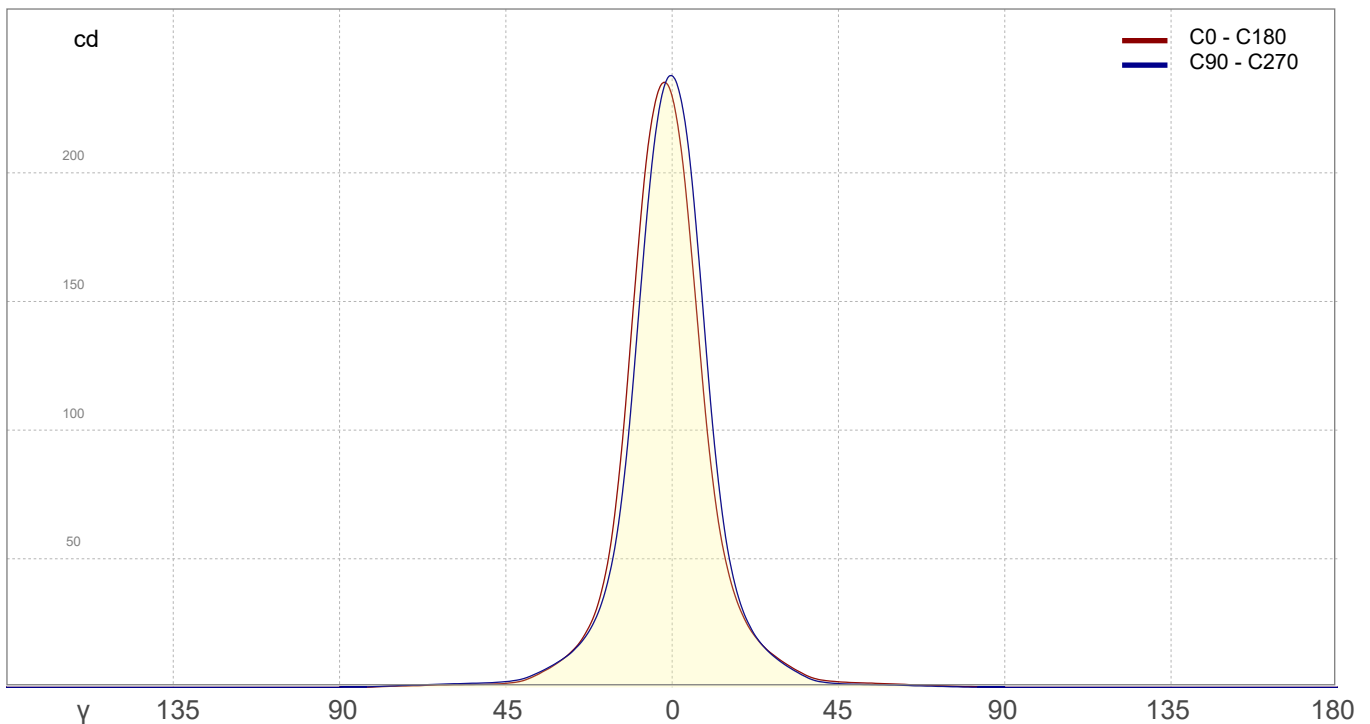

IESNA TM-15-07 Luminaire Classification System For Outdoor Luminaires

BUG rating B0 U0 G0

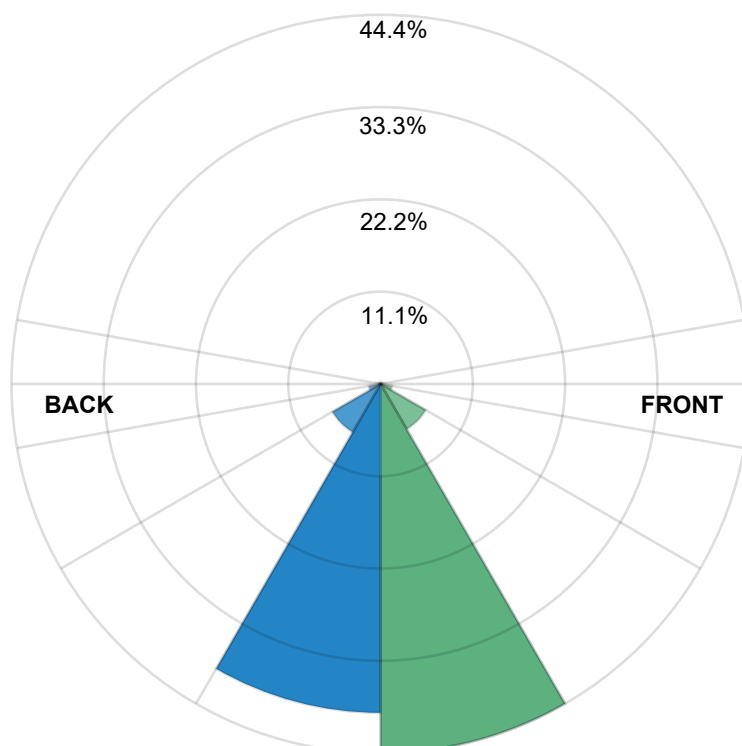

Forward Light

Low (0-30°)	21.7 lm	44.4%
Medium (30-60°)	3.1 lm	6.3%
High (60-80°)	0.7 lm	1.4%
Very High (80-90°)	0.1 lm	0.2%

Back Light

Low (0-30°)	19.4 lm	39.5%
Medium (30-60°)	3.3 lm	6.7%
High (60-80°)	0.7 lm	1.4%
Very High (80-90°)	0.1 lm	0.2%

Uplight

Low (90-100°)	0.0 lm	0.00%
High (100-180°)	0.0 lm	0.0%

Total

Sum	49.0 lm	100,0%
-----	---------	--------