

Light measurement report



Laboratory and Equipment

Test lab	n/a
Spectrometer Manufacturer and Model	n/a, n/a – n/a
Measurement date	7/14/2026

Measurement Conditions

Tested c-planes	12
Tested gamma angles	181 – 1.00°
Input Power	4.68 W


Tested Light Source

Luminaire	2022/10/22 10:07:52
Basic Luminous Shape	PANEL
Item No.	
Manufacturer	Moon On Noon


Main Light Measurement Results

Output – Total Lumen (Up% / Down%)	68.64 lm – 0.0006% / 100%
Efficiency	14.67 lm/W
Peak Intensity	771.2 cd
Correlated Color Temperature, CCT	3000 K
Color Rendering Index	CRI 85.0

Polar light distribution diagram

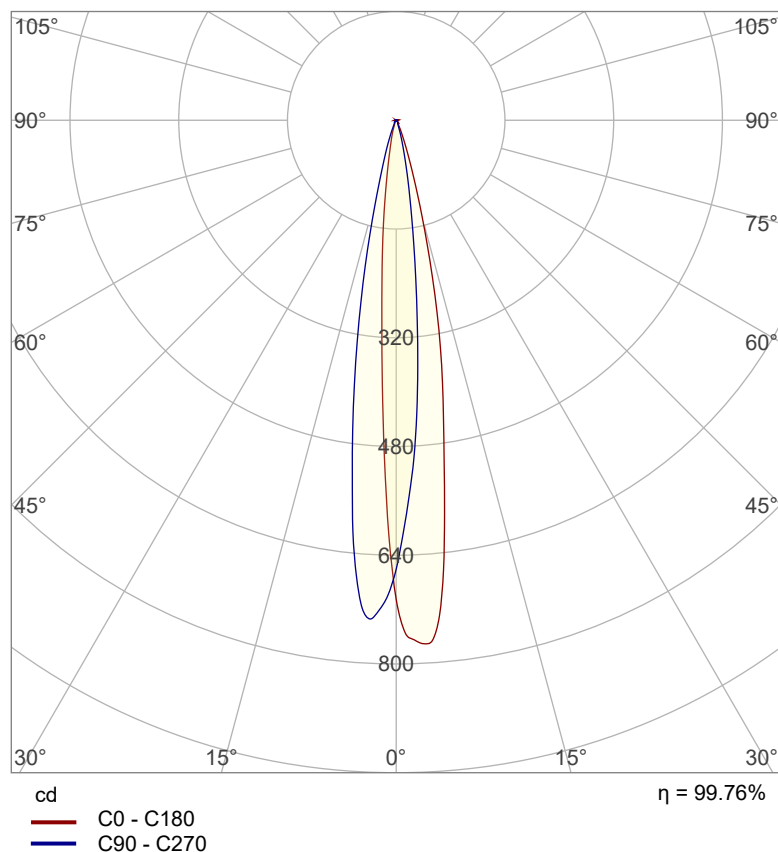


Beam details

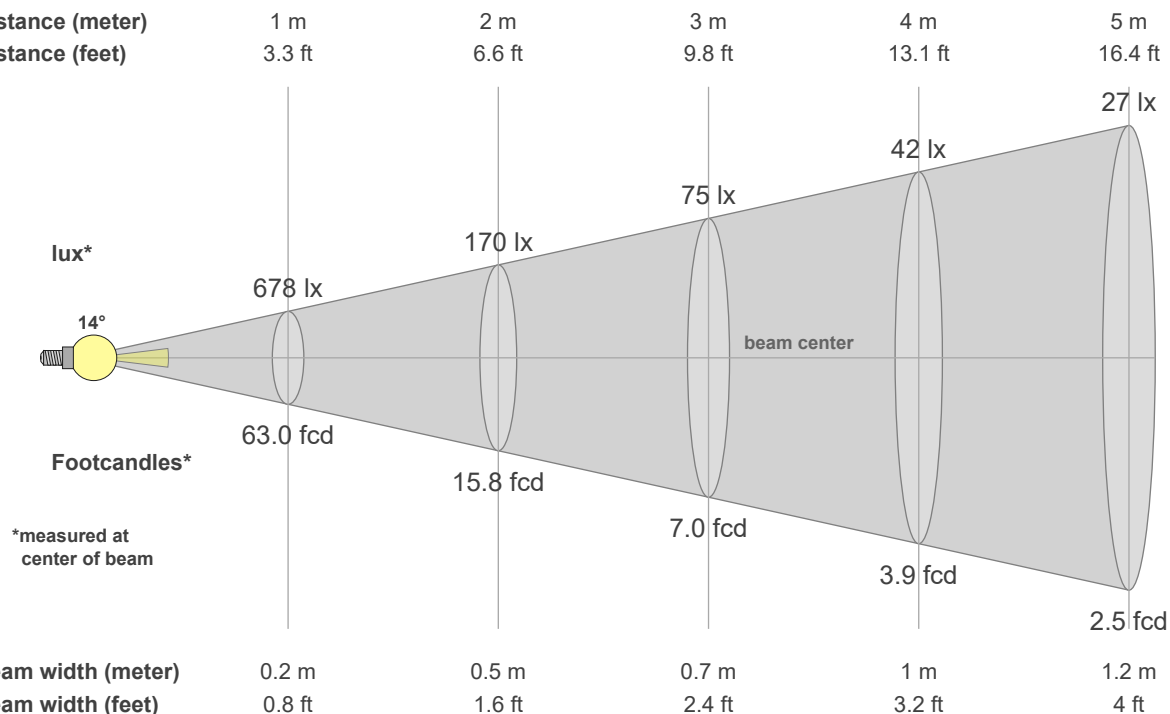


Luminaire budgetary diagram


LAMPS (number of lamps)

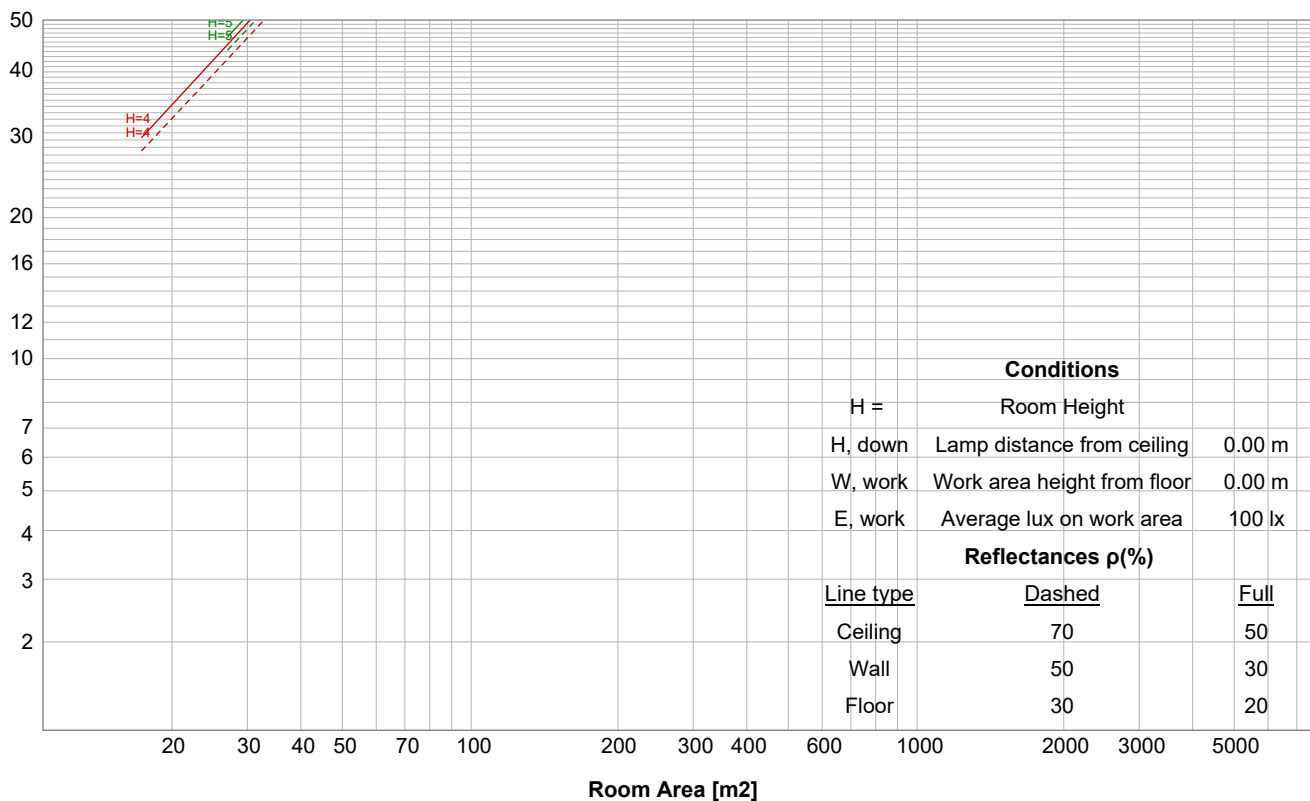


Iso-intensity Diagram (Iso-candela)

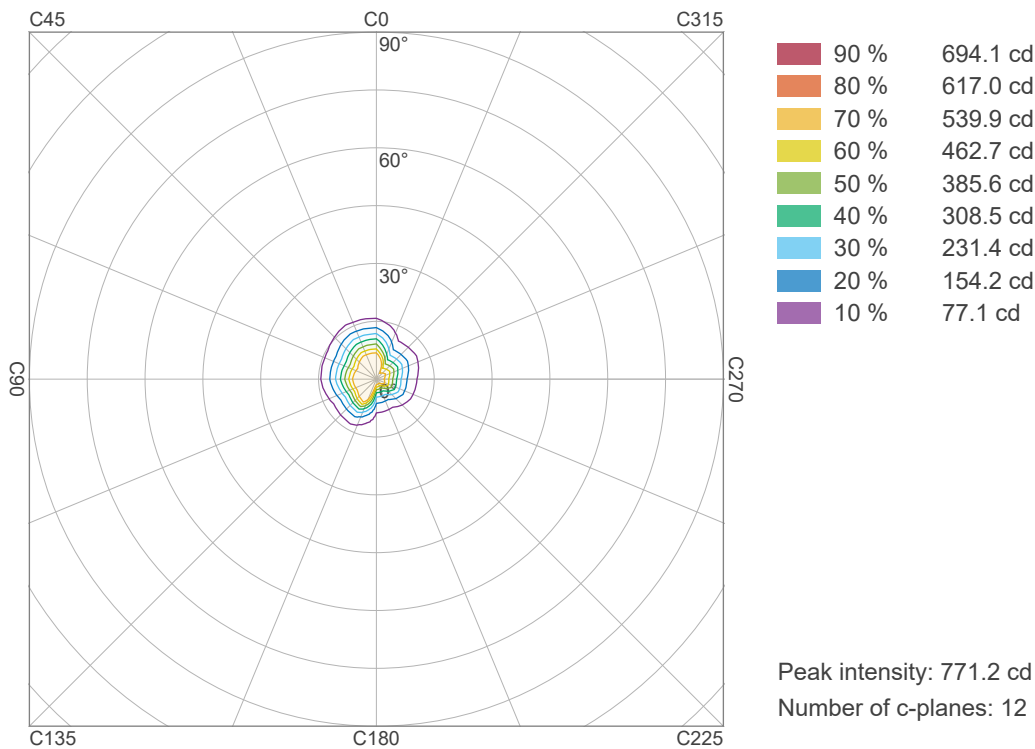

Iso-illuminance Diagram (Iso-lux)

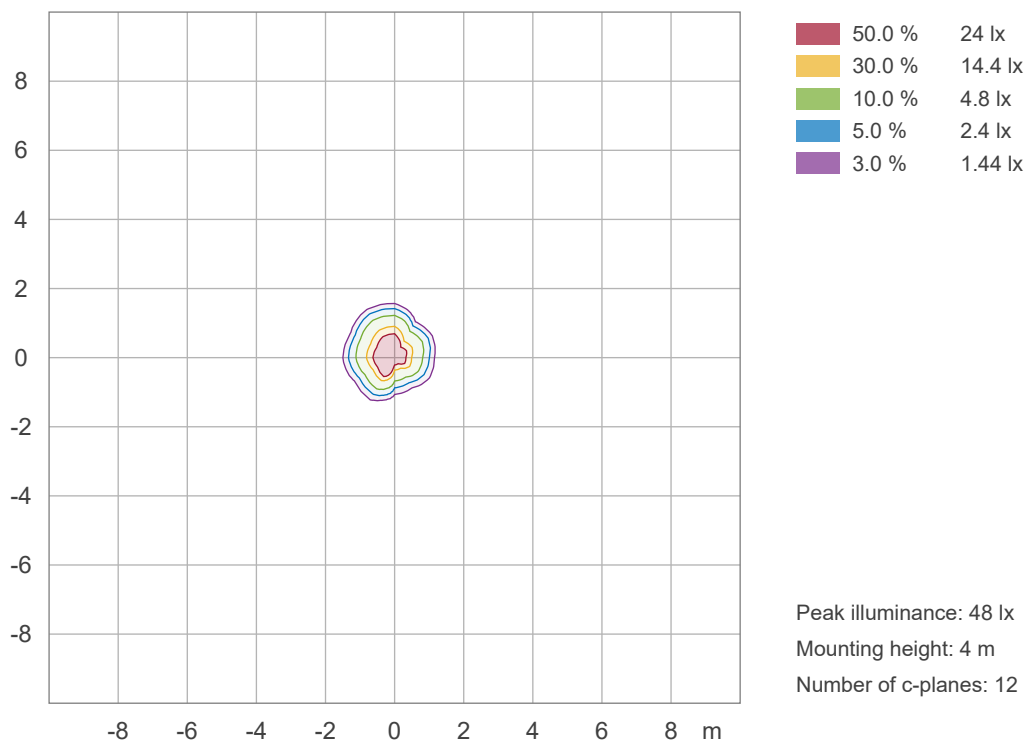


Linear intensity distribution diagram

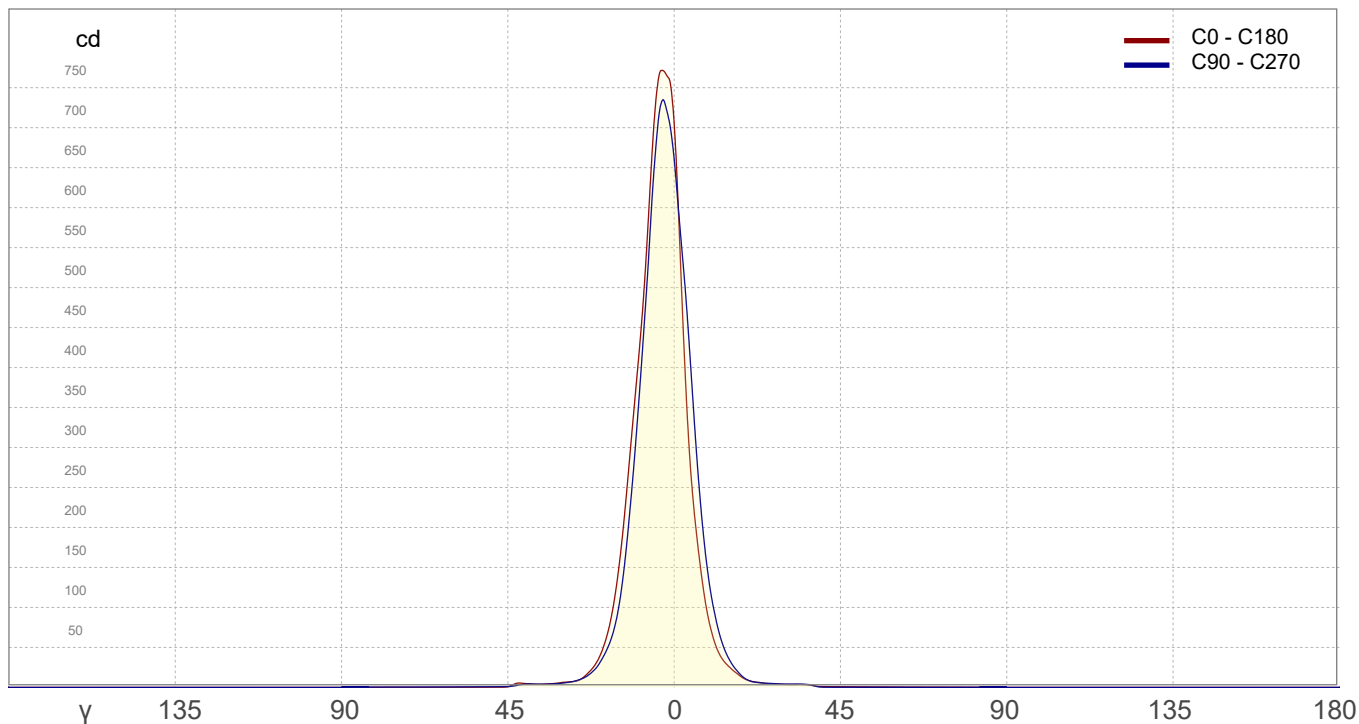

IESNA TM-15-07 Luminaire Classification System For Outdoor Luminaires

BUG rating B0 U0 G0

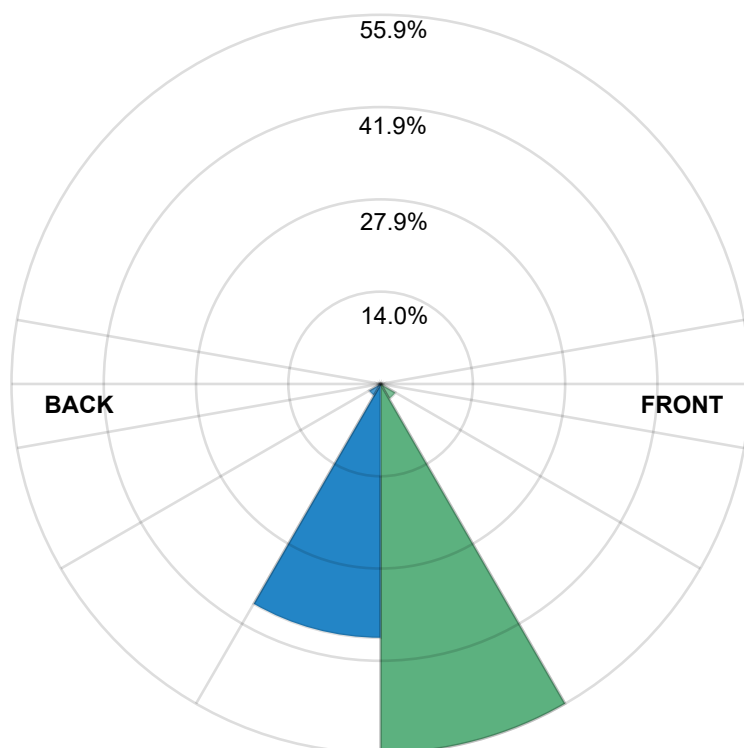

Forward Light

Low (0-30°)	38.4 lm	55.9%
Medium (30-60°)	1.8 lm	2.6%
High (60-80°)	0.3 lm	0.4%
Very High (80-90°)	0.1 lm	0.2%

Back Light

Low (0-30°)	26.4 lm	38.4%
Medium (30-60°)	1.4 lm	2.0%
High (60-80°)	0.3 lm	0.4%
Very High (80-90°)	0.1 lm	0.2%

Uplight

Low (90-100°)	0.0 lm	0.00%
High (100-180°)	0.0 lm	0.0%

Total

Sum	68.6 lm	100,0%
-----	---------	--------