

Light measurement report



Laboratory and Equipment

Test lab	n/a
Spectrometer Manufacturer and Model	n/a, n/a – n/a
Measurement date	7/13/2026

Measurement Conditions

Tested c-planes	8
Tested gamma angles	181 – 1.00°
Input Power	10.49 W


Tested Light Source

Luminaire	2021/4/22 22:04:22
Basic Luminous Shape	PANEL
Item No.	
Manufacturer	Moon On Noon


Main Light Measurement Results

Output – Total Lumen (Up% / Down%)	523.7 lm – 0.0005% / 100%
Efficiency	49.92 lm/W
Peak Intensity	1226 cd
Correlated Color Temperature, CCT	3000 K
Color Rendering Index	CRI 85.0

Polar light distribution diagram

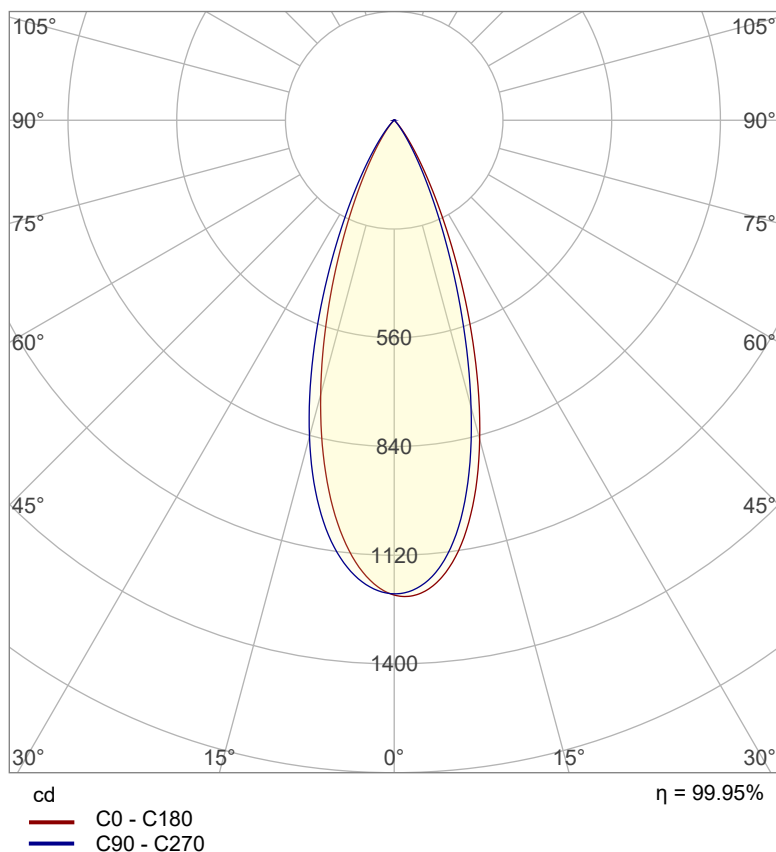


Beam details

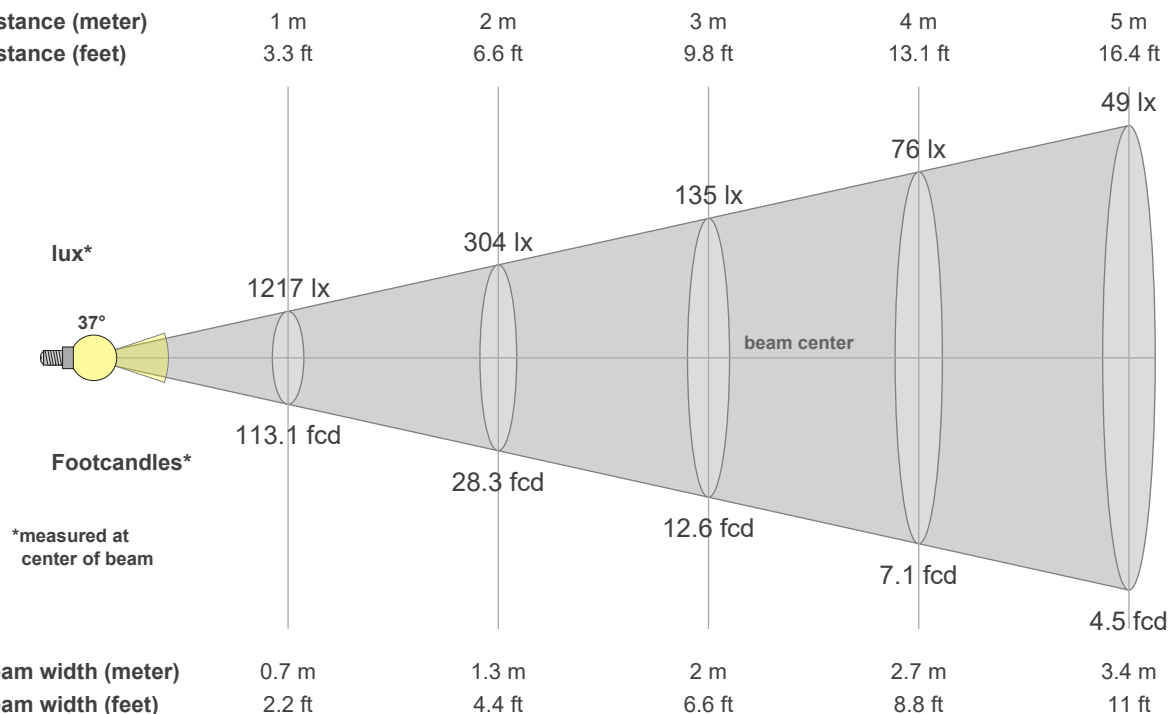


Luminaire budgetary diagram


LAMPS (number of lamps)

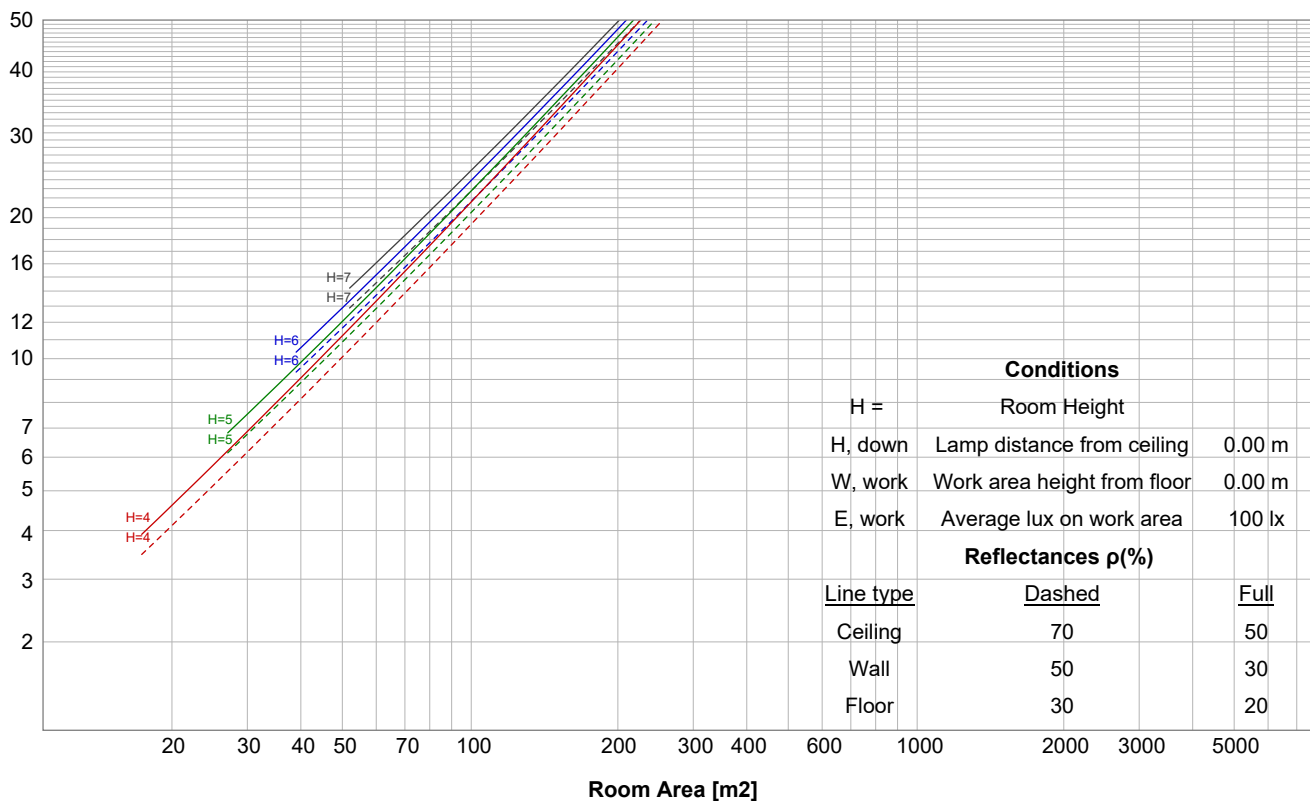


Iso-intensity Diagram (Iso-candela)

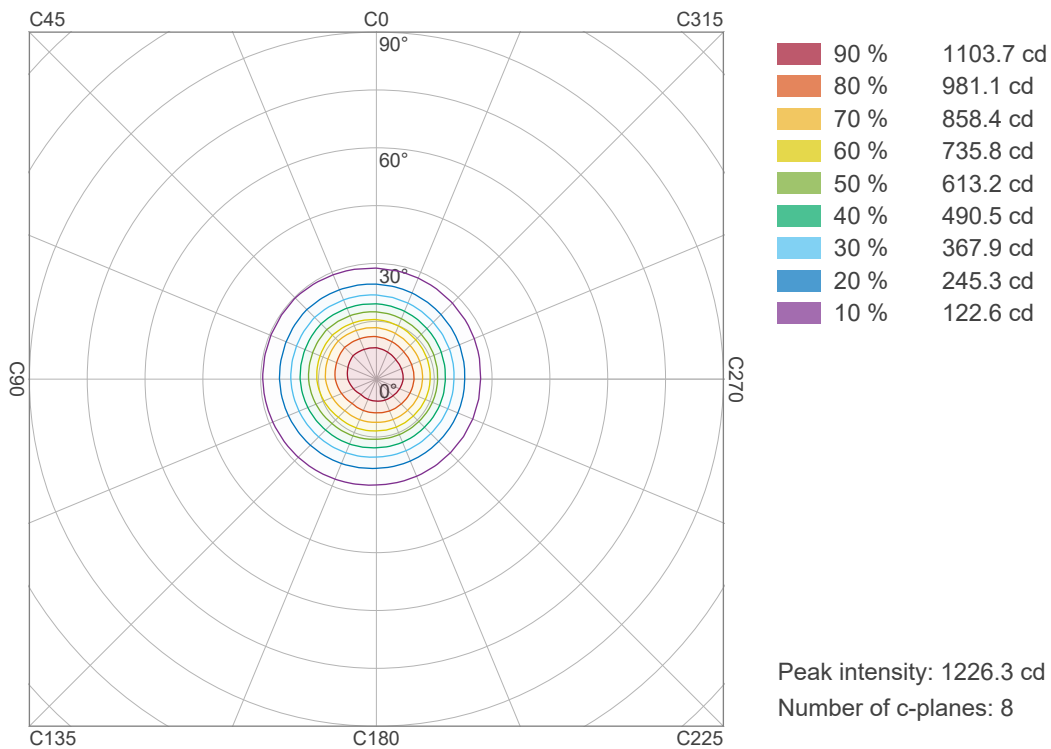

Iso-illuminance Diagram (Iso-lux)

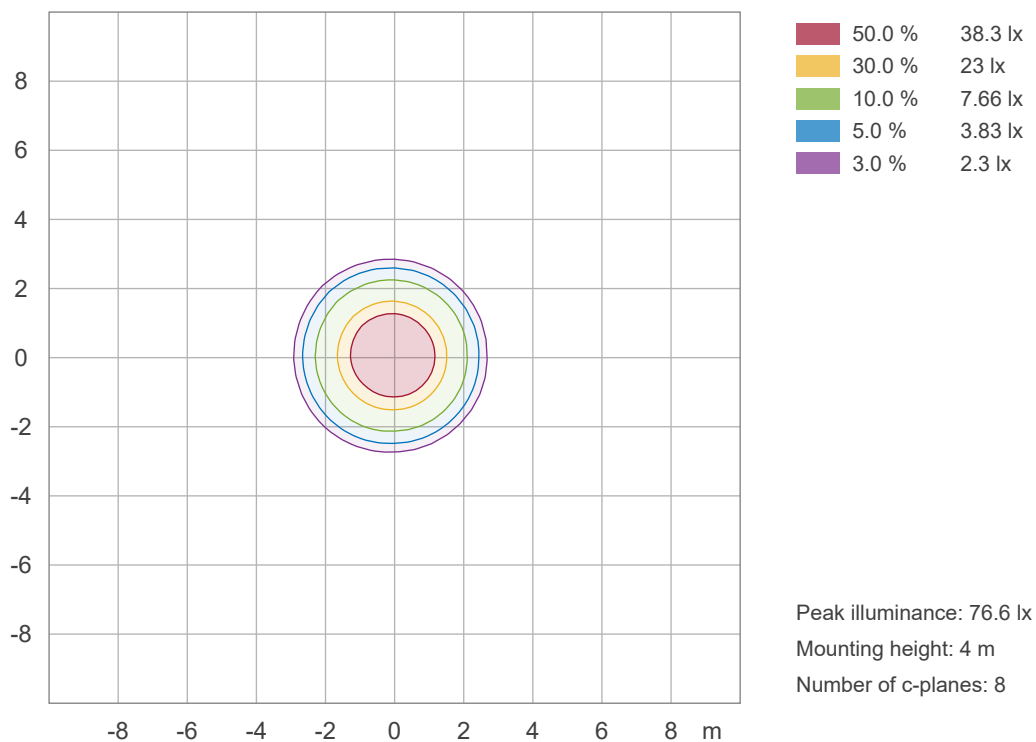


Linear intensity distribution diagram

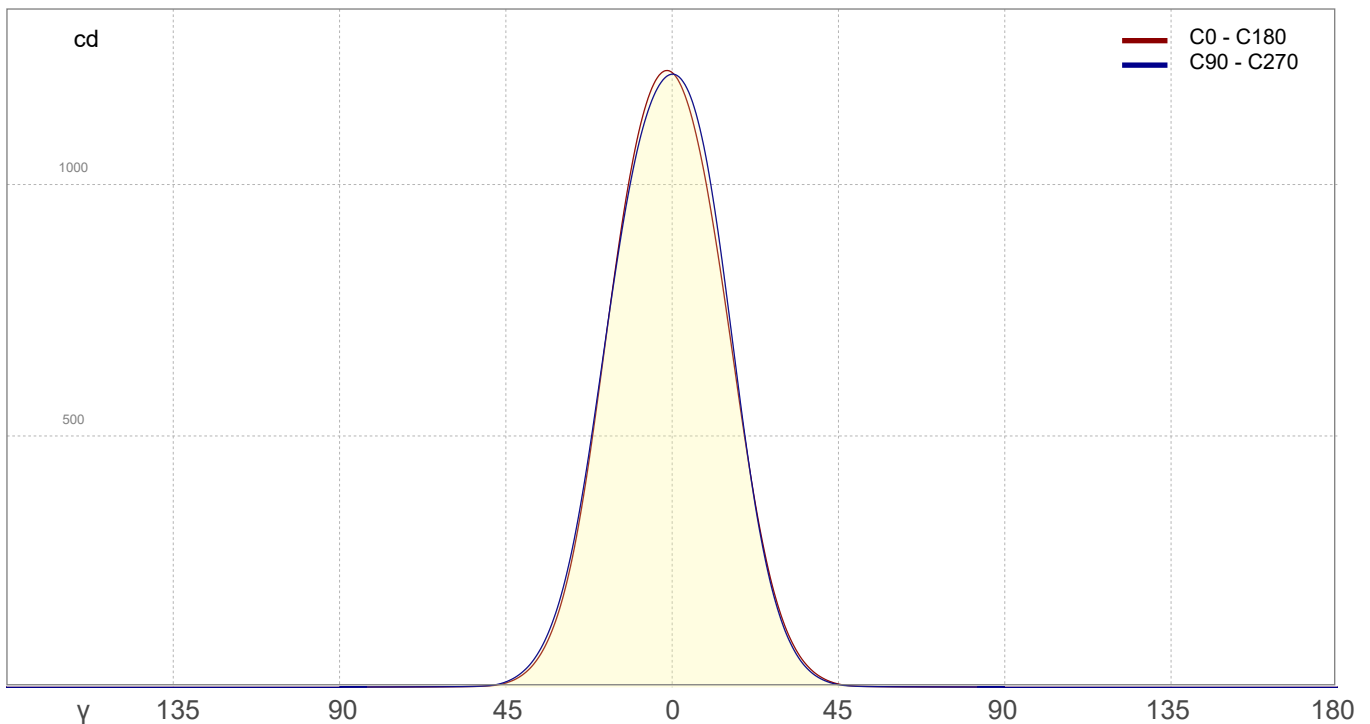

IESNA TM-15-07 Luminaire Classification System For Outdoor Luminaires

BUG rating B1 U0 G0

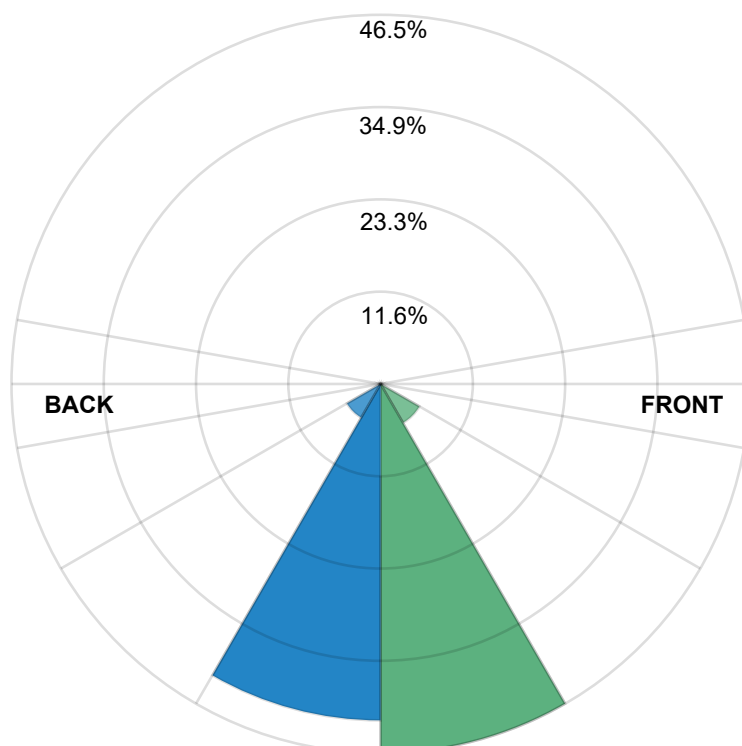

Forward Light

Low (0-30°)	243.6 lm	46.5%
Medium (30-60°)	29.6 lm	5.7%
High (60-80°)	1.0 lm	0.2%
Very High (80-90°)	0.4 lm	0.1%

Back Light

Low (0-30°)	222.0 lm	42.4%
Medium (30-60°)	25.6 lm	4.9%
High (60-80°)	1.0 lm	0.2%
Very High (80-90°)	0.4 lm	0.1%

Uplight

Low (90-100°)	0.0 lm	0.00%
High (100-180°)	0.0 lm	0.0%

Total

Sum	523.7 lm	100,0%
-----	----------	--------