

Light measurement report



Laboratory and Equipment

Test lab	n/a
Spectrometer Manufacturer and Model	n/a, n/a – n/a
Measurement date	7/14/2026

Measurement Conditions

Tested c-planes	8
Tested gamma angles	181 – 1.00°
Input Power	28.03 W


Tested Light Source

Luminaire	2021/4/18 8:06:51
Basic Luminous Shape	PANEL
Item No.	
Manufacturer	Moon On Noon


Main Light Measurement Results

Output – Total Lumen (Up% / Down%)	2549 lm – 0.0009% / 100%
Efficiency	90.94 lm/W
Peak Intensity	7786 cd
Correlated Color Temperature, CCT	3000 K
Color Rendering Index	CRI 85.0

Polar light distribution diagram

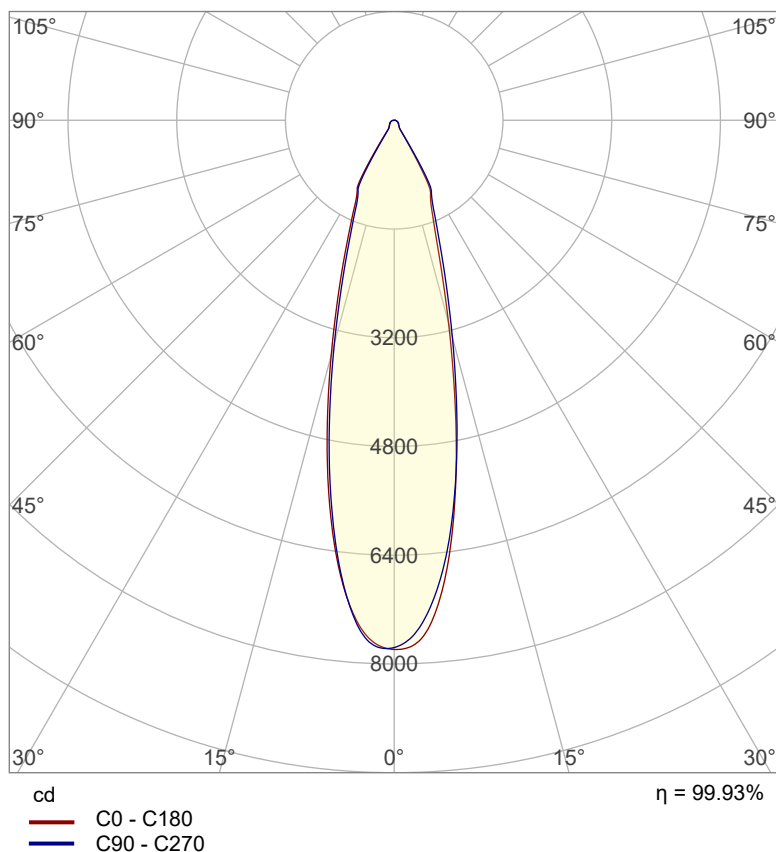


Beam details

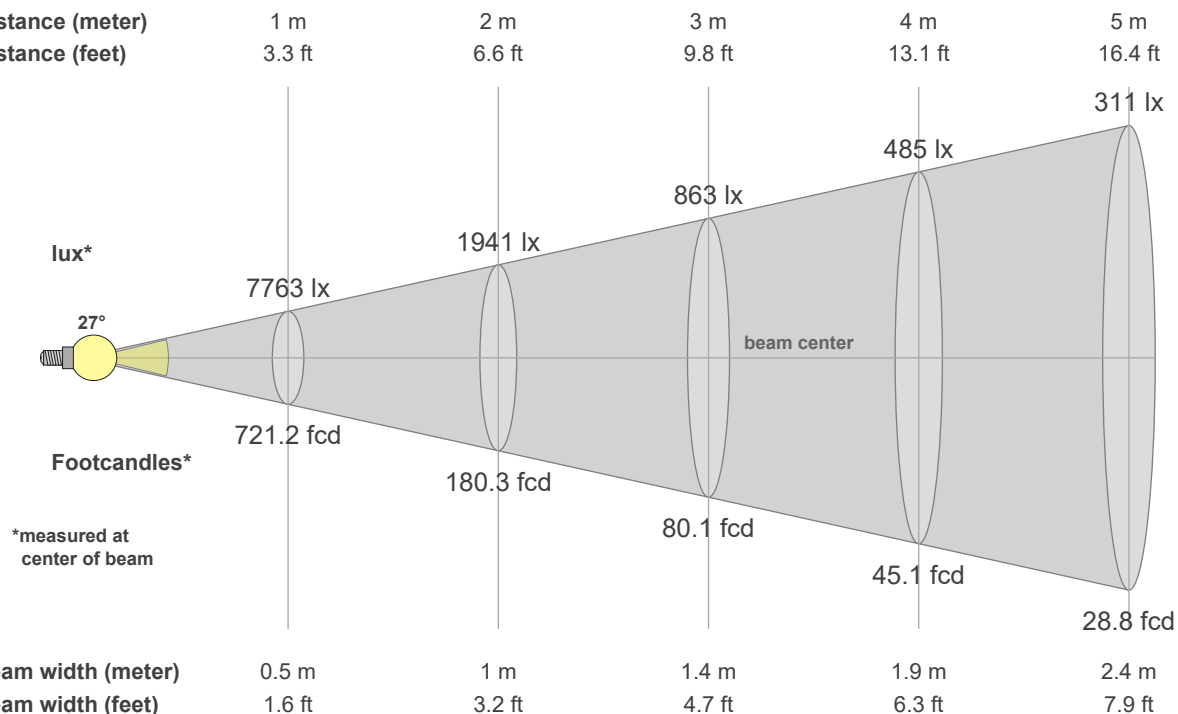


Luminaire budgetary diagram


LAMPS (number of lamps)

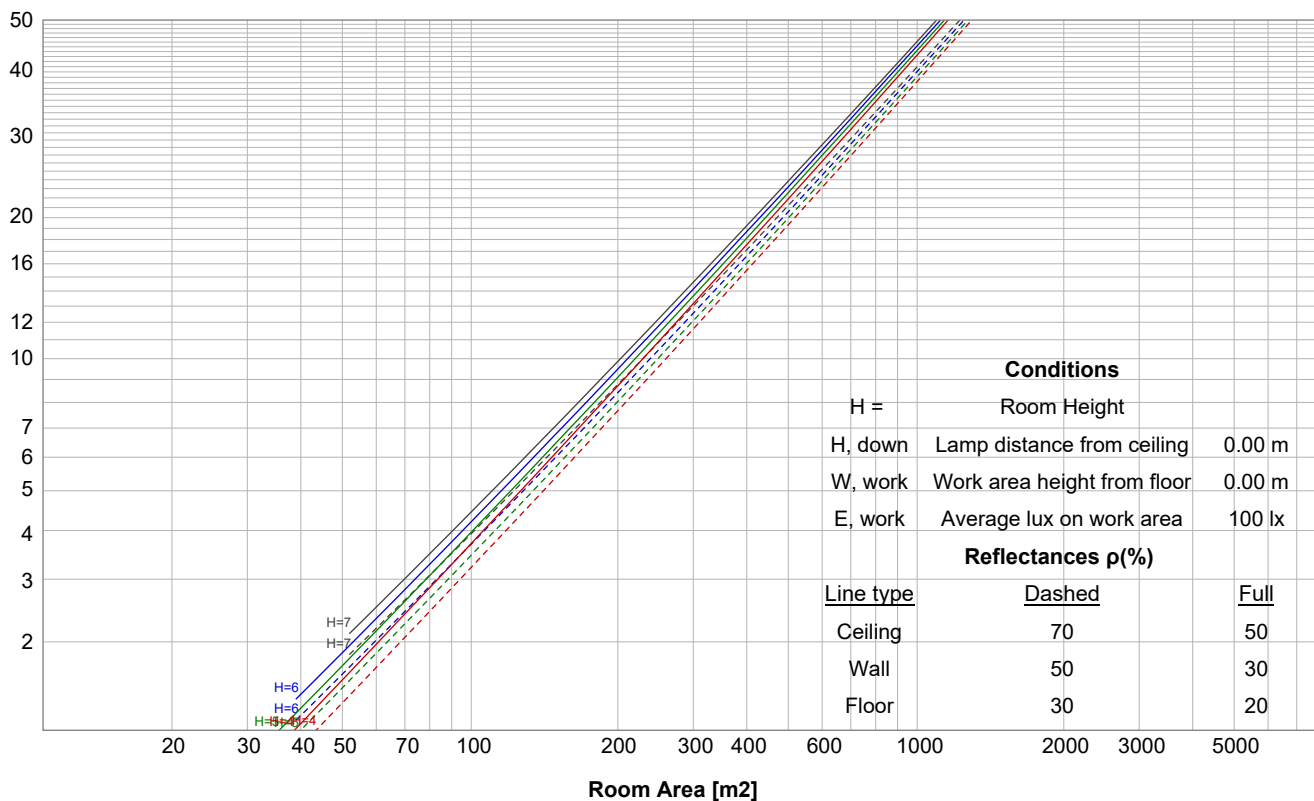


Iso-intensity Diagram (Iso-candela)

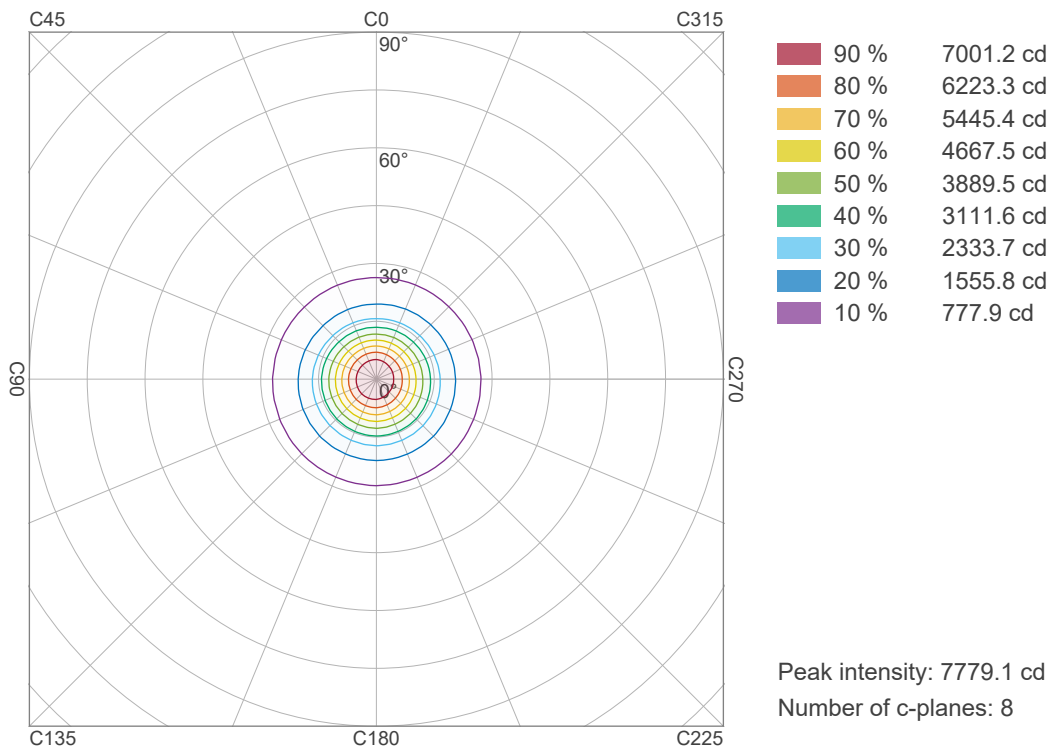

Iso-illuminance Diagram (Iso-lux)

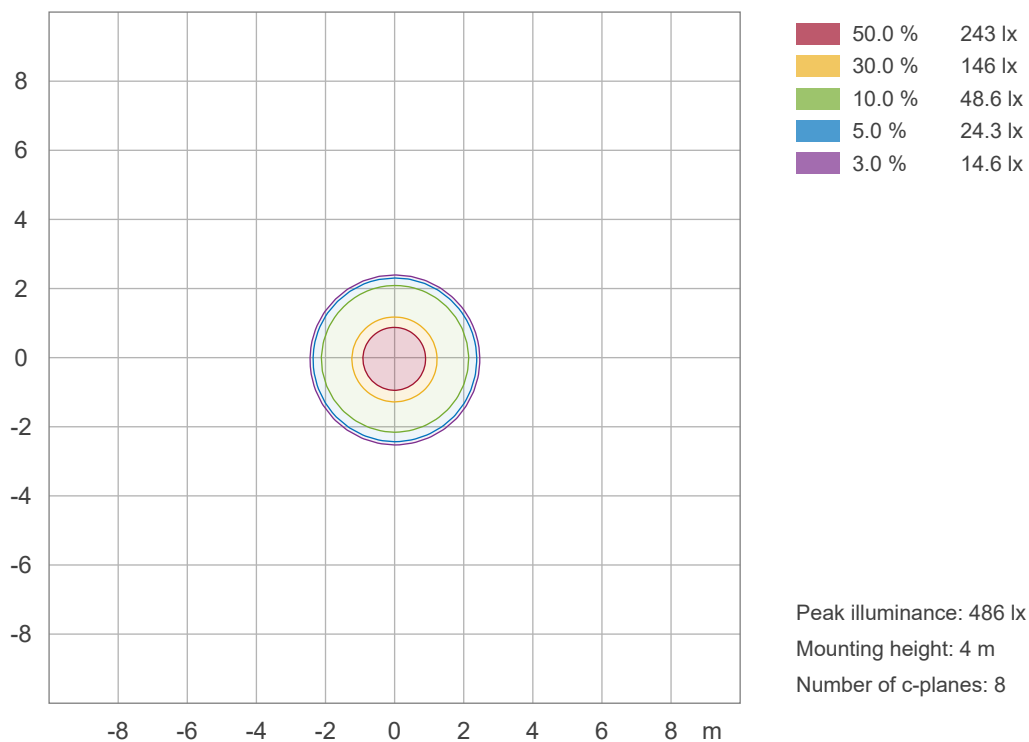


Linear intensity distribution diagram

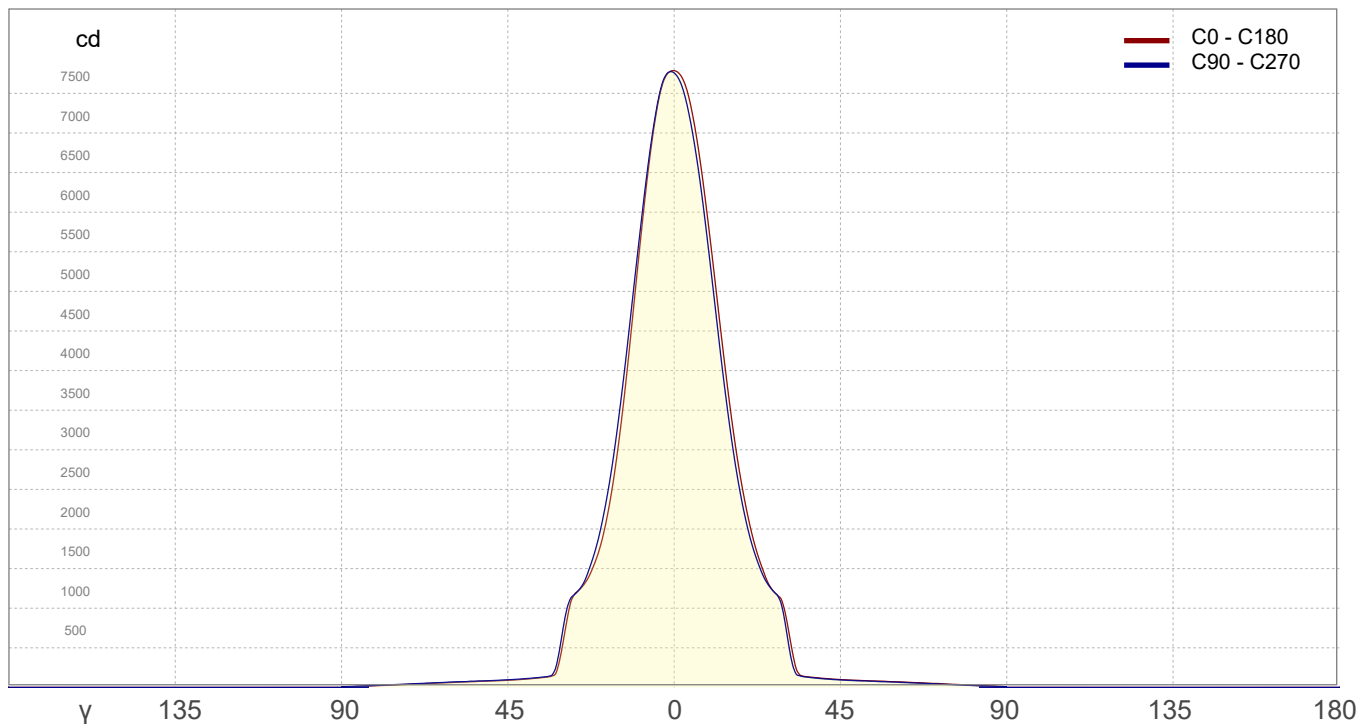

IESNA TM-15-07 Luminaire Classification System For Outdoor Luminaires

BUG rating B3 U0 G0

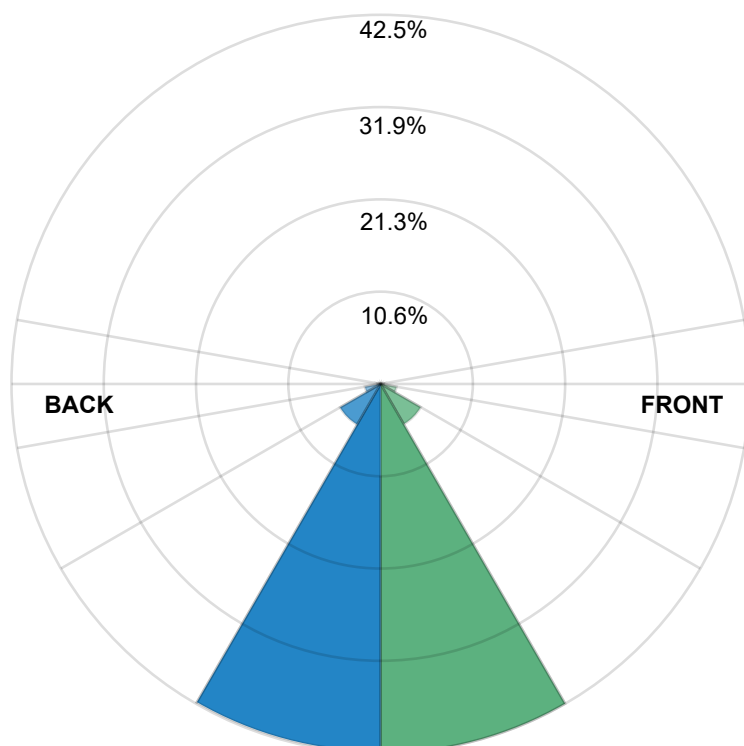

Forward Light

Low (0-30°)	1084.2 lm	42.5%
Medium (30-60°)	136.2 lm	5.3%
High (60-80°)	47.6 lm	1.9%
Very High (80-90°)	9.0 lm	0.4%

Back Light

Low (0-30°)	1079.2 lm	42.3%
Medium (30-60°)	137.4 lm	5.4%
High (60-80°)	46.7 lm	1.8%
Very High (80-90°)	8.7 lm	0.3%

Uplight

Low (90-100°)	0.0 lm	0.00%
High (100-180°)	0.0 lm	0.0%

Total

Sum	2548.9 lm	100,0%
-----	-----------	--------