

Light measurement report



Laboratory and Equipment

Test lab	n/a
Spectrometer Manufacturer and Model	n/a, n/a – n/a
Measurement date	7/14/2026

Measurement Conditions

Tested c-planes	12
Tested gamma angles	181 – 1.00°
Input Power	9.751 W


Tested Light Source

Luminaire	2023/2/20 16:03:36
Basic Luminous Shape	PANEL
Item No.	
Manufacturer	Moon On Noon


Main Light Measurement Results

Output – Total Lumen (Up% / Down%)	799.7 lm – 0.002% / 100%
Efficiency	82.02 lm/W
Peak Intensity	5136 cd
Correlated Color Temperature, CCT	2700 K
Color Rendering Index	CRI 85.0

Polar light distribution diagram

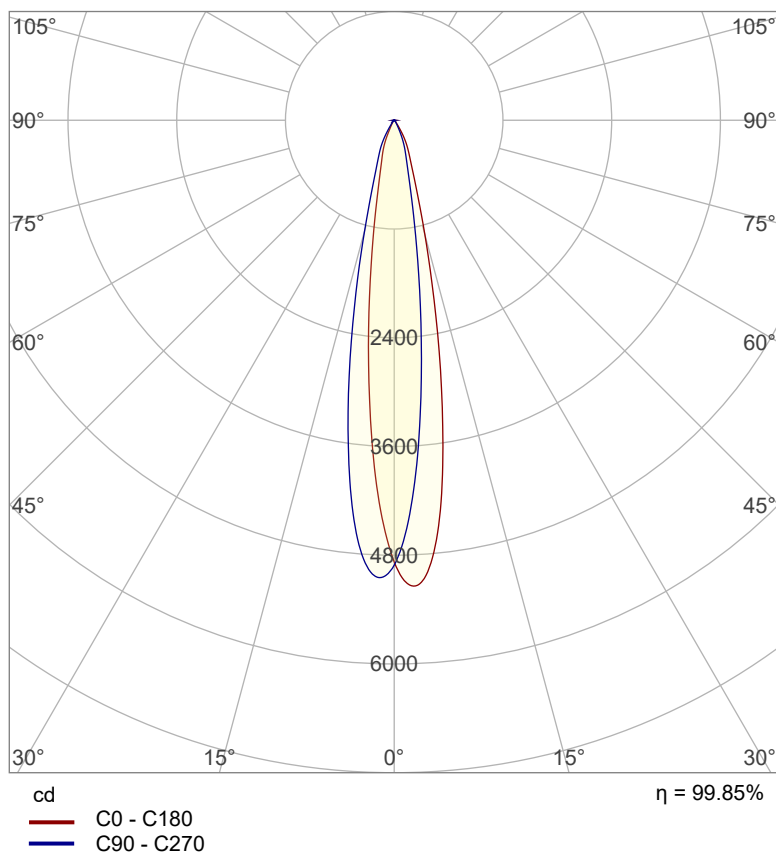


Beam details

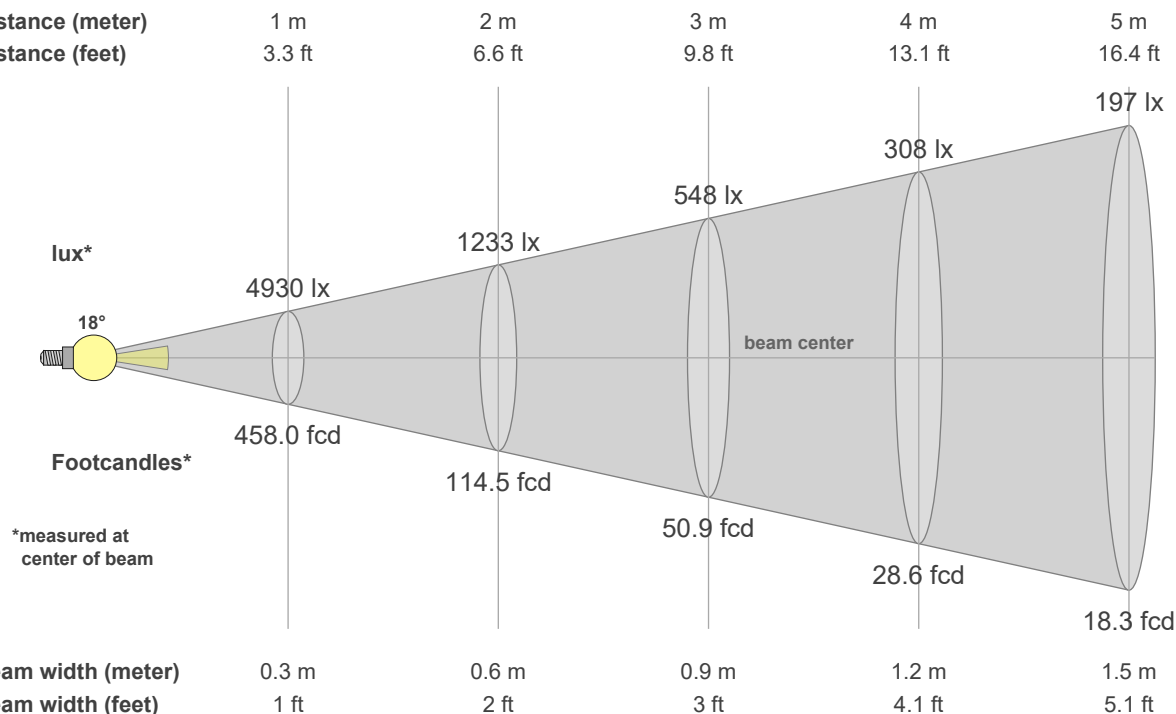


Luminaire budgetary diagram


LAMPS (number of lamps)

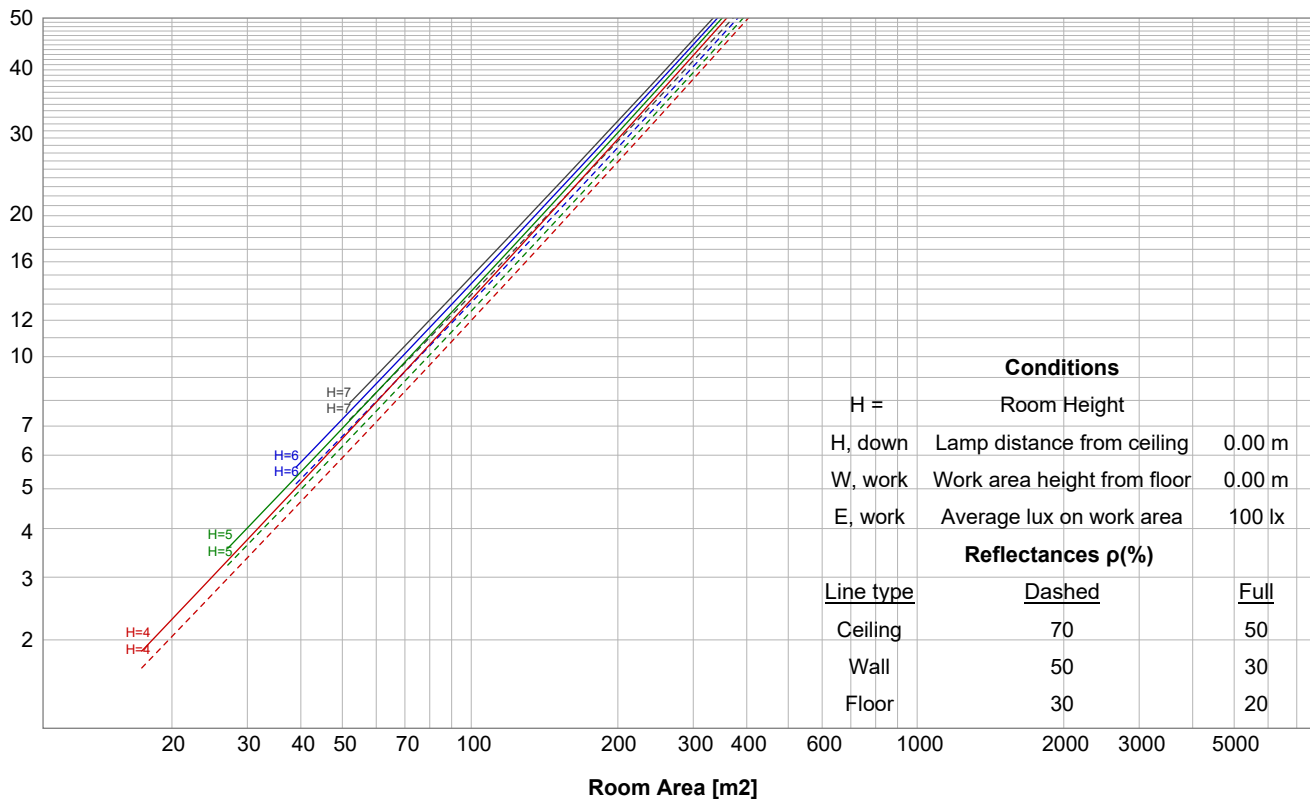


Iso-intensity Diagram (Iso-candela)

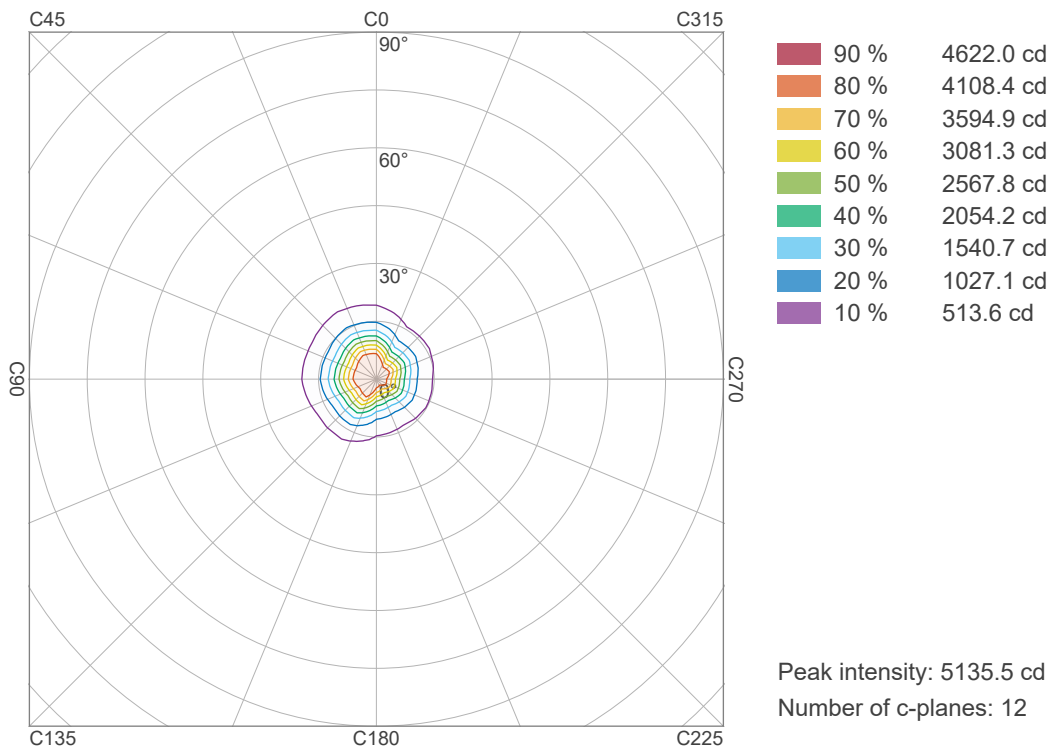

Iso-illuminance Diagram (Iso-lux)

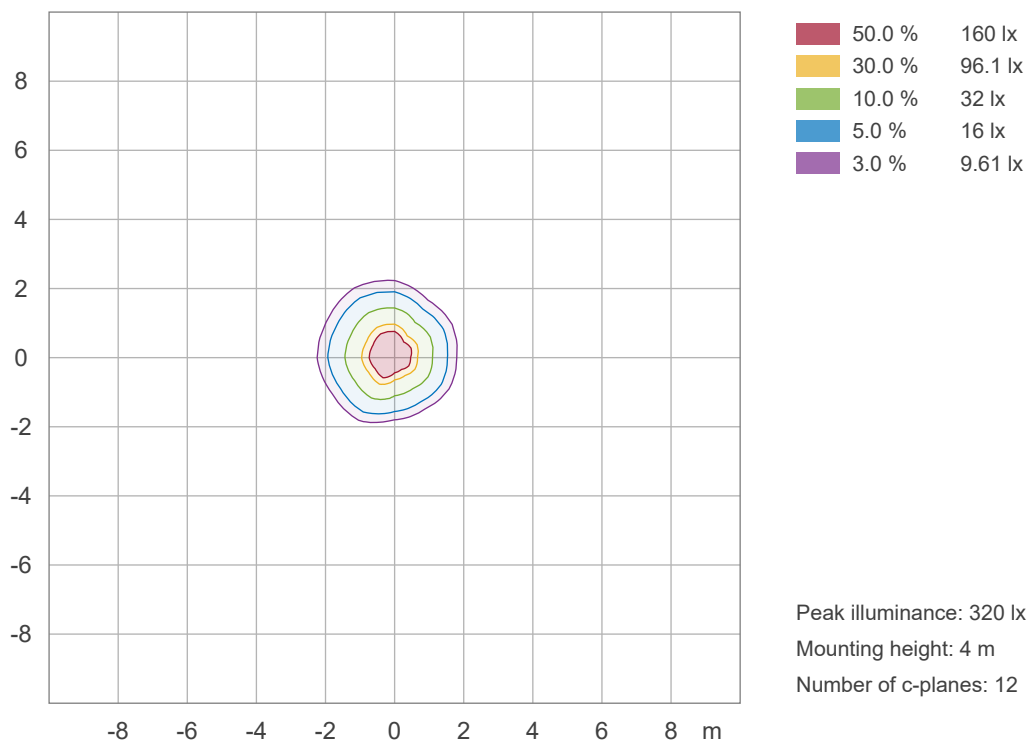


Linear intensity distribution diagram

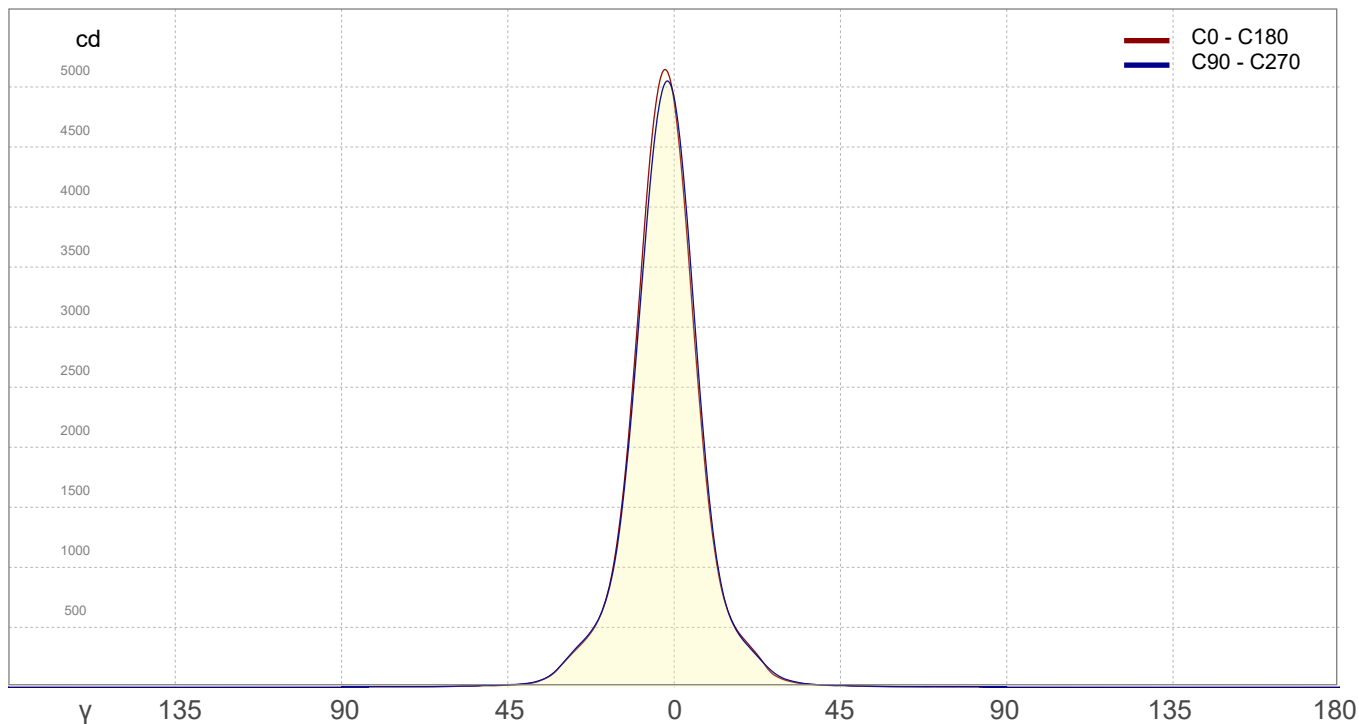

IESNA TM-15-07 Luminaire Classification System For Outdoor Luminaires

BUG rating B1 U0 G0

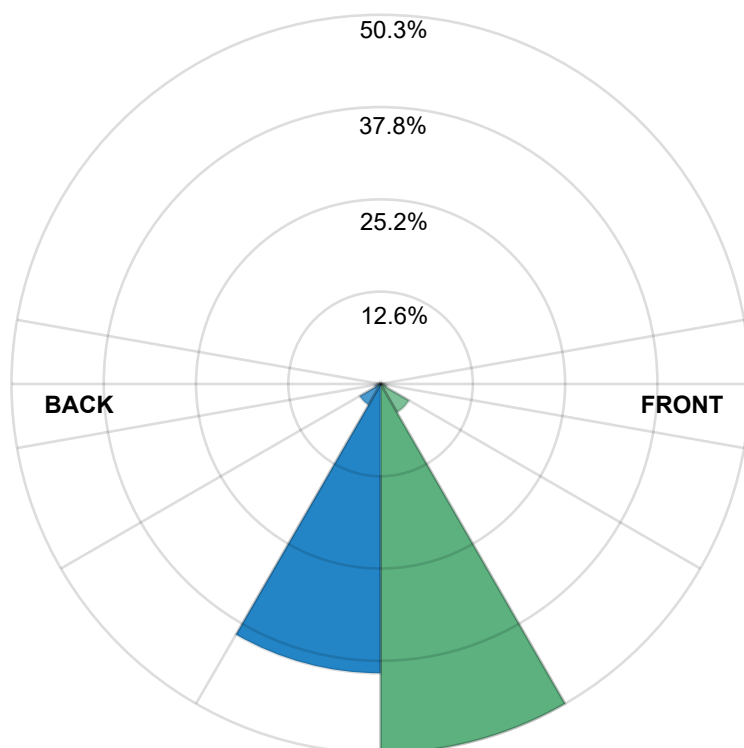

Forward Light

Low (0-30°)	402.6 lm	50.3%
Medium (30-60°)	35.8 lm	4.5%
High (60-80°)	6.6 lm	0.8%
Very High (80-90°)	3.2 lm	0.4%

Back Light

Low (0-30°)	315.6 lm	39.5%
Medium (30-60°)	26.3 lm	3.3%
High (60-80°)	6.4 lm	0.8%
Very High (80-90°)	3.2 lm	0.4%

Uplight

Low (90-100°)	0.0 lm	0.00%
High (100-180°)	0.0 lm	0.0%

Total

Sum	799.7 lm	100,0%
-----	----------	--------