

Light measurement report



Laboratory and Equipment

Test lab	n/a
Spectrometer Manufacturer and Model	n/a, n/a – n/a
Measurement date	7/14/2026

Measurement Conditions

Tested c-planes	8
Tested gamma angles	181 – 1.00°
Input Power	10.31 W


Tested Light Source

Luminaire	2023/5/22 16:21:04
Basic Luminous Shape	PANEL
Item No.	
Manufacturer	Moon On Noon


Main Light Measurement Results

Output – Total Lumen (Up% / Down%)	559.5 lm – 0.016% / 99.98%
Efficiency	54.27 lm/W
Peak Intensity	2512 cd
Correlated Color Temperature, CCT	3000 K
Color Rendering Index	CRI 85.0

Polar light distribution diagram

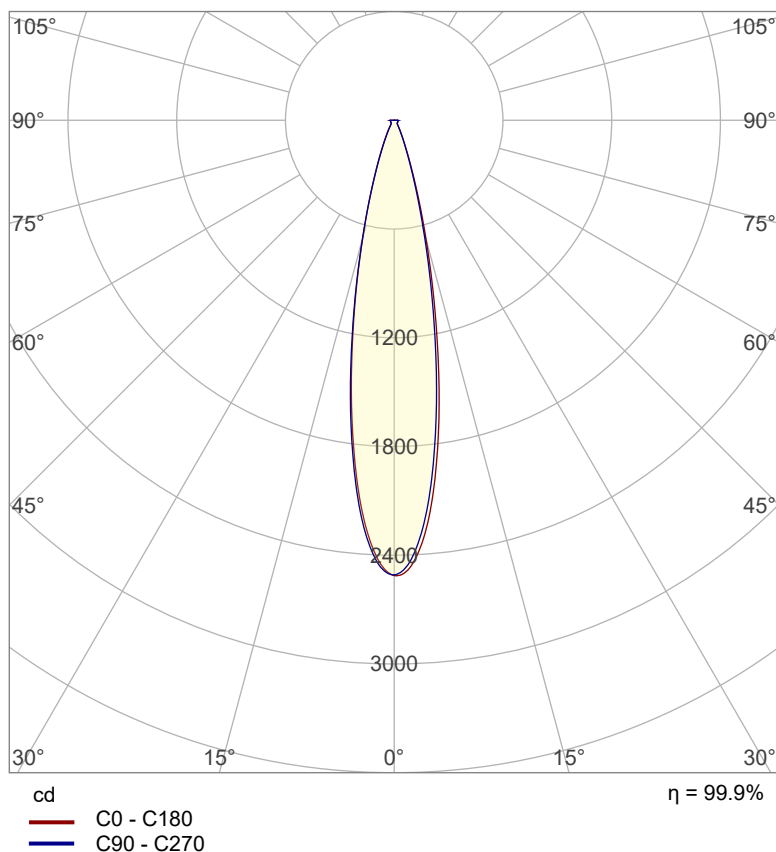


Beam details

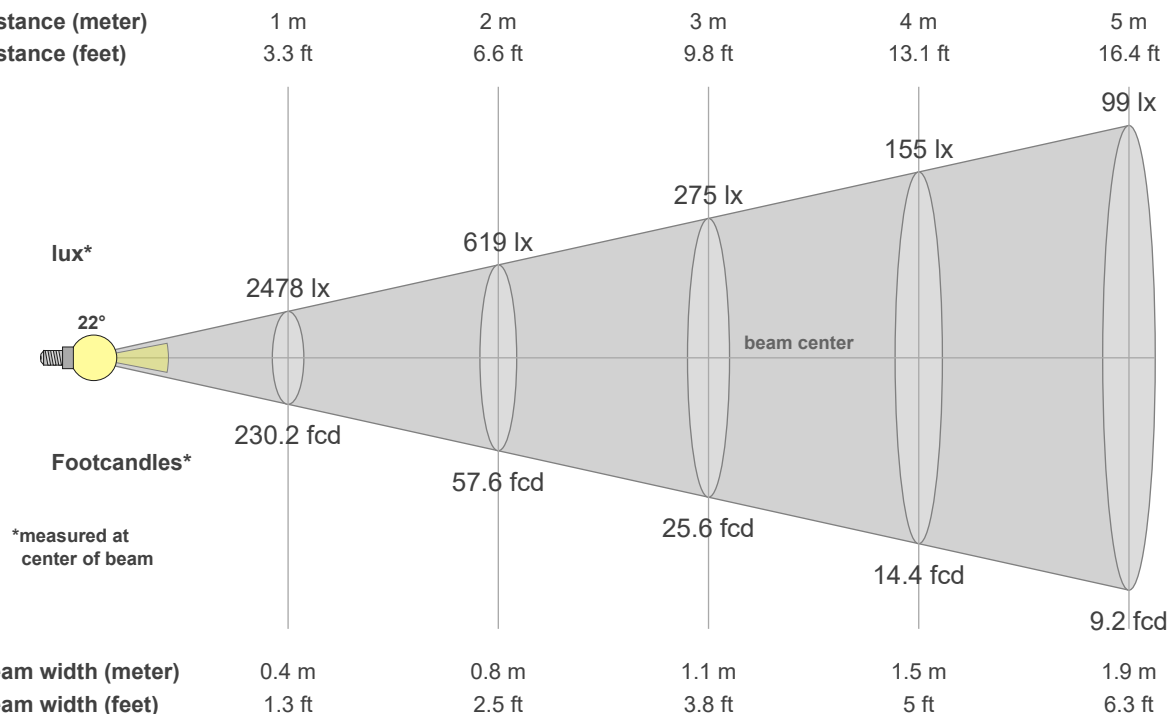


Luminaire budgetary diagram


LAMPS (number of lamps)

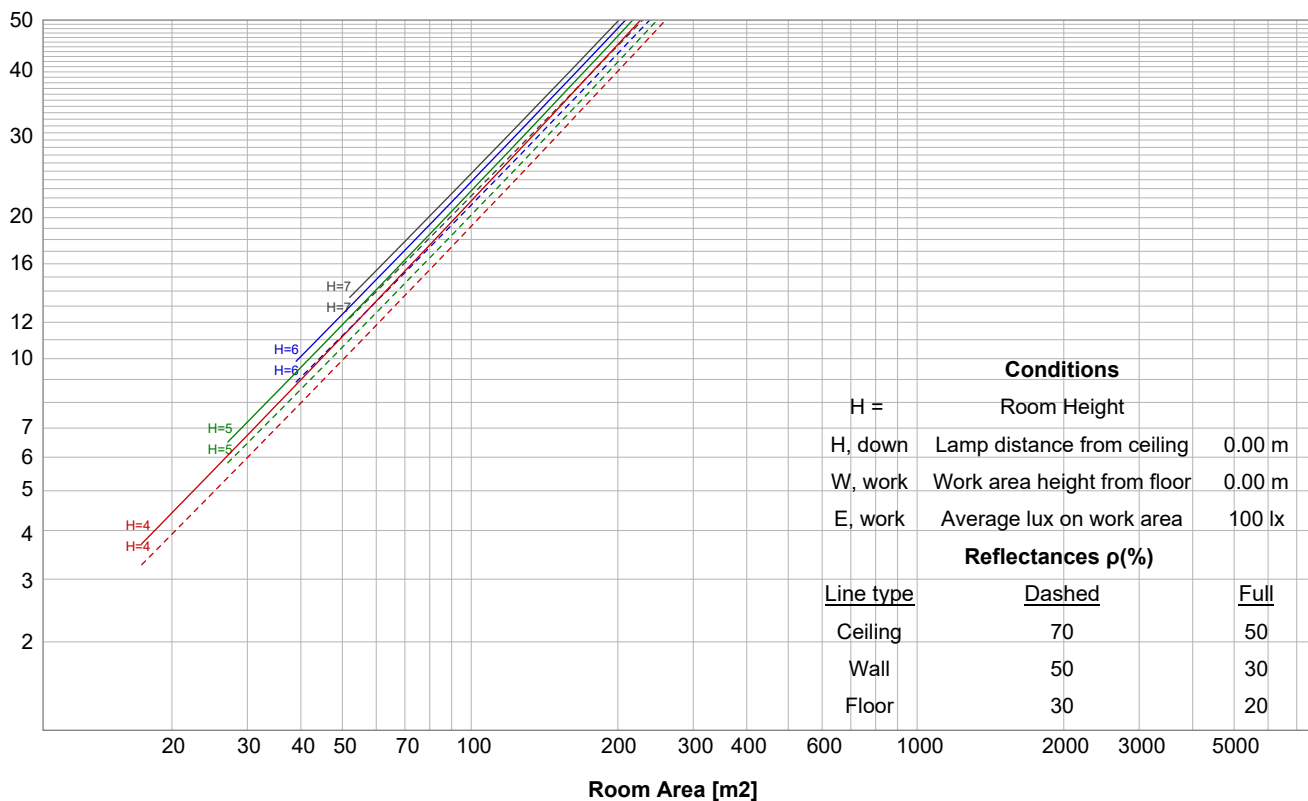


Iso-intensity Diagram (Iso-candela)

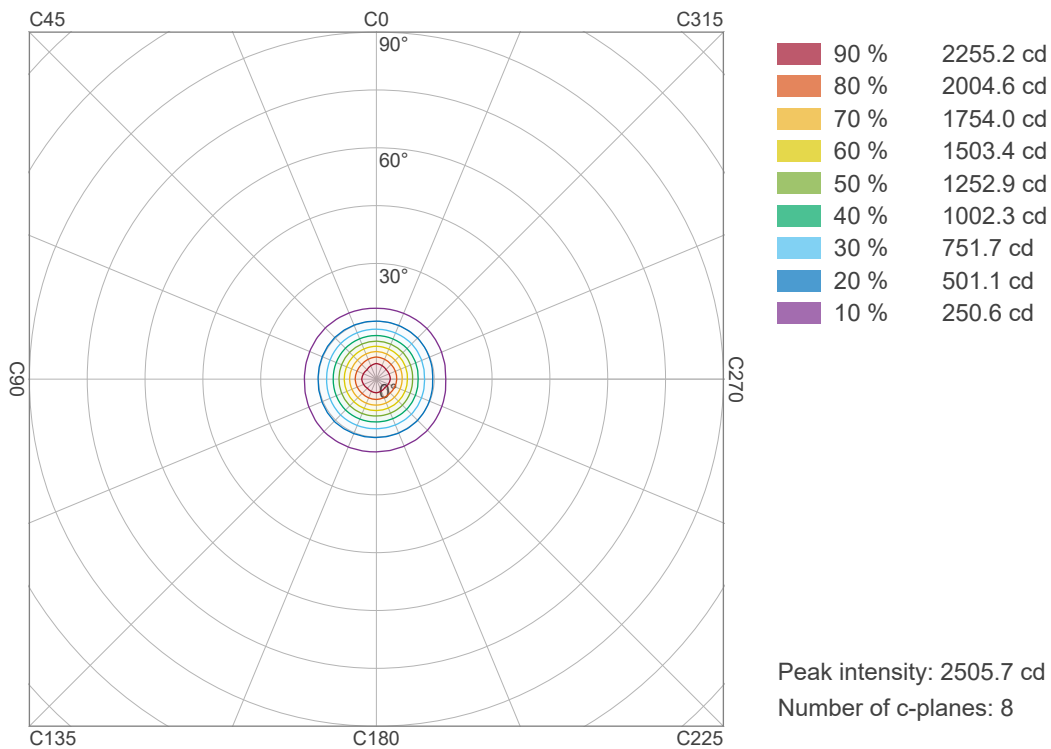

Iso-illuminance Diagram (Iso-lux)

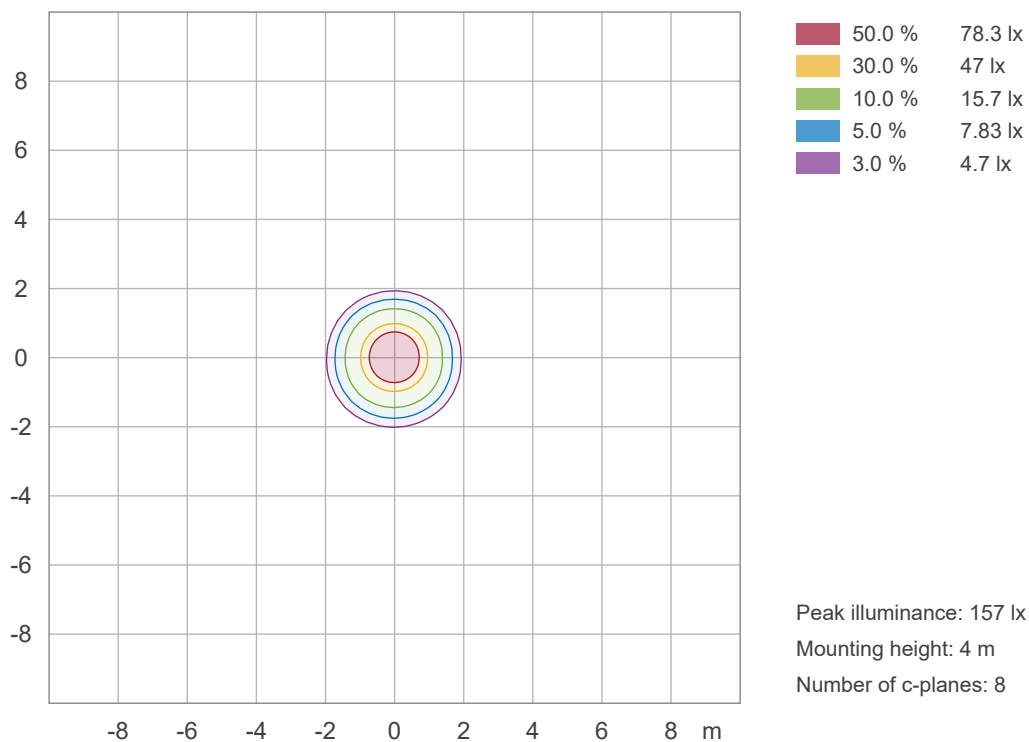


Linear intensity distribution diagram

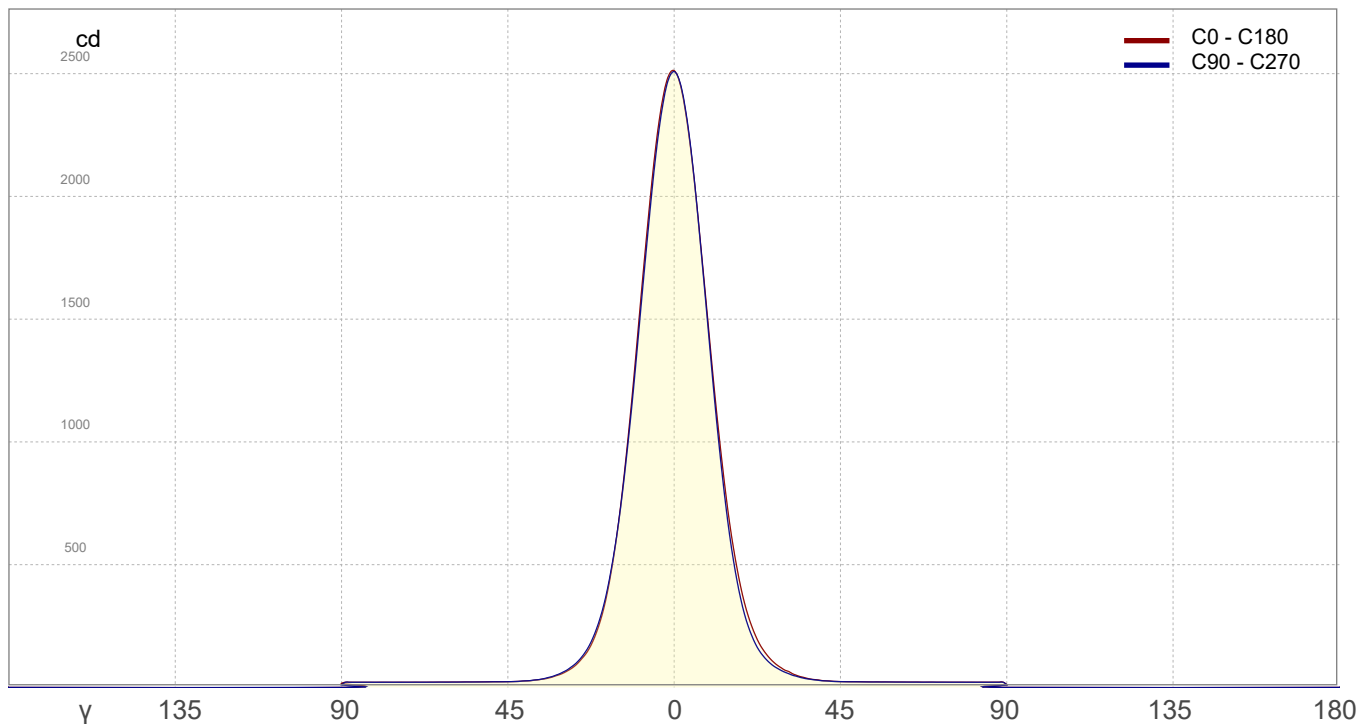

IESNA TM-15-07 Luminaire Classification System For Outdoor Luminaires

BUG rating B1 U0 G1

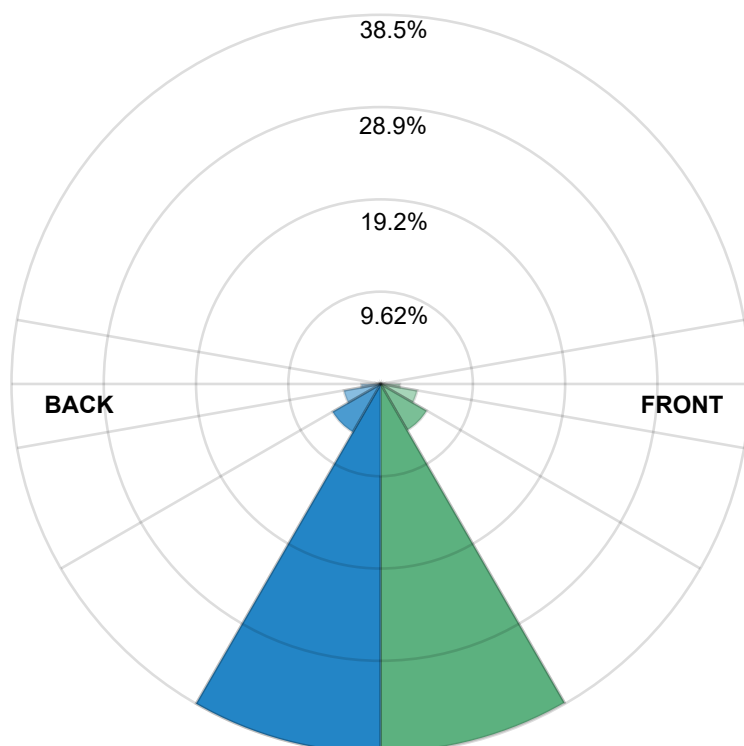

Forward Light

Low (0-30°)	214.7 lm	38.4%
Medium (30-60°)	31.1 lm	5.6%
High (60-80°)	21.7 lm	3.9%
Very High (80-90°)	11.3 lm	2.0%

Back Light

Low (0-30°)	215.3 lm	38.5%
Medium (30-60°)	32.4 lm	5.8%
High (60-80°)	21.7 lm	3.9%
Very High (80-90°)	11.3 lm	2.0%

Uplight

Low (90-100°)	0.0 lm	0.00%
High (100-180°)	0.0 lm	0.0%

Total

Sum	559.5 lm	100,0%
-----	----------	--------