

Light measurement report



Laboratory and Equipment

Test lab	n/a
Spectrometer Manufacturer and Model	n/a, n/a – n/a
Measurement date	6/25/2026

Measurement Conditions

Tested c-planes	12
Tested gamma angles	181 – 1.00°
Input Power	6.32 W


Tested Light Source

Luminaire	2021/12/3 11:17:29
Basic Luminous Shape	PANEL
Item No.	
Manufacturer	Moon On Noon


Main Light Measurement Results

Output – Total Lumen (Up% / Down%)	471.6 lm – 0.0014% / 100%
Efficiency	74.61 lm/W
Peak Intensity	3334 cd
Correlated Color Temperature, CCT	3000 K
Color Rendering Index	CRI 85.0

Polar light distribution diagram

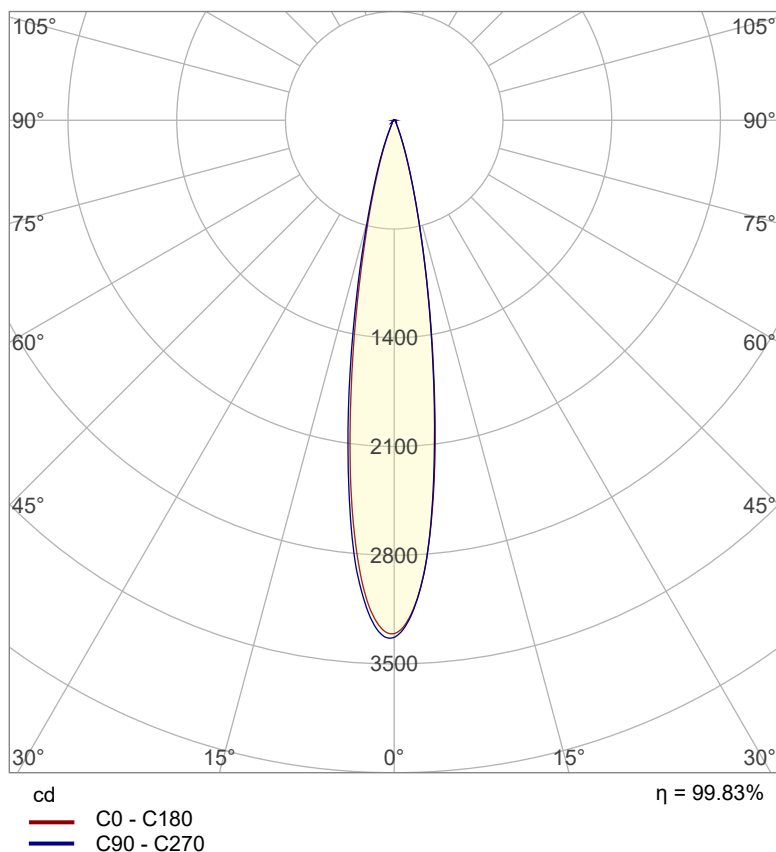


Beam details

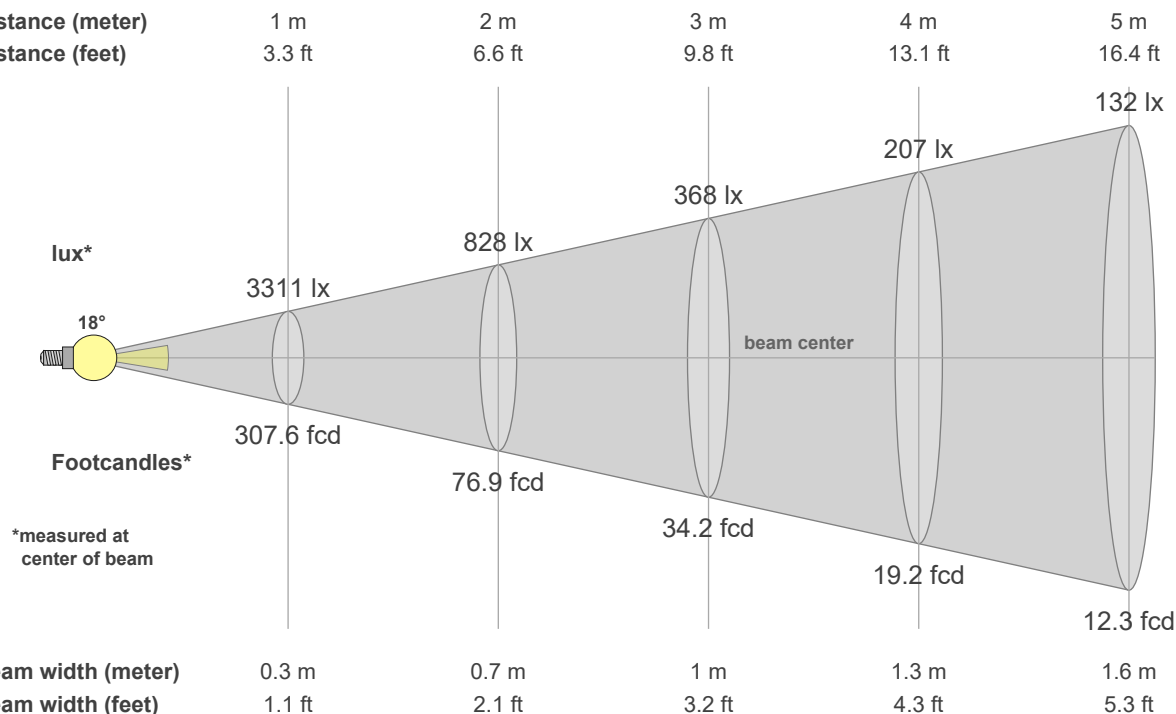


Luminaire budgetary diagram


LAMPS (number of lamps)

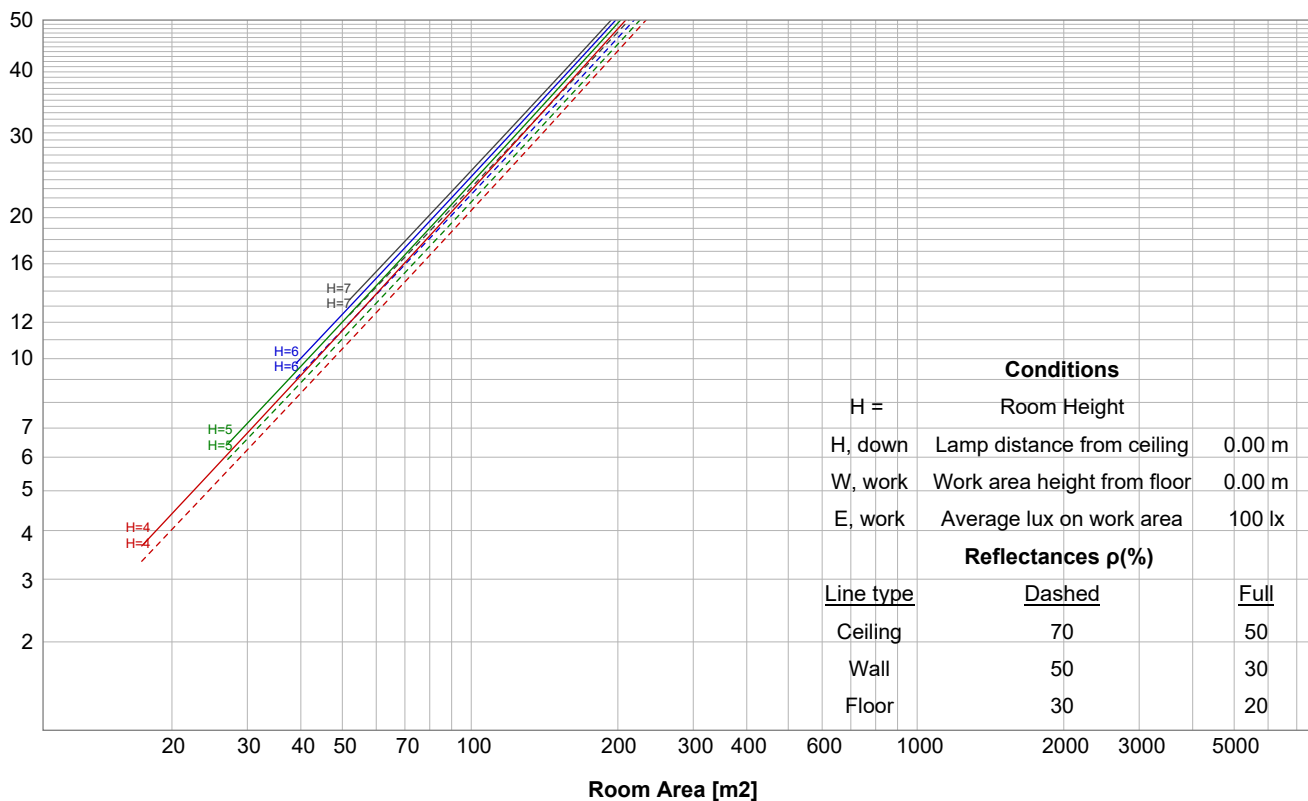


Iso-intensity Diagram (Iso-candela)

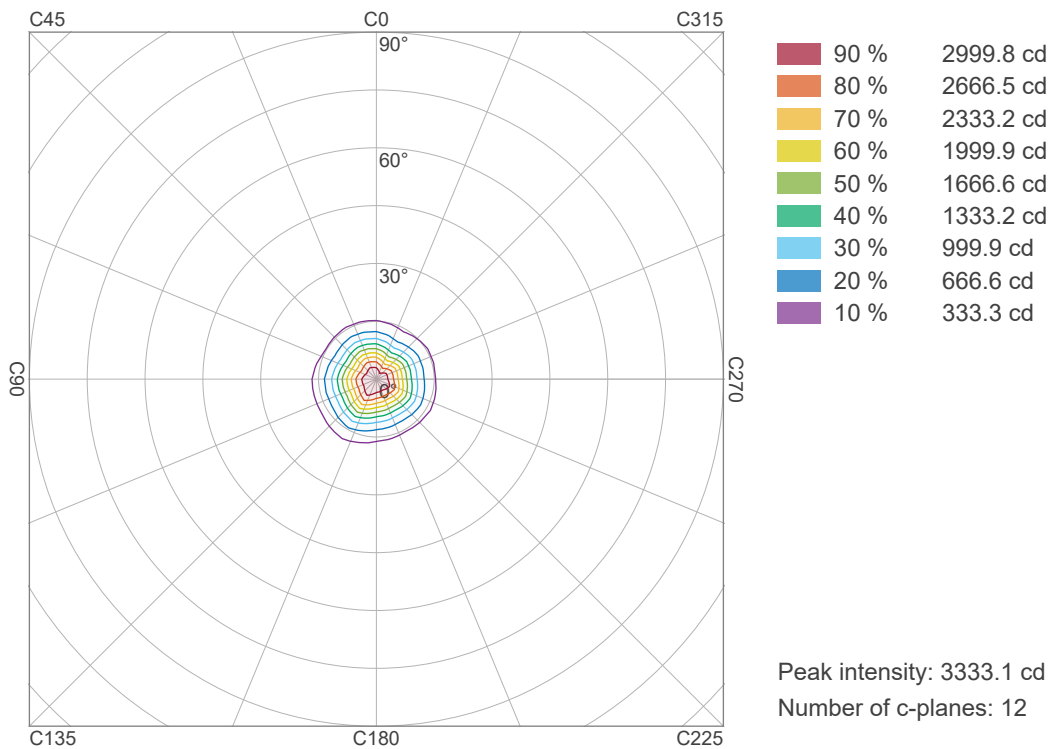

Iso-illuminance Diagram (Iso-lux)

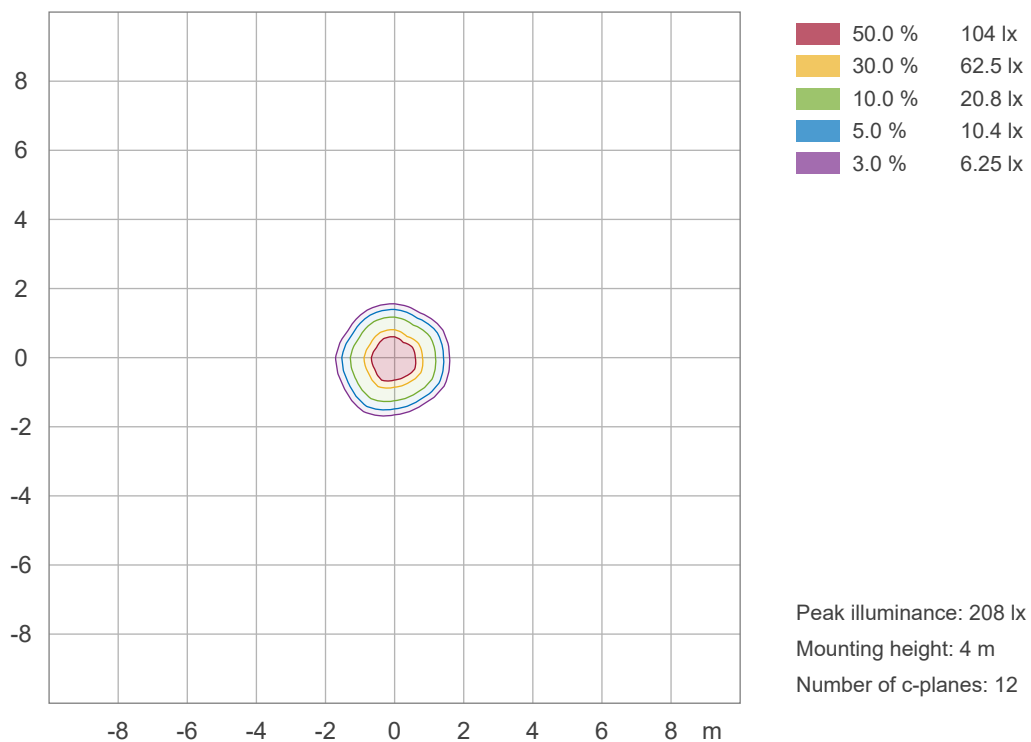


Linear intensity distribution diagram

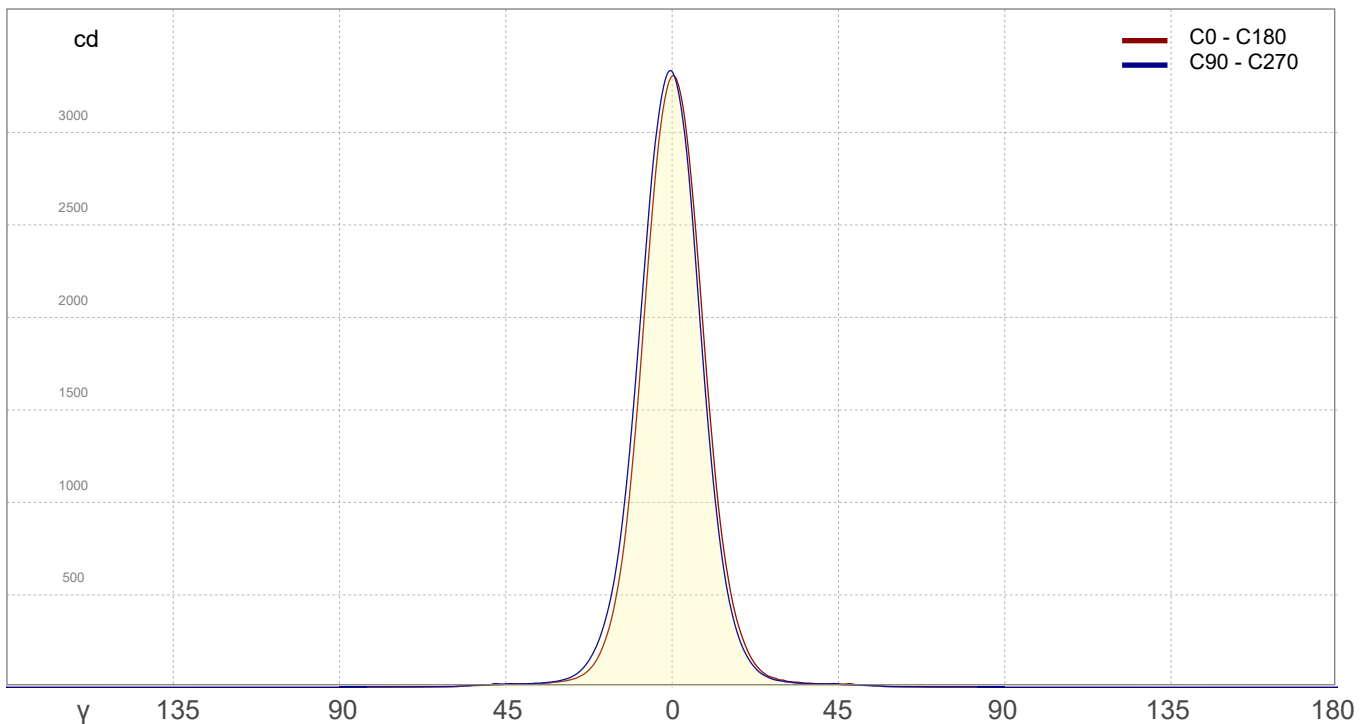

IESNA TM-15-07 Luminaire Classification System For Outdoor Luminaires

BUG rating B1 U0 G0

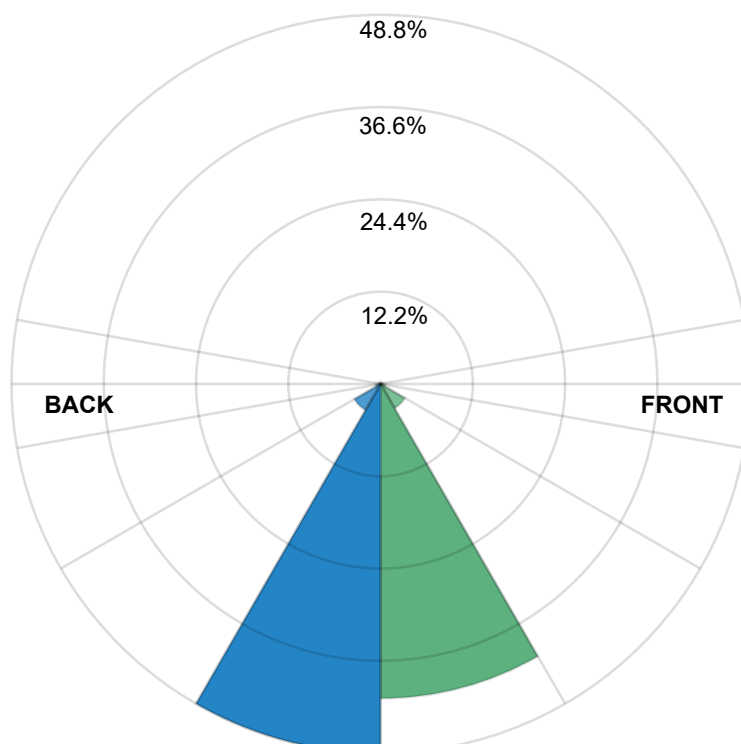

Forward Light

Low (0-30°)	196.2 lm	41.6%
Medium (30-60°)	17.5 lm	3.7%
High (60-80°)	2.9 lm	0.6%
Very High (80-90°)	1.3 lm	0.3%

Back Light

Low (0-30°)	230.3 lm	48.8%
Medium (30-60°)	18.9 lm	4.0%
High (60-80°)	3.1 lm	0.7%
Very High (80-90°)	1.3 lm	0.3%

Uplight

Low (90-100°)	0.0 lm	0.00%
High (100-180°)	0.0 lm	0.0%

Total

Sum	471.6 lm	100,0%
-----	----------	--------