

Light measurement report



Laboratory and Equipment

Test lab	n/a
Spectrometer Manufacturer and Model	n/a, n/a – n/a
Measurement date	7/14/2026

Measurement Conditions

Tested c-planes	12
Tested gamma angles	181 – 1.00°
Input Power	13.92 W


Tested Light Source

Luminaire	2023/5/10 10:55:54
Basic Luminous Shape	PANEL
Item No.	
Manufacturer	Moon On Noon


Main Light Measurement Results

Output – Total Lumen (Up% / Down%)	1266 lm – 0.0015% / 100%
Efficiency	90.98 lm/W
Peak Intensity	6969 cd
Correlated Color Temperature, CCT	2700 K
Color Rendering Index	CRI 85.0

Polar light distribution diagram

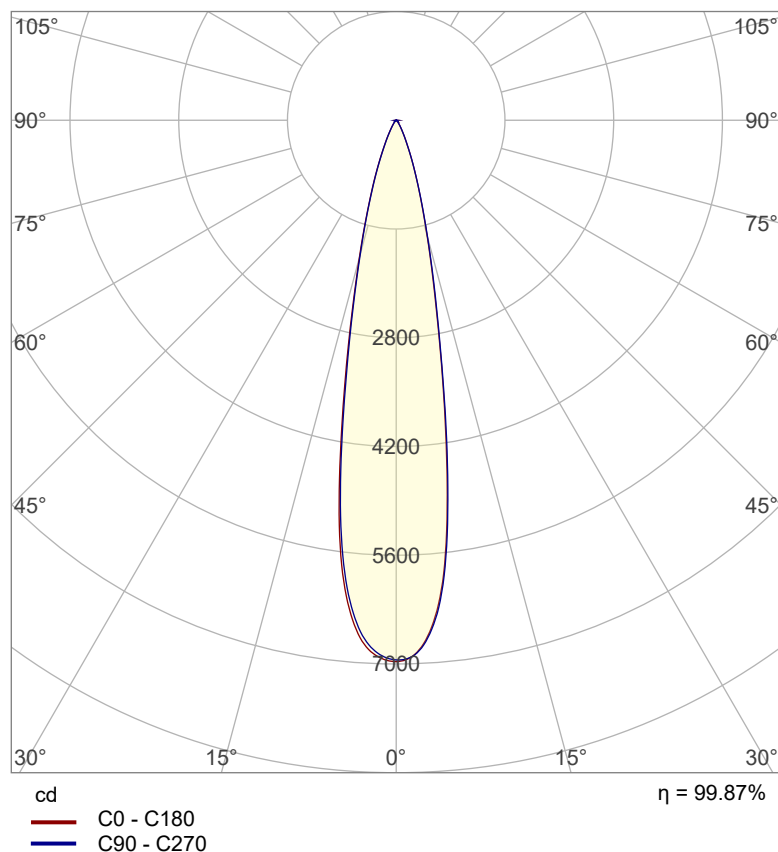


Beam details

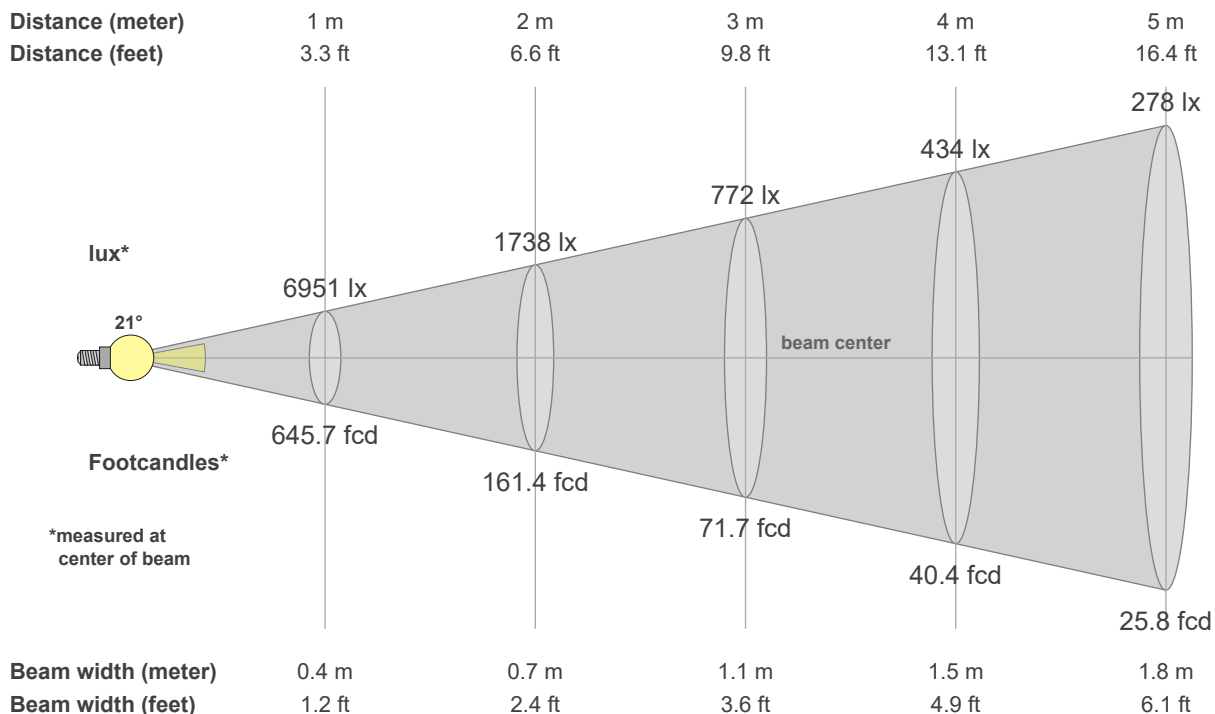


Luminaire budgetary diagram


LAMPS (number of lamps)

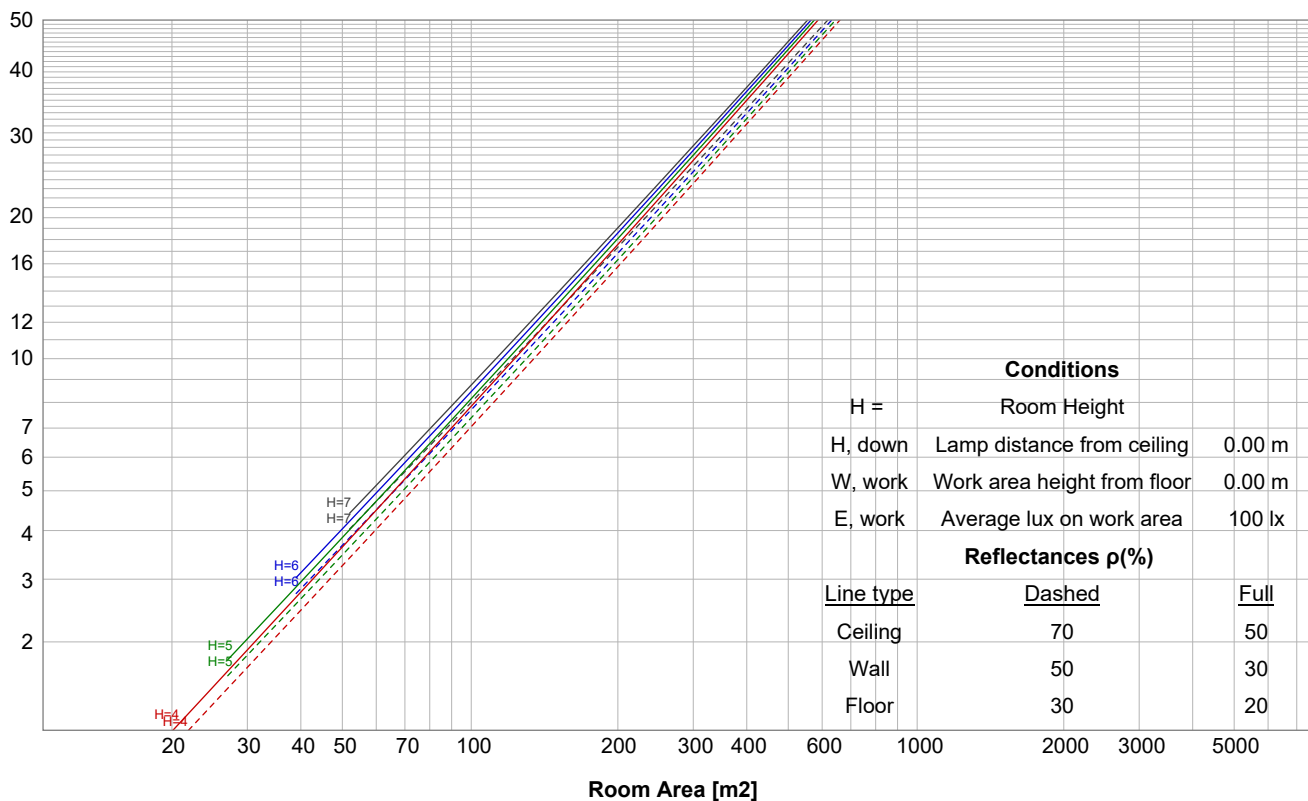


Iso-intensity Diagram (Iso-candela)

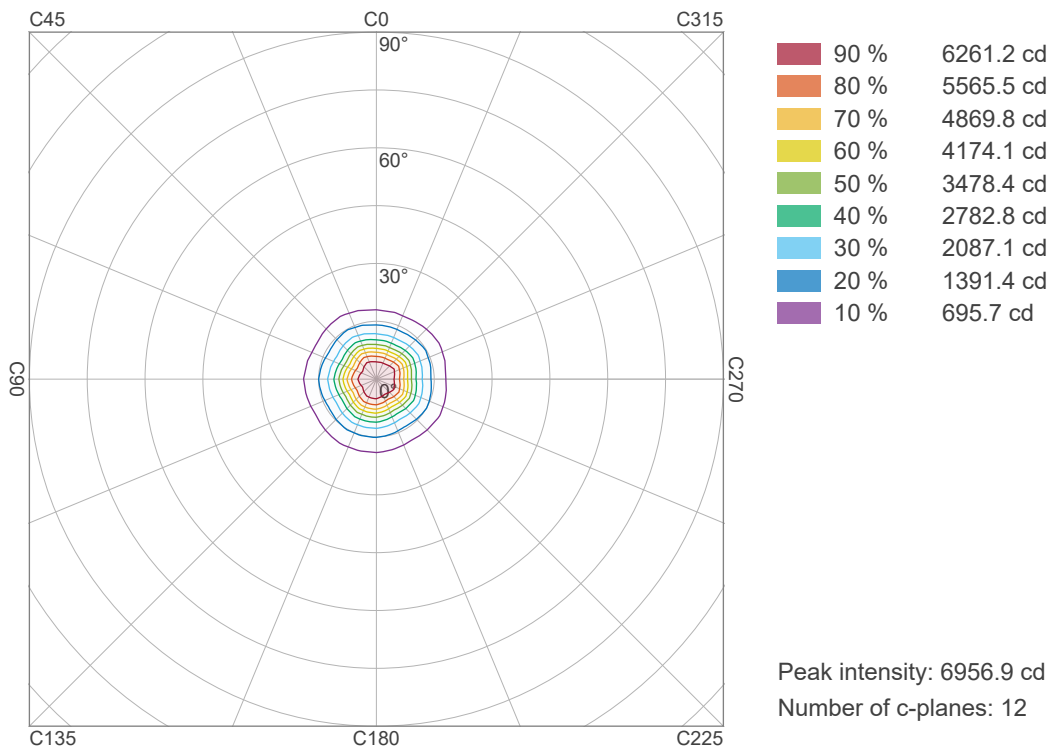

Iso-illuminance Diagram (Iso-lux)

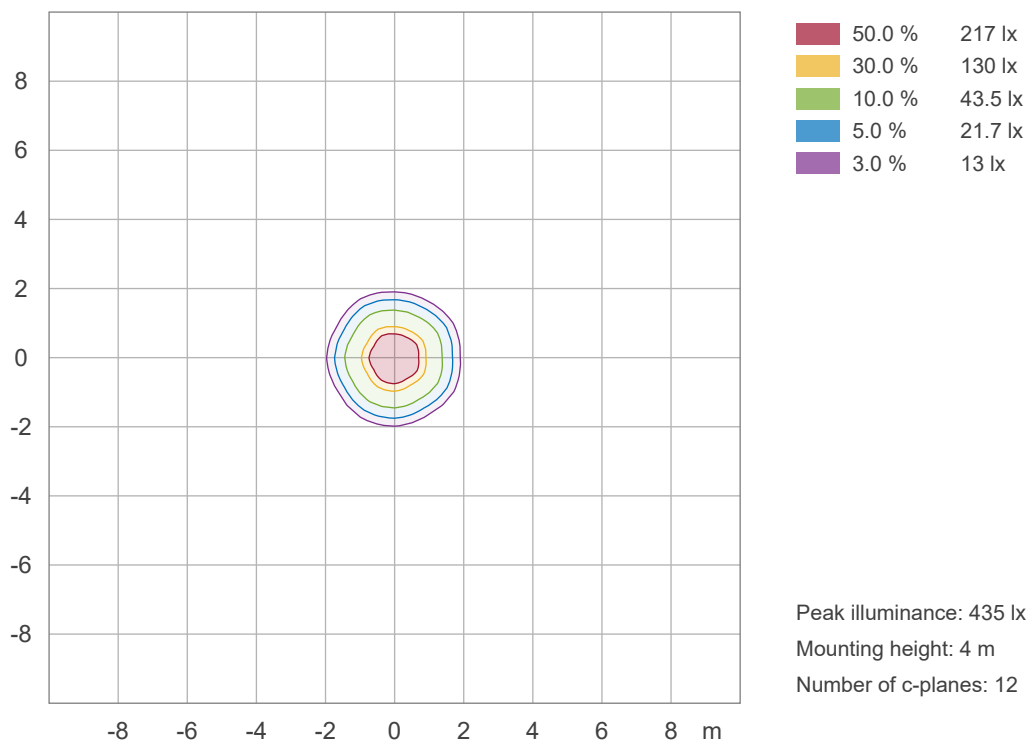


Linear intensity distribution diagram

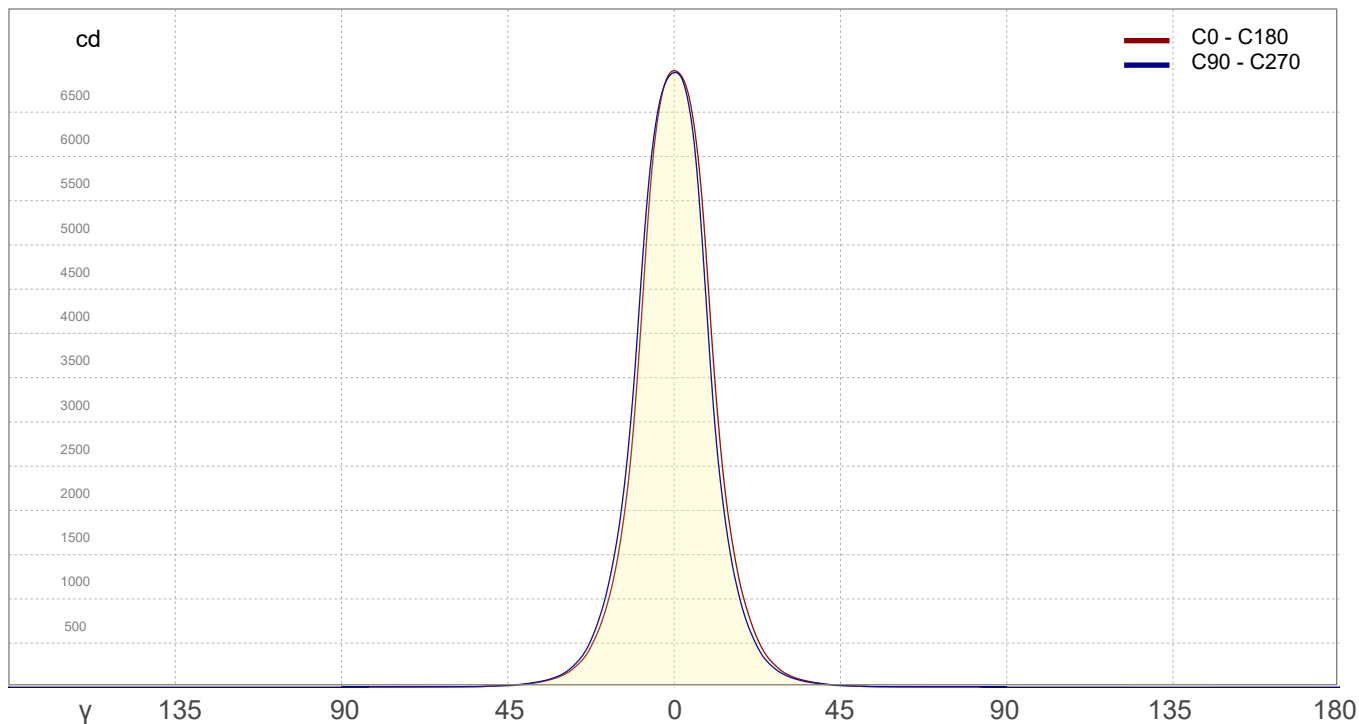

IESNA TM-15-07 Luminaire Classification System For Outdoor Luminaires

BUG rating B2 U0 G0

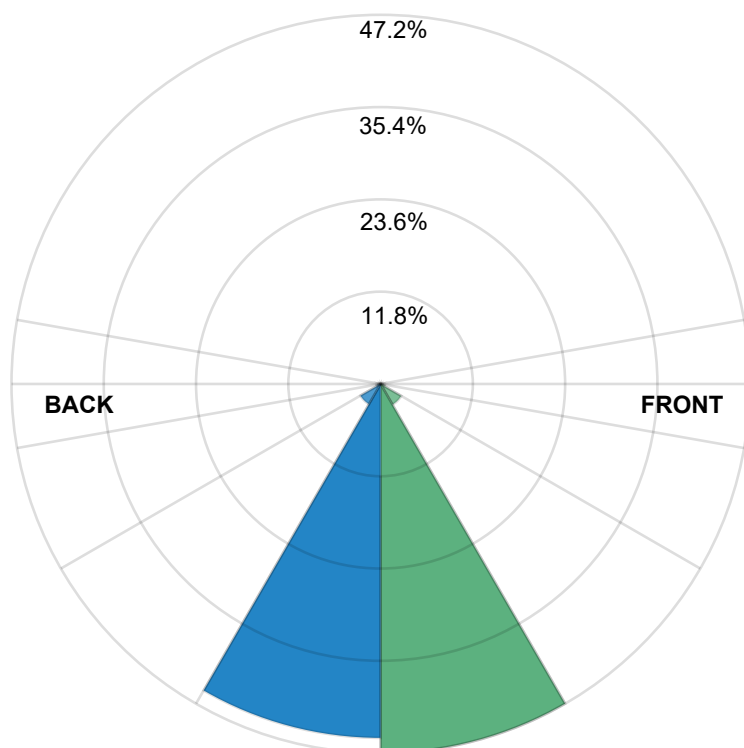

Forward Light

Low (0-30°)	597.3 lm	47.2%
Medium (30-60°)	38.6 lm	3.0%
High (60-80°)	6.8 lm	0.5%
Very High (80-90°)	3.4 lm	0.3%

Back Light

Low (0-30°)	572.7 lm	45.2%
Medium (30-60°)	37.6 lm	3.0%
High (60-80°)	6.7 lm	0.5%
Very High (80-90°)	3.3 lm	0.3%

Uplight

Low (90-100°)	0.0 lm	0.00%
High (100-180°)	0.0 lm	0.0%

Total

Sum	1266.5 lm	100,0%
-----	-----------	--------