

Light measurement report



Laboratory and Equipment

Test lab	n/a
Spectrometer Manufacturer and Model	n/a, n/a – n/a
Measurement date	7/14/2026

Measurement Conditions

Tested c-planes	12
Tested gamma angles	181 – 1.00°
Input Power	33.2 W


Tested Light Source

Luminaire	2023/4/19 19:30:03
Basic Luminous Shape	PANEL
Item No.	
Manufacturer	Moon On Noon


Main Light Measurement Results

Output – Total Lumen (Up% / Down%)	3566 lm – 0.0009% / 100%
Efficiency	107.4 lm/W
Peak Intensity	5278 cd
Correlated Color Temperature, CCT	2700 K
Color Rendering Index	CRI 85.0

Polar light distribution diagram

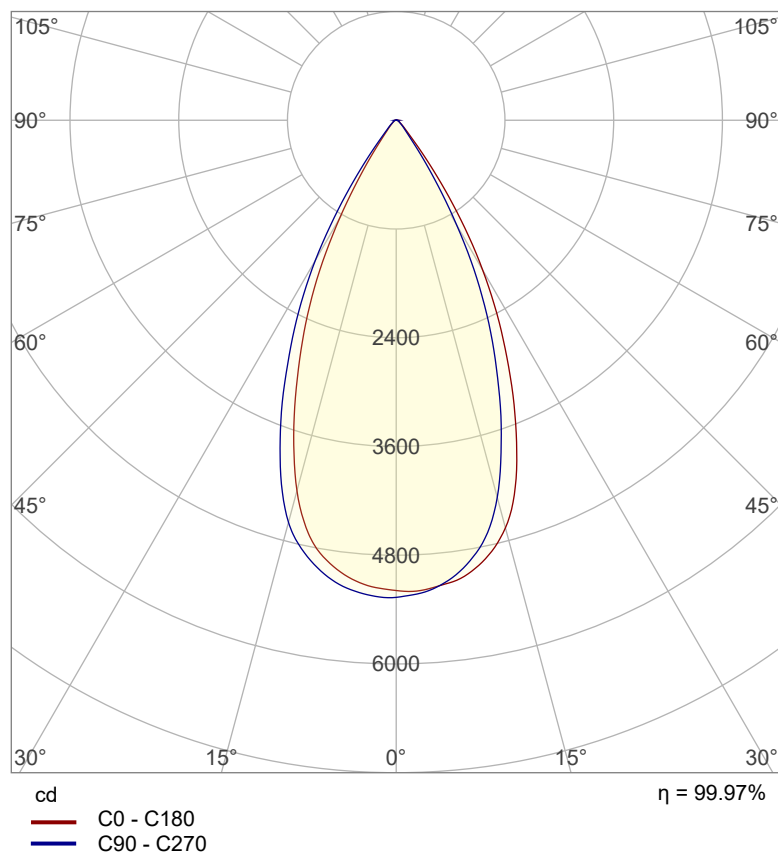


Beam details

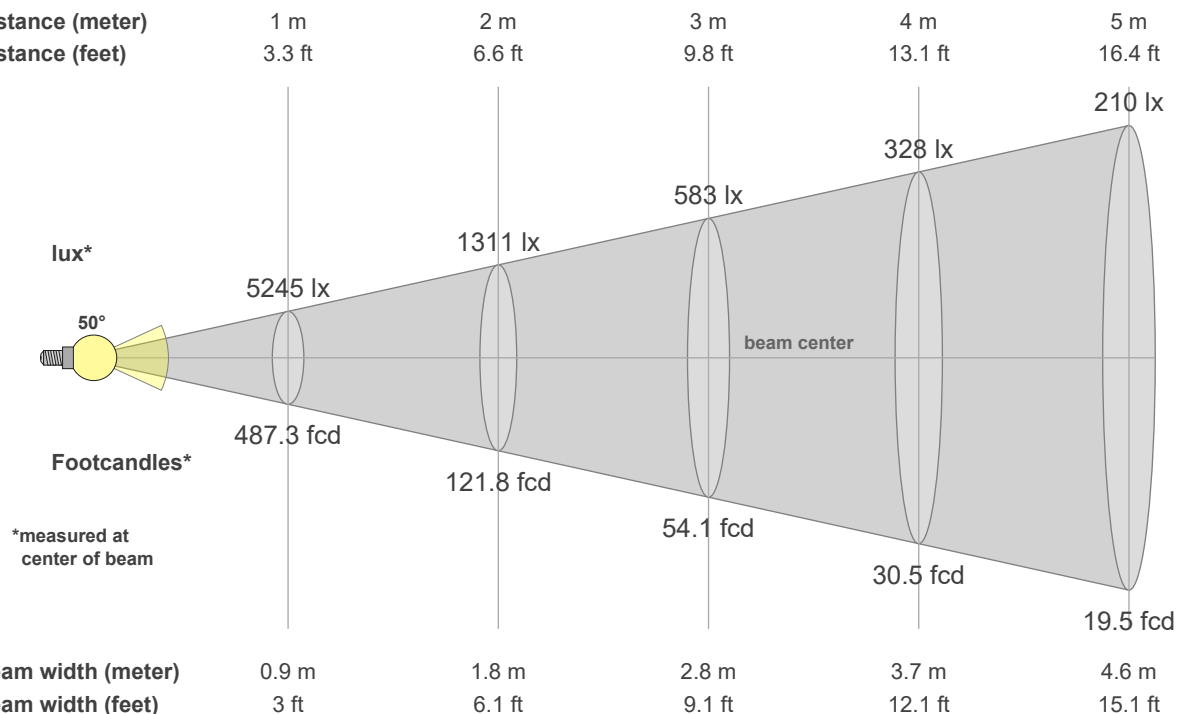


Luminaire budgetary diagram


LAMPS (number of lamps)

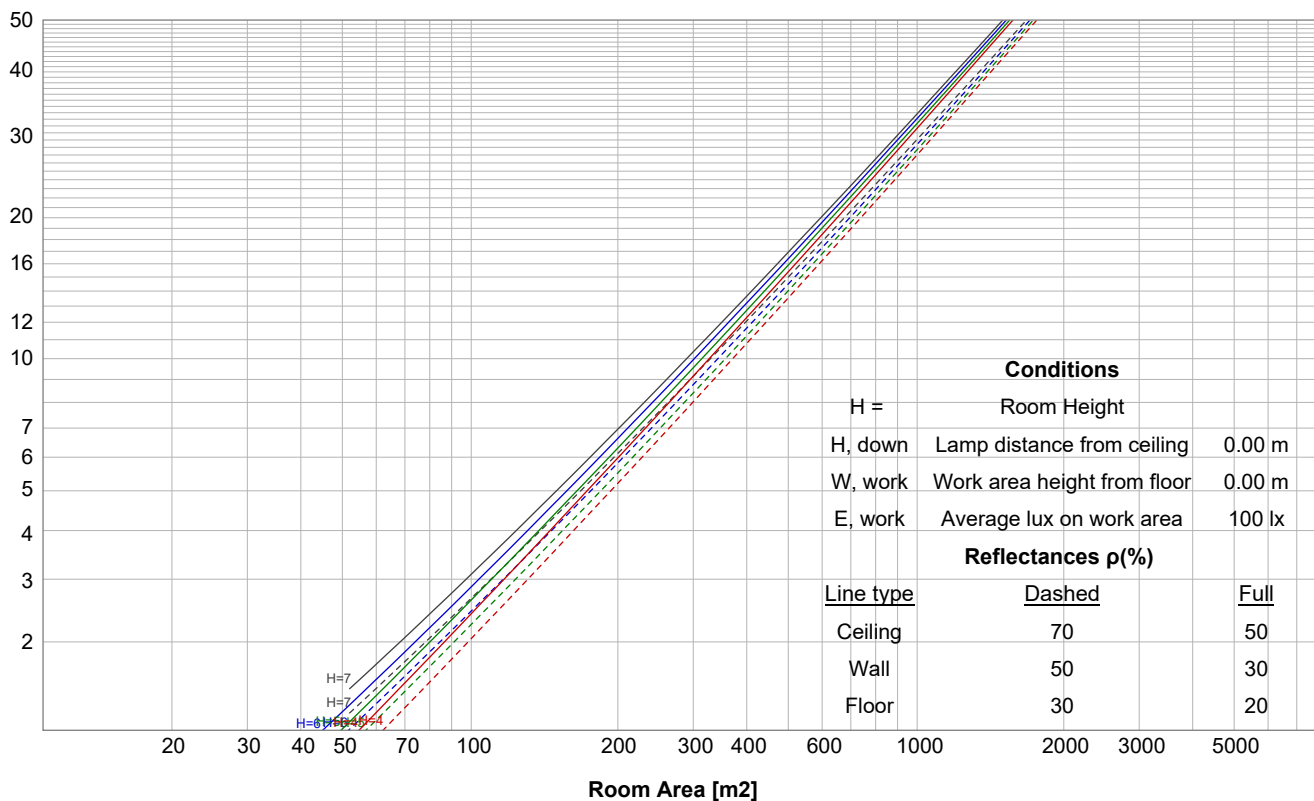


Iso-intensity Diagram (Iso-candela)

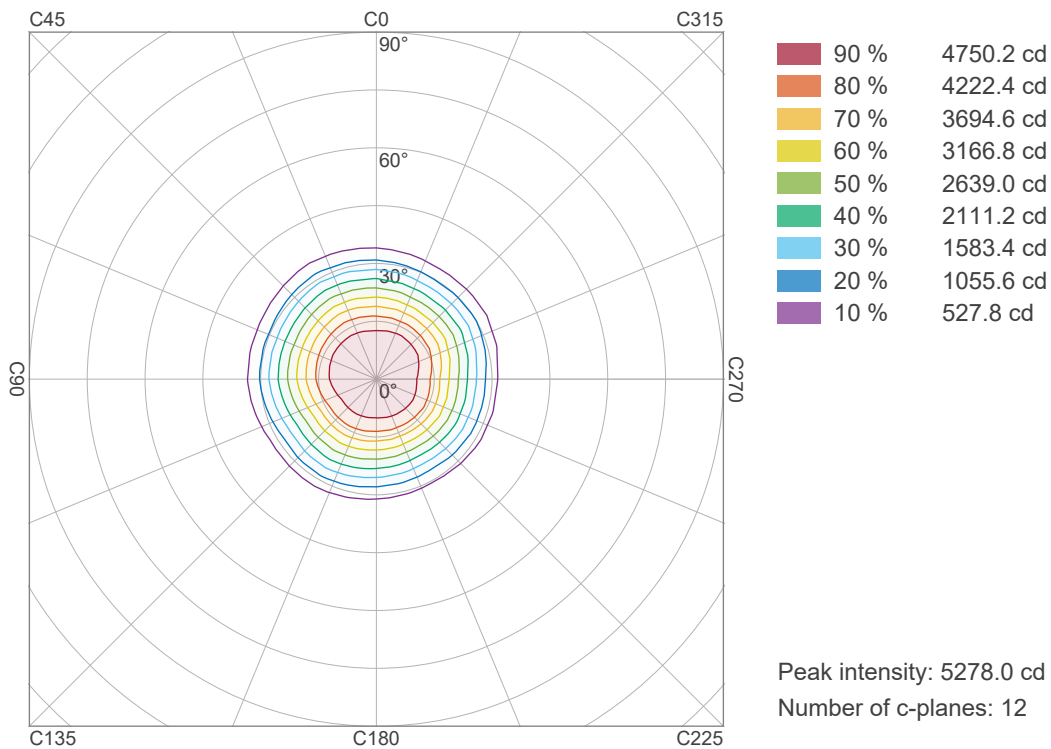

Iso-illuminance Diagram (Iso-lux)

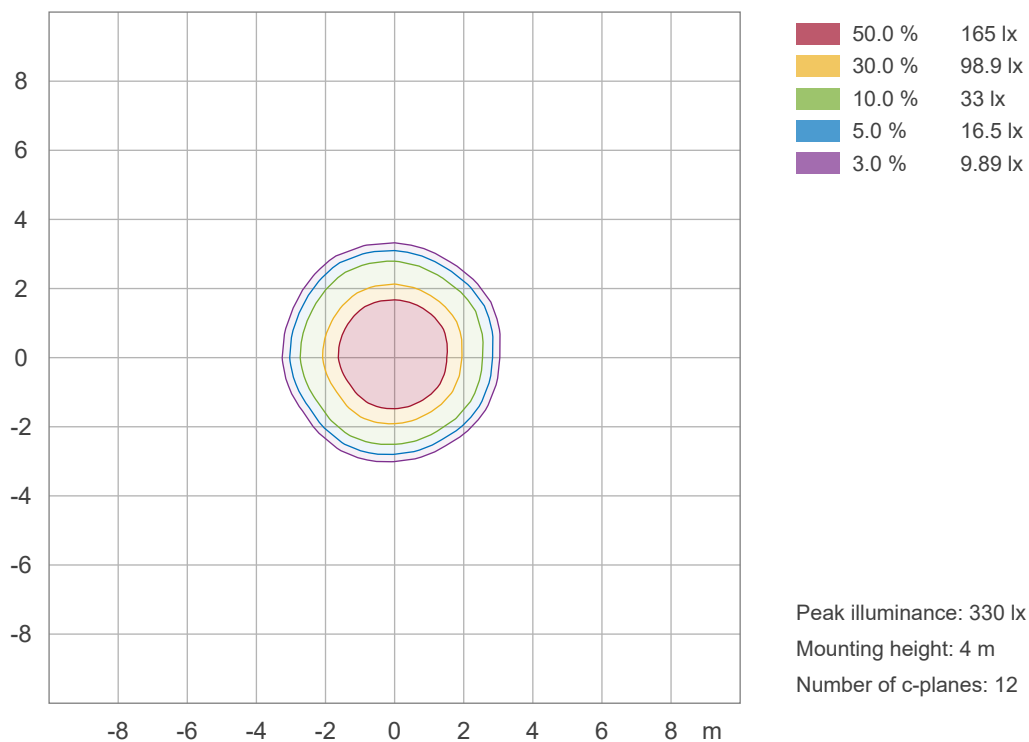


Linear intensity distribution diagram

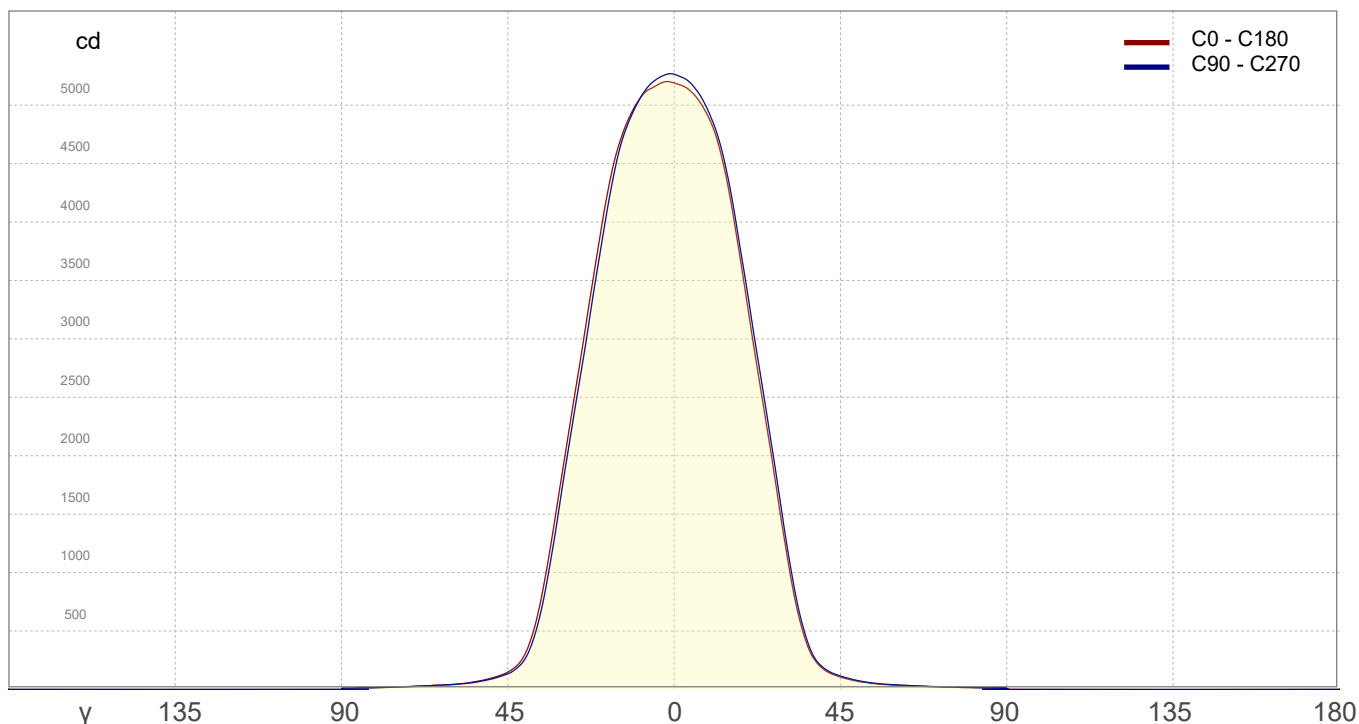

IESNA TM-15-07 Luminaire Classification System For Outdoor Luminaires

BUG rating B3 U0 G0

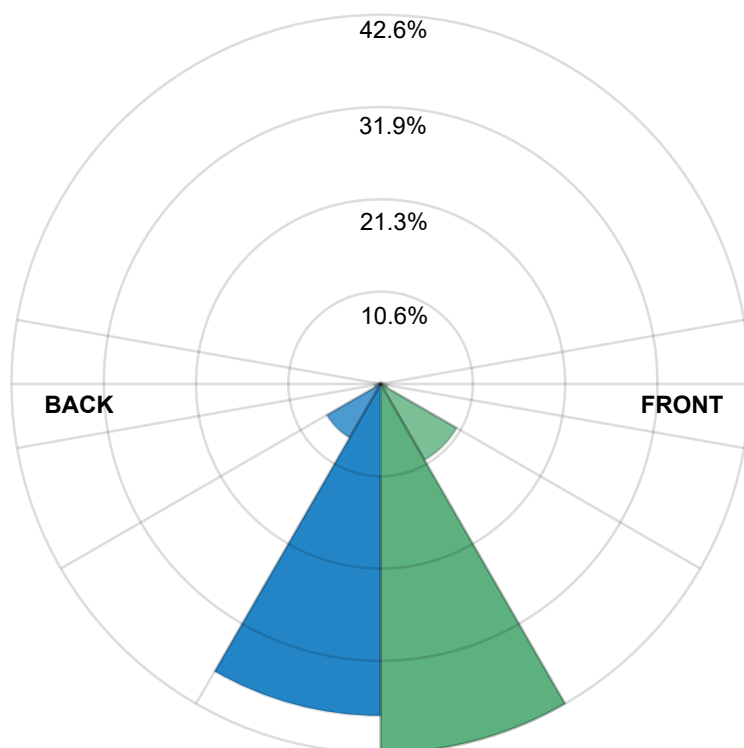

Forward Light

Low (0-30°)	1517.6 lm	42.6%
Medium (30-60°)	361.9 lm	10.1%
High (60-80°)	28.0 lm	0.8%
Very High (80-90°)	7.0 lm	0.2%

Back Light

Low (0-30°)	1364.4 lm	38.3%
Medium (30-60°)	255.7 lm	7.2%
High (60-80°)	24.9 lm	0.7%
Very High (80-90°)	6.6 lm	0.2%

Uplight

Low (90-100°)	0.0 lm	0.00%
High (100-180°)	0.0 lm	0.0%

Total

Sum	3565.9 lm	100,0%
-----	-----------	--------