

Light measurement report



Laboratory and Equipment

Test lab	n/a
Spectrometer Manufacturer and Model	n/a, n/a – n/a
Measurement date	7/14/2026

Measurement Conditions

Tested c-planes	12
Tested gamma angles	181 – 1.00°
Input Power	32.24 W


Tested Light Source

Luminaire	2023/4/3 10:53:12
Basic Luminous Shape	PANEL
Item No.	
Manufacturer	Moon On Noon


Main Light Measurement Results

Output – Total Lumen (Up% / Down%)	2956 lm – 0.0006% / 100%
Efficiency	91.7 lm/W
Peak Intensity	11.26 kcd
Correlated Color Temperature, CCT	2700 K
Color Rendering Index	CRI 85.0

Polar light distribution diagram

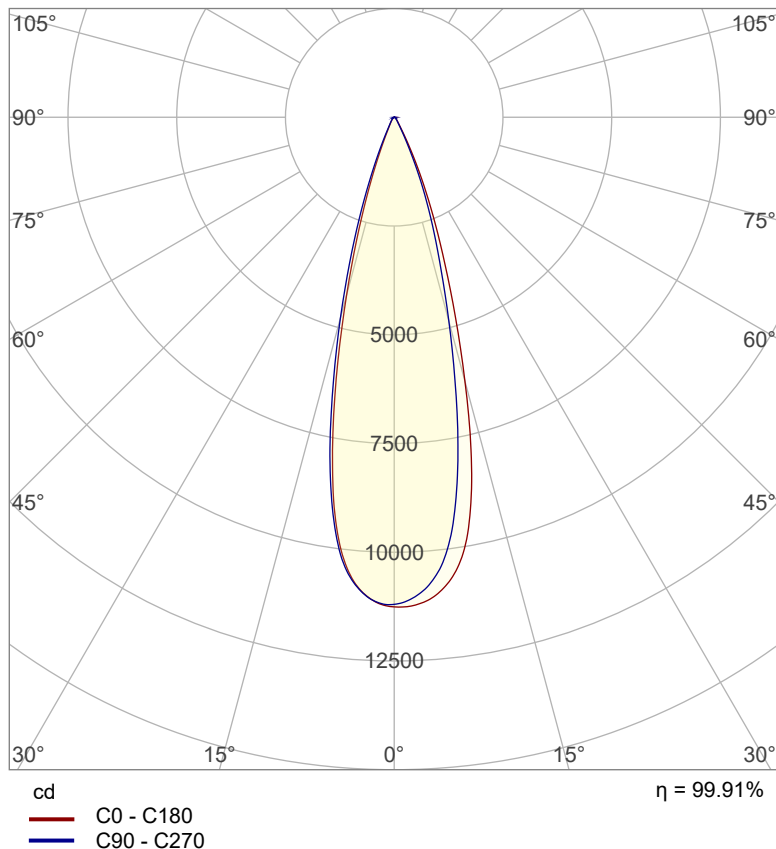


Beam details

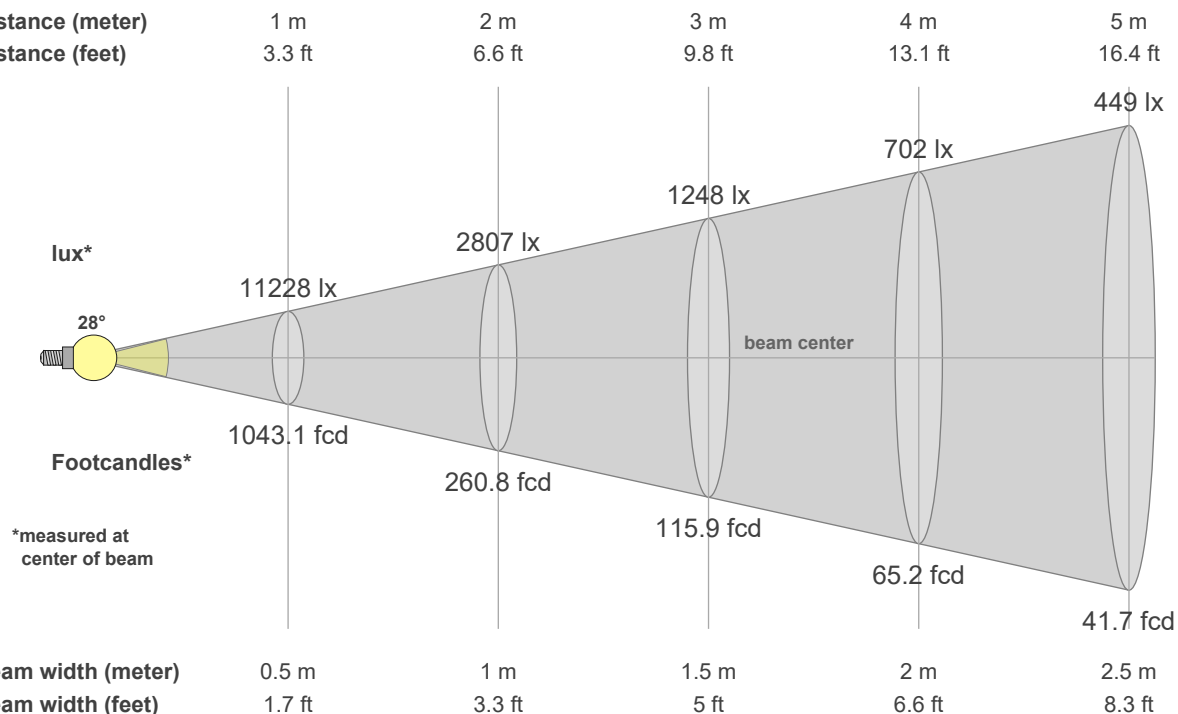


Luminaire budgetary diagram


LAMPS (number of lamps)

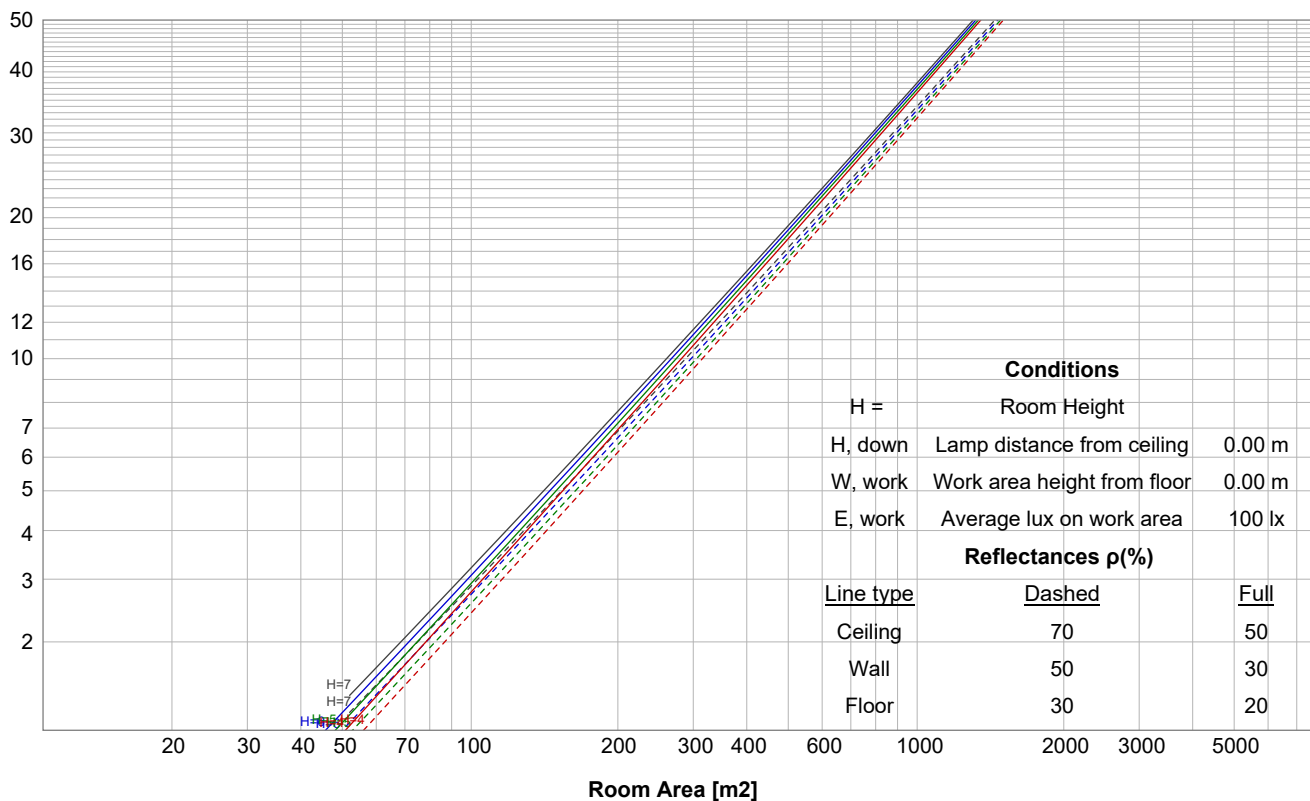


Iso-intensity Diagram (Iso-candela)

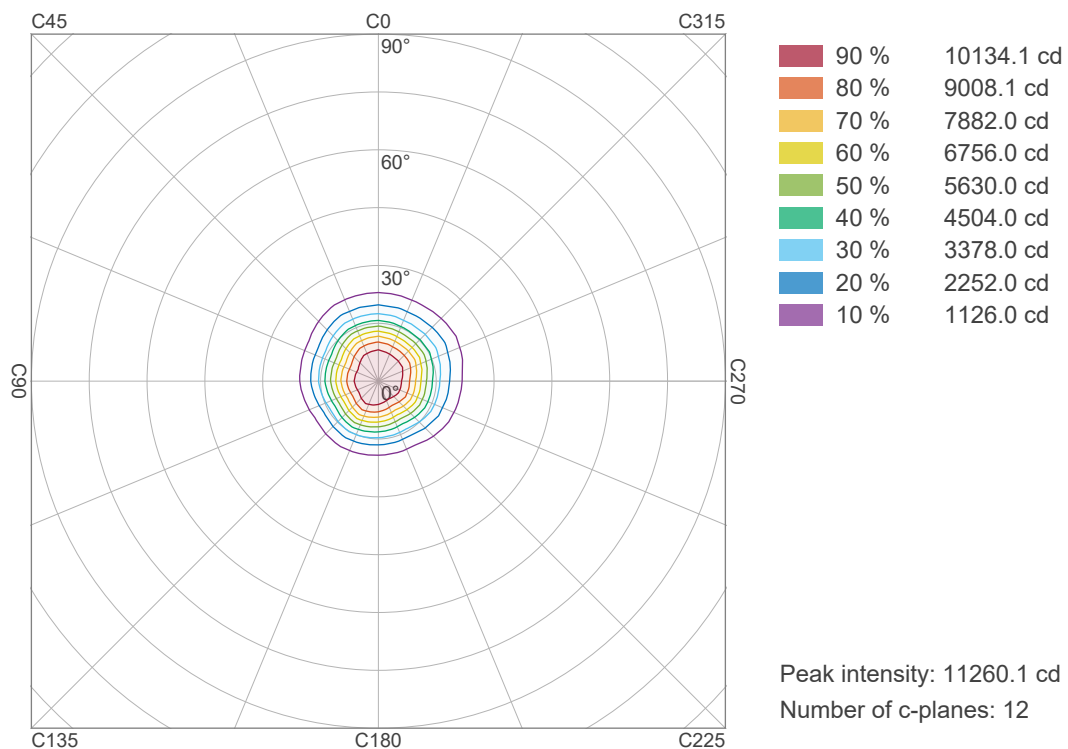

Iso-illuminance Diagram (Iso-lux)

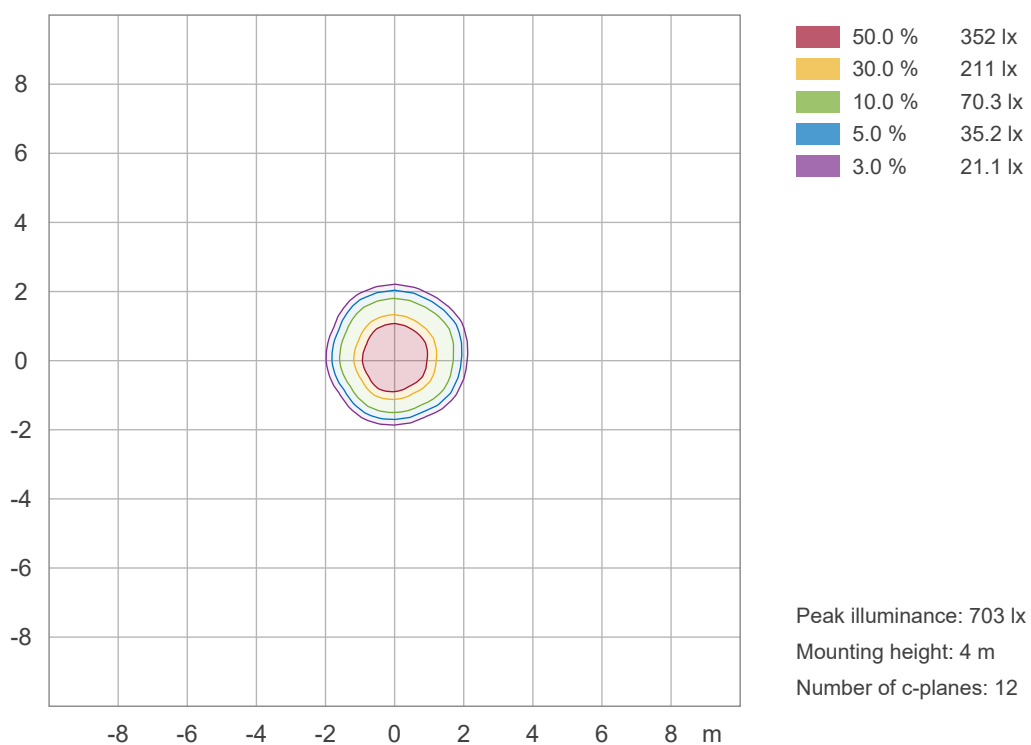


Linear intensity distribution diagram

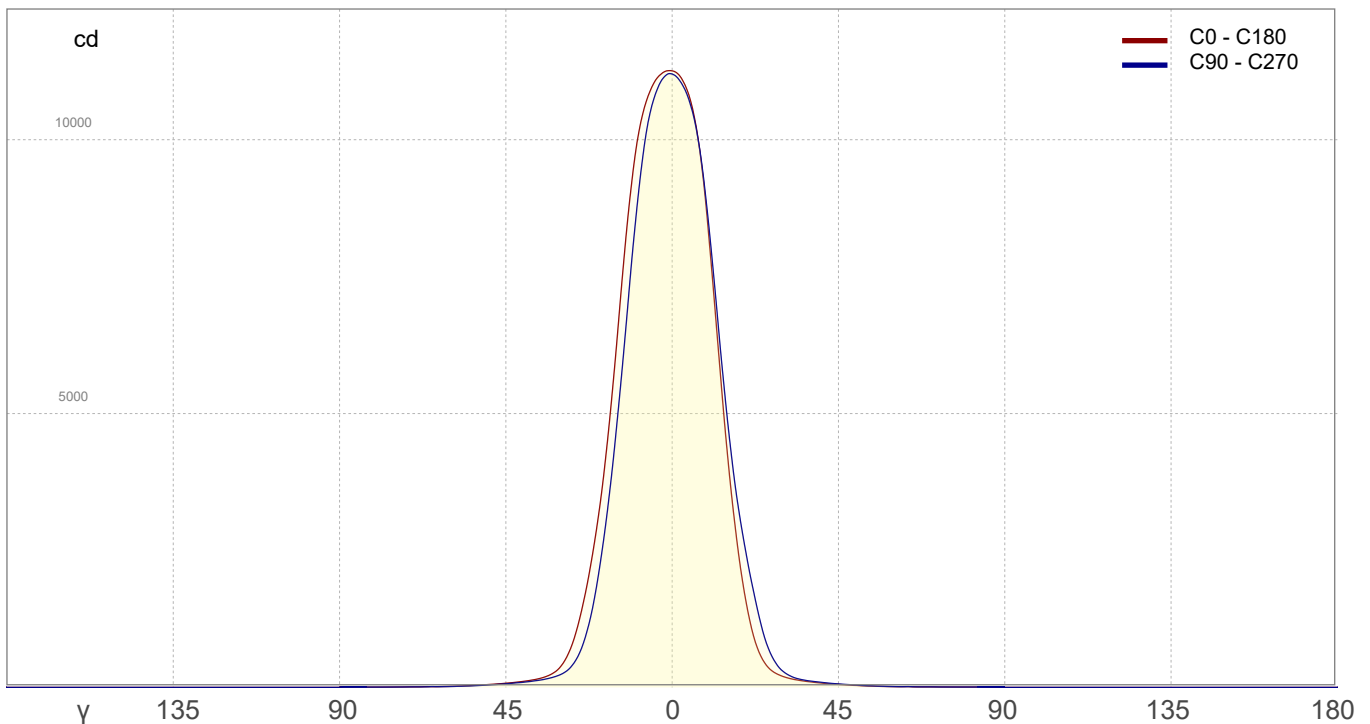

IESNA TM-15-07 Luminaire Classification System For Outdoor Luminaires

BUG rating B3 U0 G0

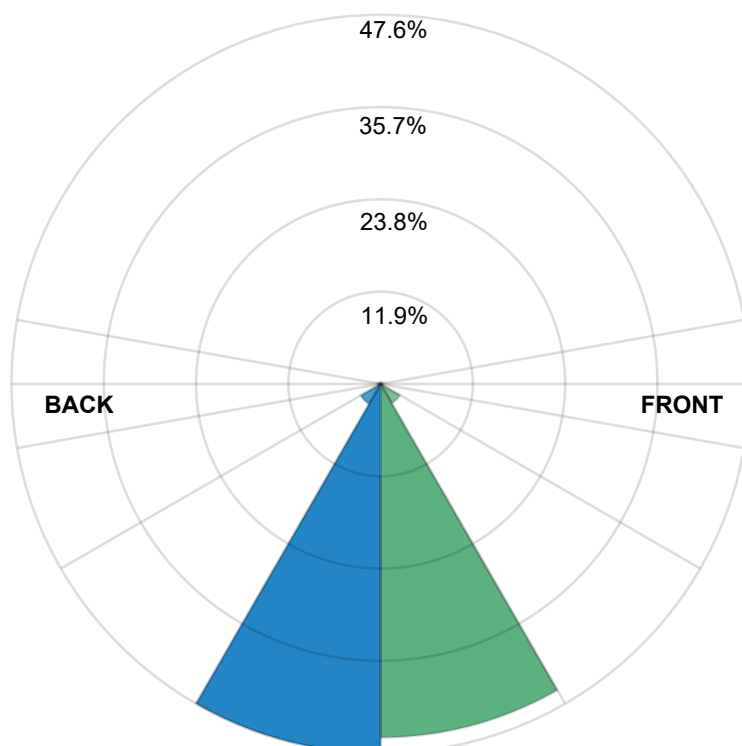

Forward Light

Low (0-30°)	1348.8 lm	45.6%
Medium (30-60°)	85.2 lm	2.9%
High (60-80°)	9.5 lm	0.3%
Very High (80-90°)	2.8 lm	0.1%

Back Light

Low (0-30°)	1408.2 lm	47.6%
Medium (30-60°)	88.3 lm	3.0%
High (60-80°)	10.0 lm	0.3%
Very High (80-90°)	3.7 lm	0.1%

Uplight

Low (90-100°)	0.0 lm	0.00%
High (100-180°)	0.0 lm	0.0%

Total

Sum	2956.5 lm	100,0%
-----	-----------	--------