

Light measurement report



Laboratory and Equipment

Test lab	n/a
Spectrometer Manufacturer and Model	n/a, n/a – n/a
Measurement date	6/29/2026

Measurement Conditions

Tested c-planes	8
Tested gamma angles	181 – 1.00°
Input Power	14.57 W


Tested Light Source

Luminaire	2021/12/23 10:39:41
Basic Luminous Shape	PANEL
Item No.	
Manufacturer	Moon On Noon


Main Light Measurement Results

Output – Total Lumen (Up% / Down%)	1035 lm – 0.0006% / 100%
Efficiency	71.04 lm/W
Peak Intensity	4831 cd
Correlated Color Temperature, CCT	3000 K
Color Rendering Index	CRI 85.0

Polar light distribution diagram

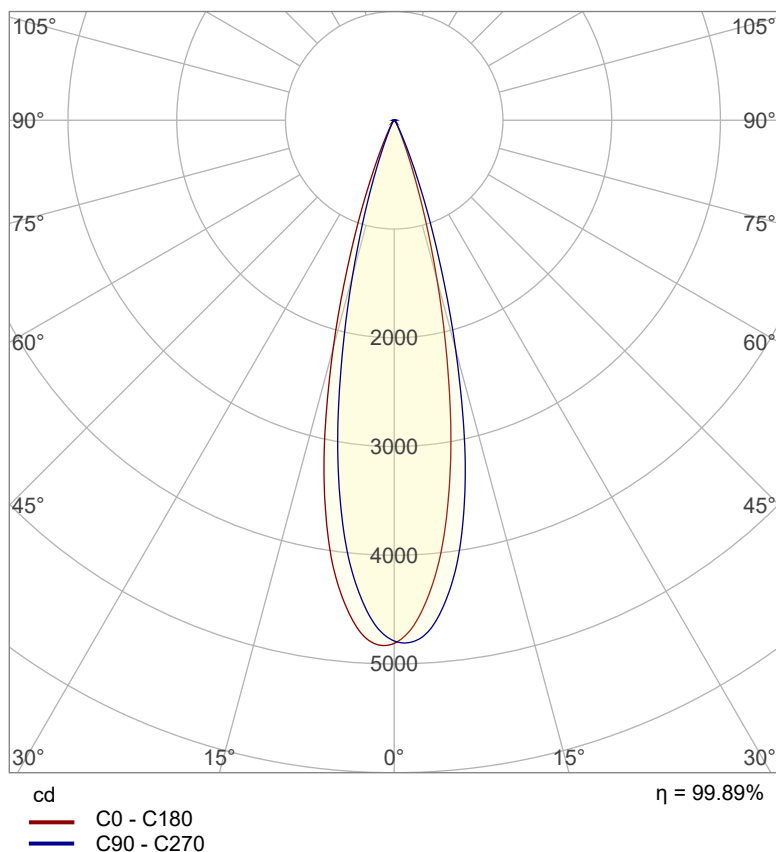


Beam details

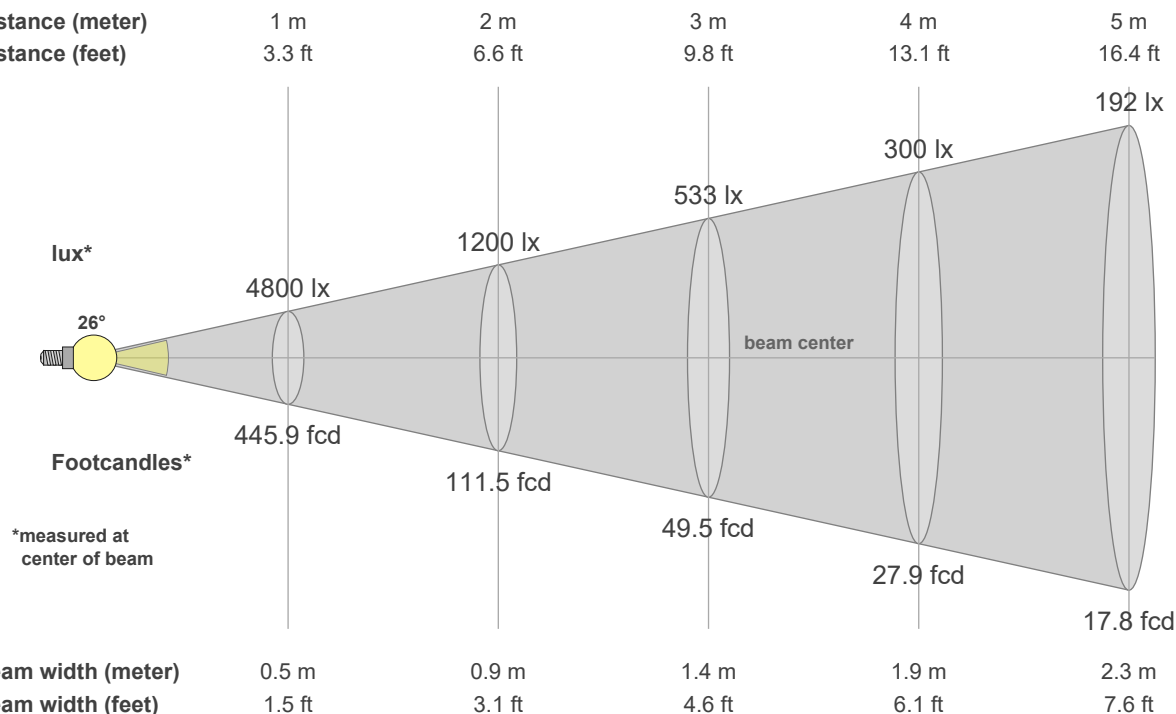


Luminaire budgetary diagram


LAMPS (number of lamps)

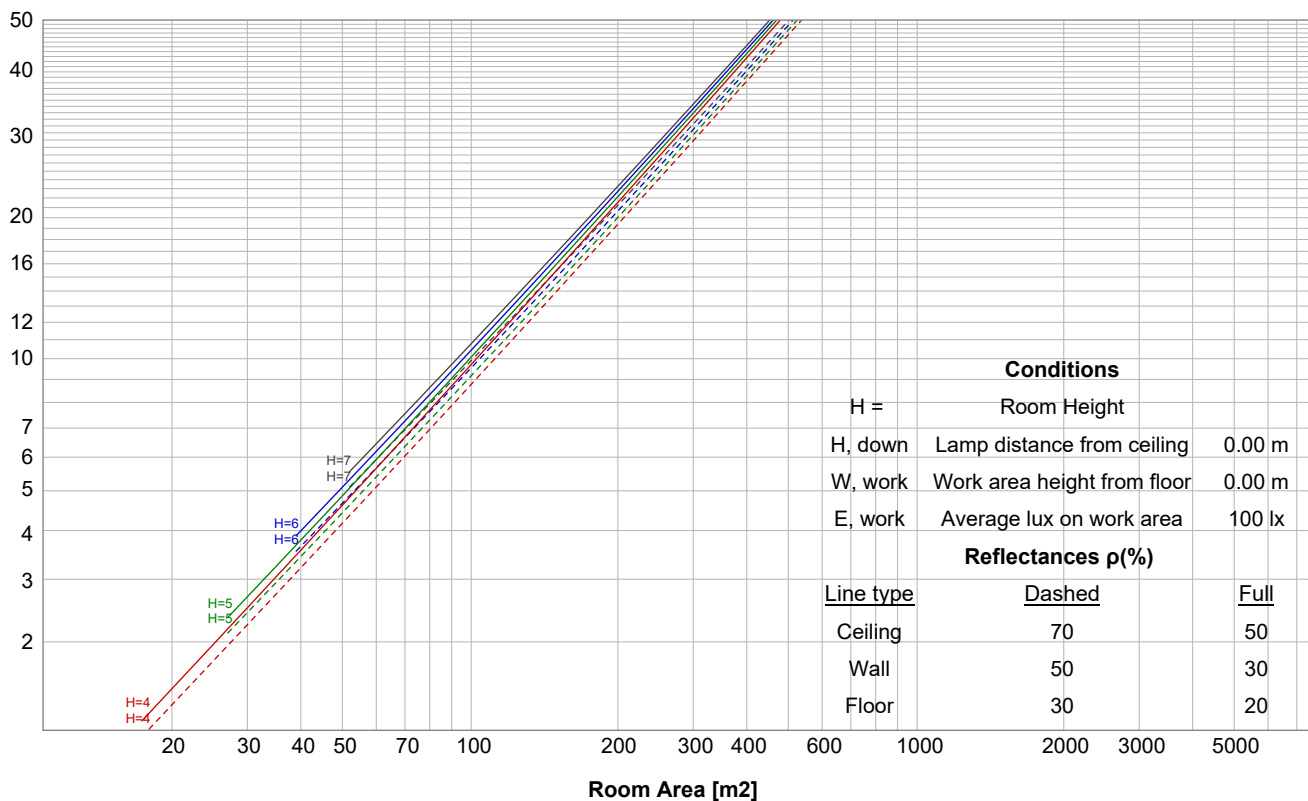


Iso-intensity Diagram (Iso-candela)

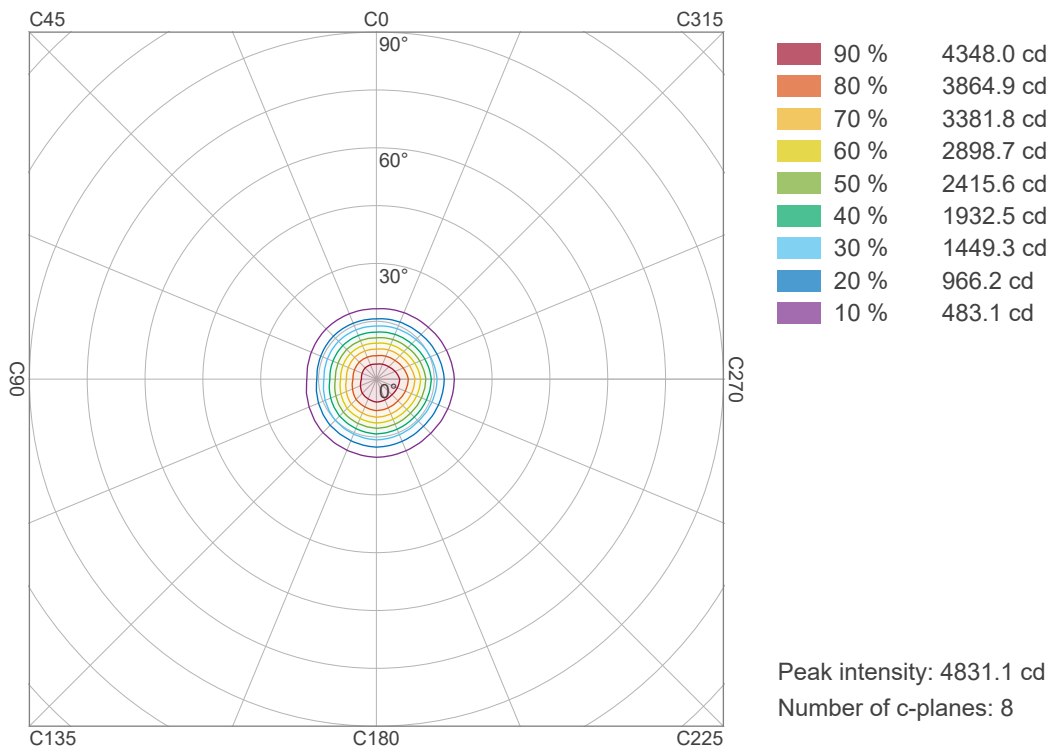

Iso-illuminance Diagram (Iso-lux)

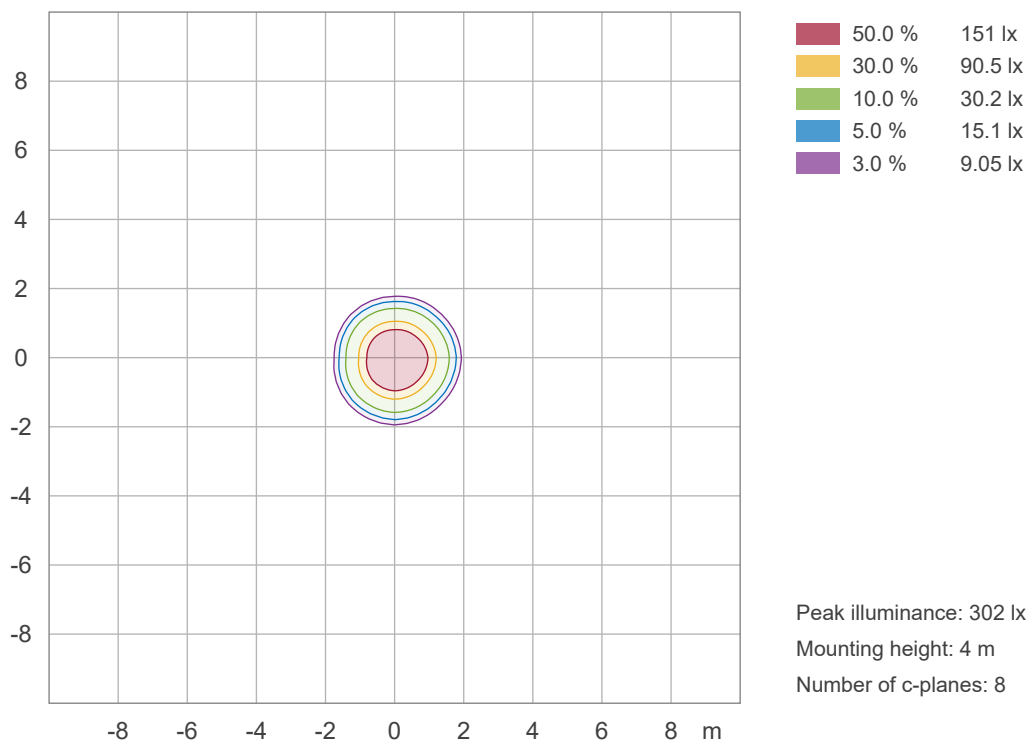


Linear intensity distribution diagram

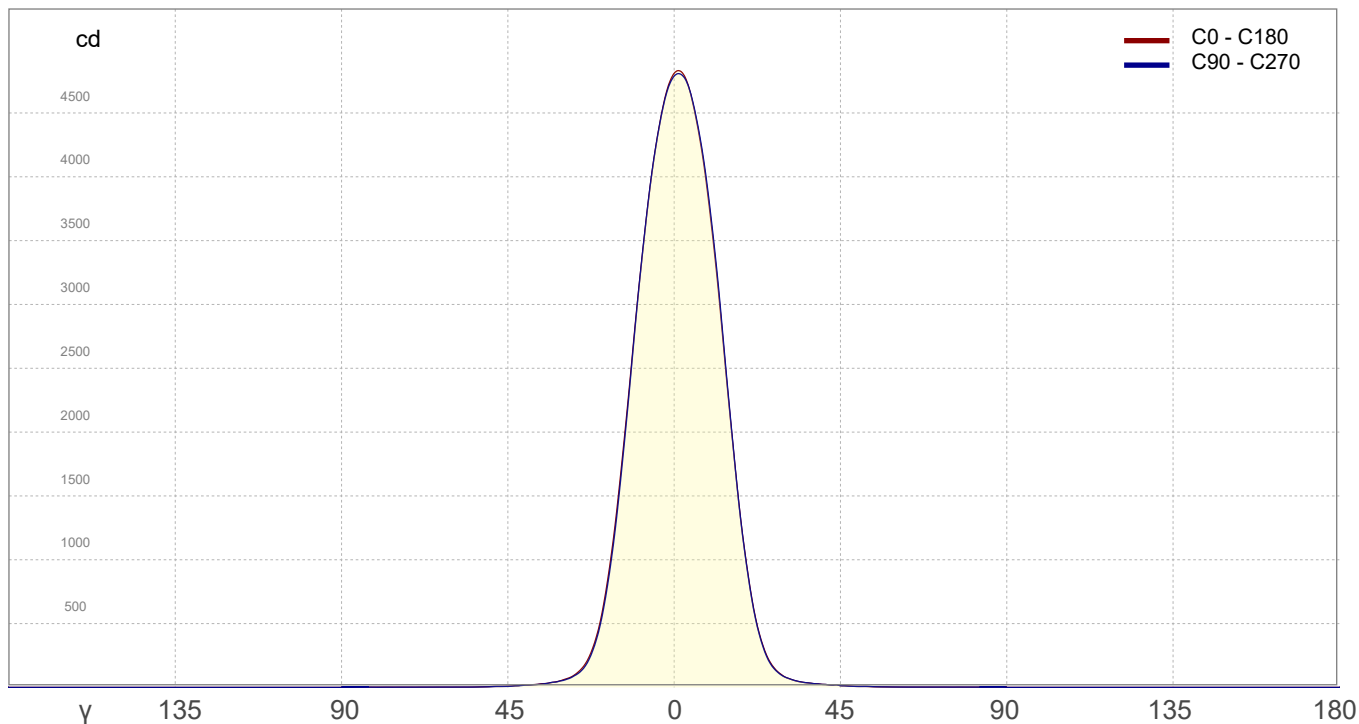

IESNA TM-15-07 Luminaire Classification System For Outdoor Luminaires

BUG rating B1 U0 G0

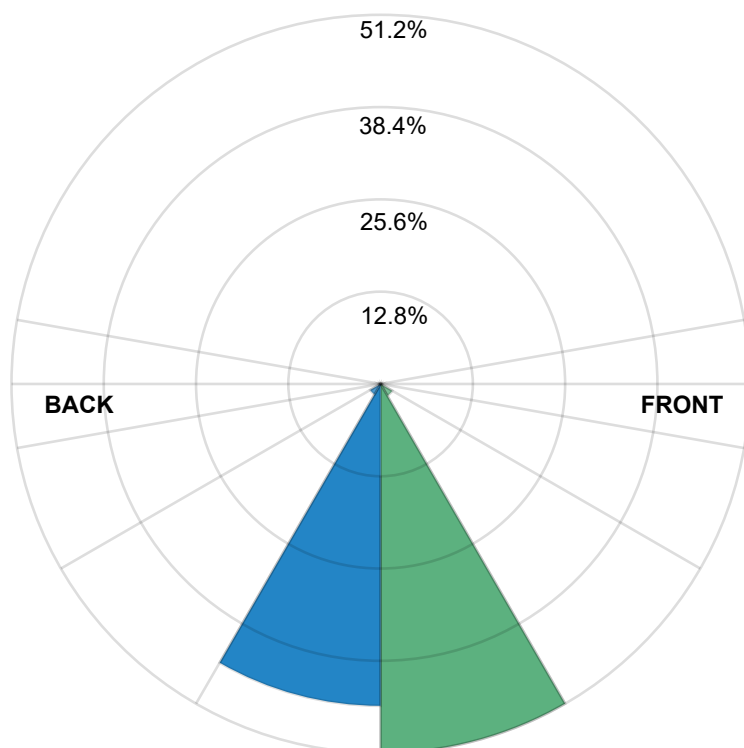

Forward Light

Low (0-30°)	529.7 lm	51.2%
Medium (30-60°)	19.3 lm	1.9%
High (60-80°)	2.4 lm	0.2%
Very High (80-90°)	1.1 lm	0.1%

Back Light

Low (0-30°)	461.9 lm	44.6%
Medium (30-60°)	17.2 lm	1.7%
High (60-80°)	2.4 lm	0.2%
Very High (80-90°)	1.1 lm	0.1%

Uplight

Low (90-100°)	0.0 lm	0.00%
High (100-180°)	0.0 lm	0.0%

Total

Sum	1035.1 lm	100,0%
-----	-----------	--------