

Light measurement report



Laboratory and Equipment

Test lab	n/a
Spectrometer Manufacturer and Model	n/a, n/a – n/a
Measurement date	6/26/2026

Measurement Conditions

Tested c-planes	8
Tested gamma angles	181 – 1.00°
Input Power	6.28 W


Tested Light Source

Luminaire	2021/12/22 14:16:41
Basic Luminous Shape	PANEL
Item No.	
Manufacturer	Moon On Noon


Main Light Measurement Results

Output – Total Lumen (Up% / Down%)	477.8 lm – 0.0003% / 100%
Efficiency	76.09 lm/W
Peak Intensity	3624 cd
Correlated Color Temperature, CCT	3000 K
Color Rendering Index	CRI 85.0

Polar light distribution diagram

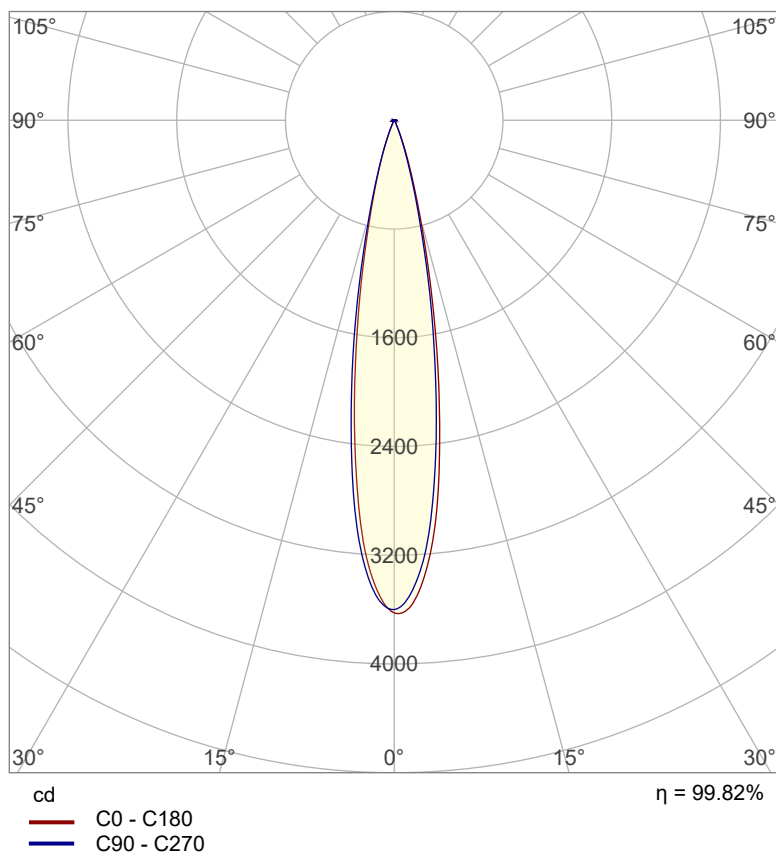


Beam details

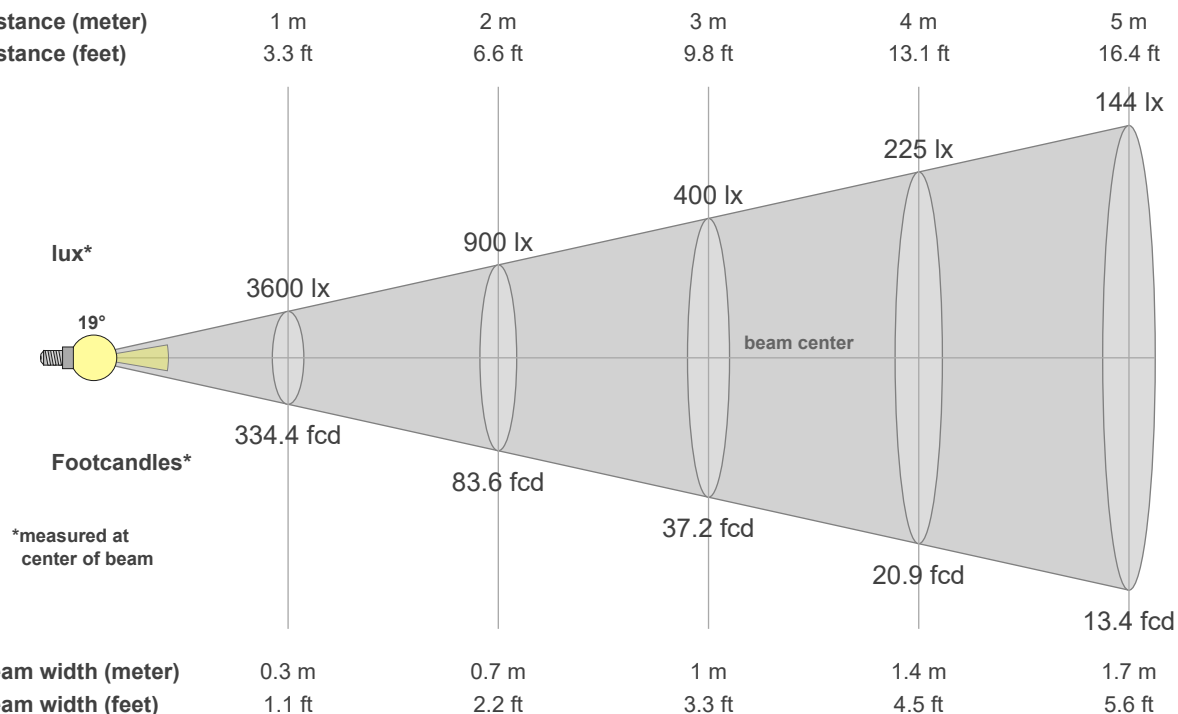


Luminaire budgetary diagram


LAMPS (number of lamps)

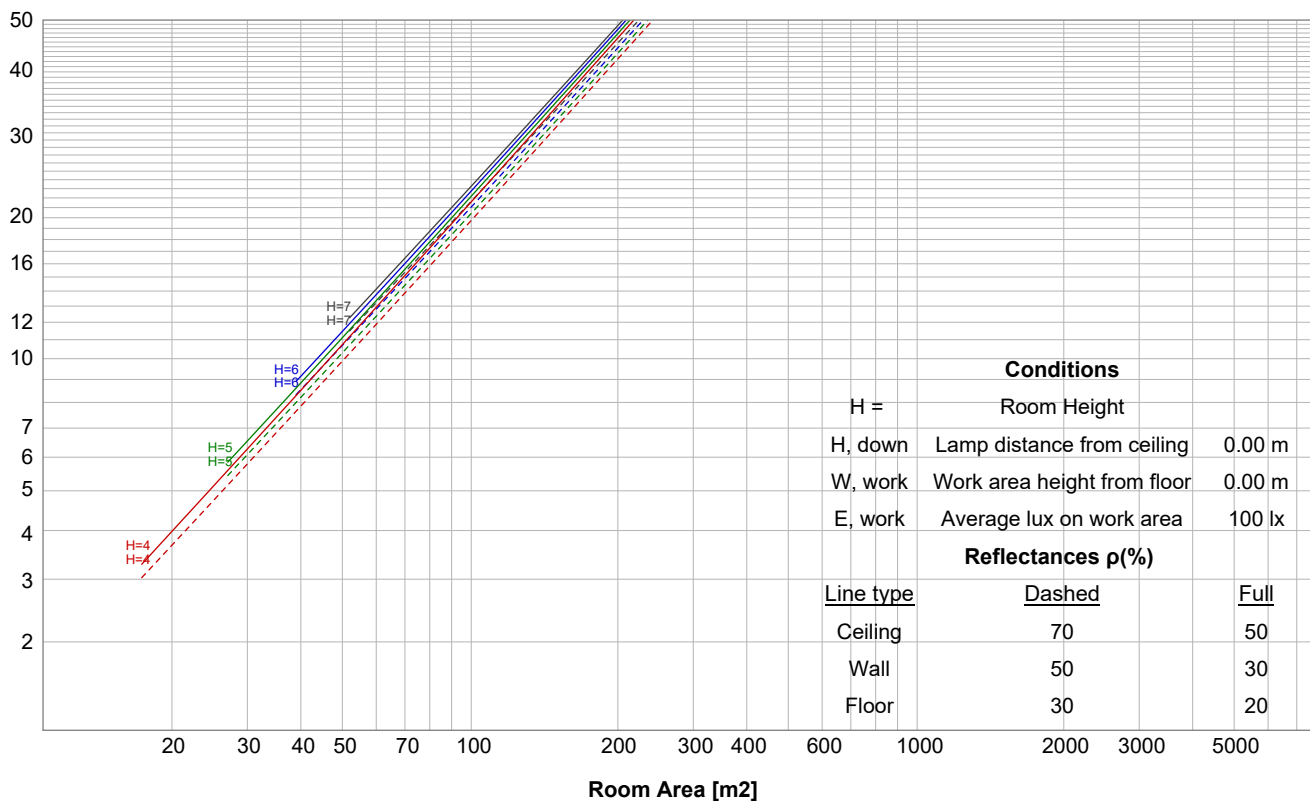


Iso-intensity Diagram (Iso-candela)

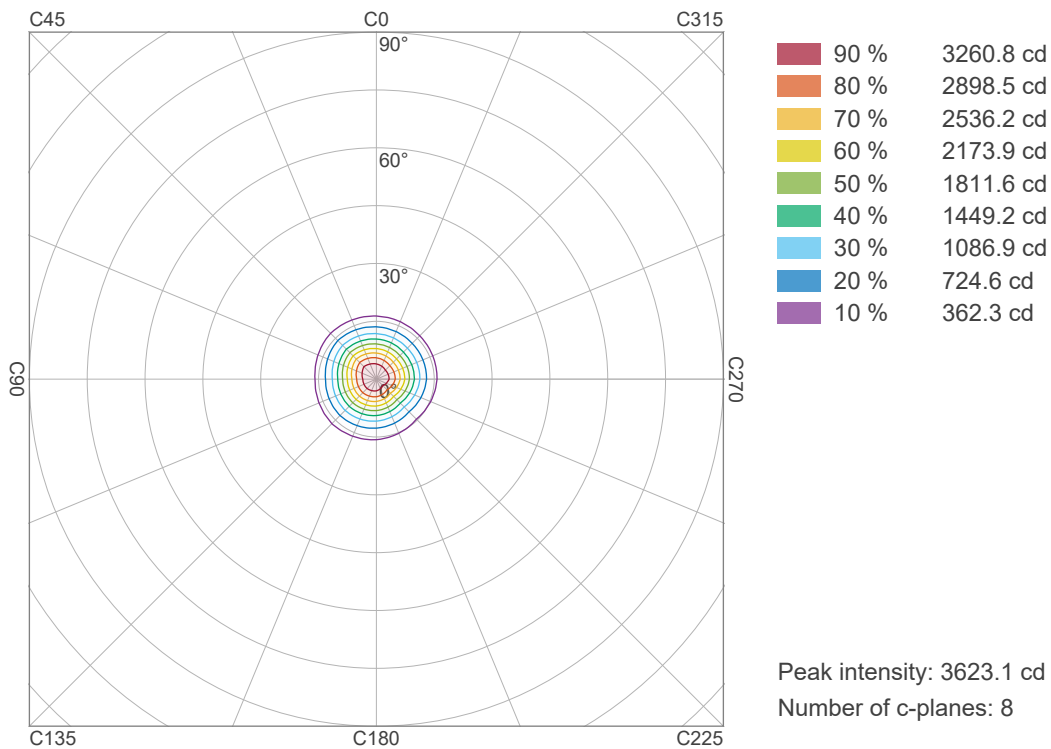

Iso-illuminance Diagram (Iso-lux)

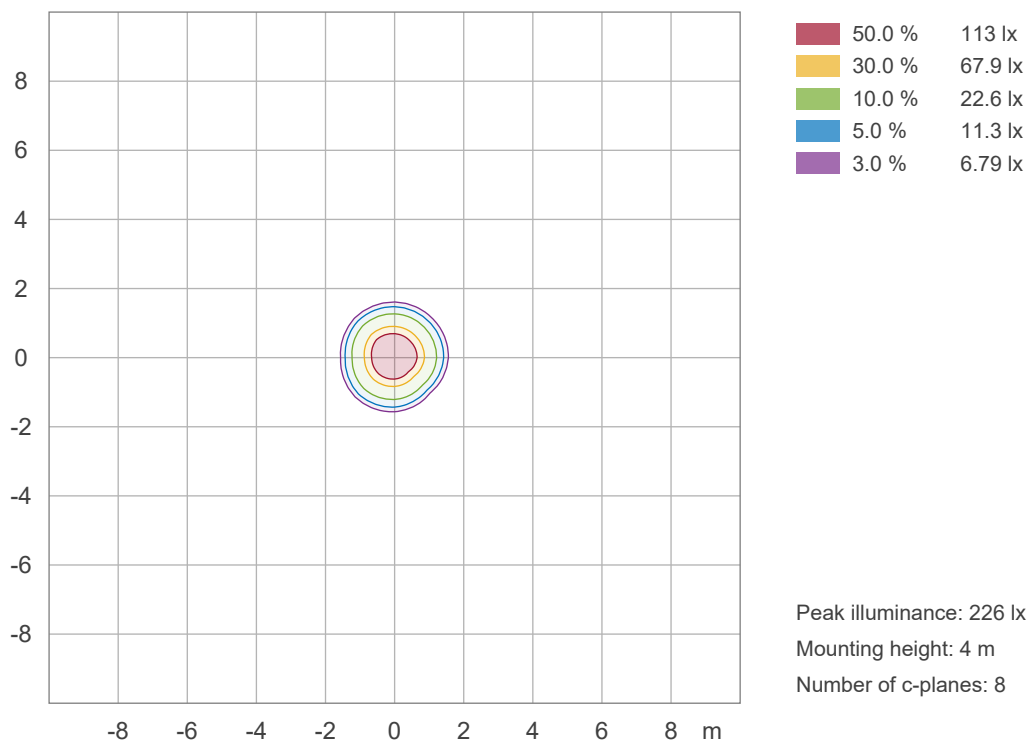


Linear intensity distribution diagram

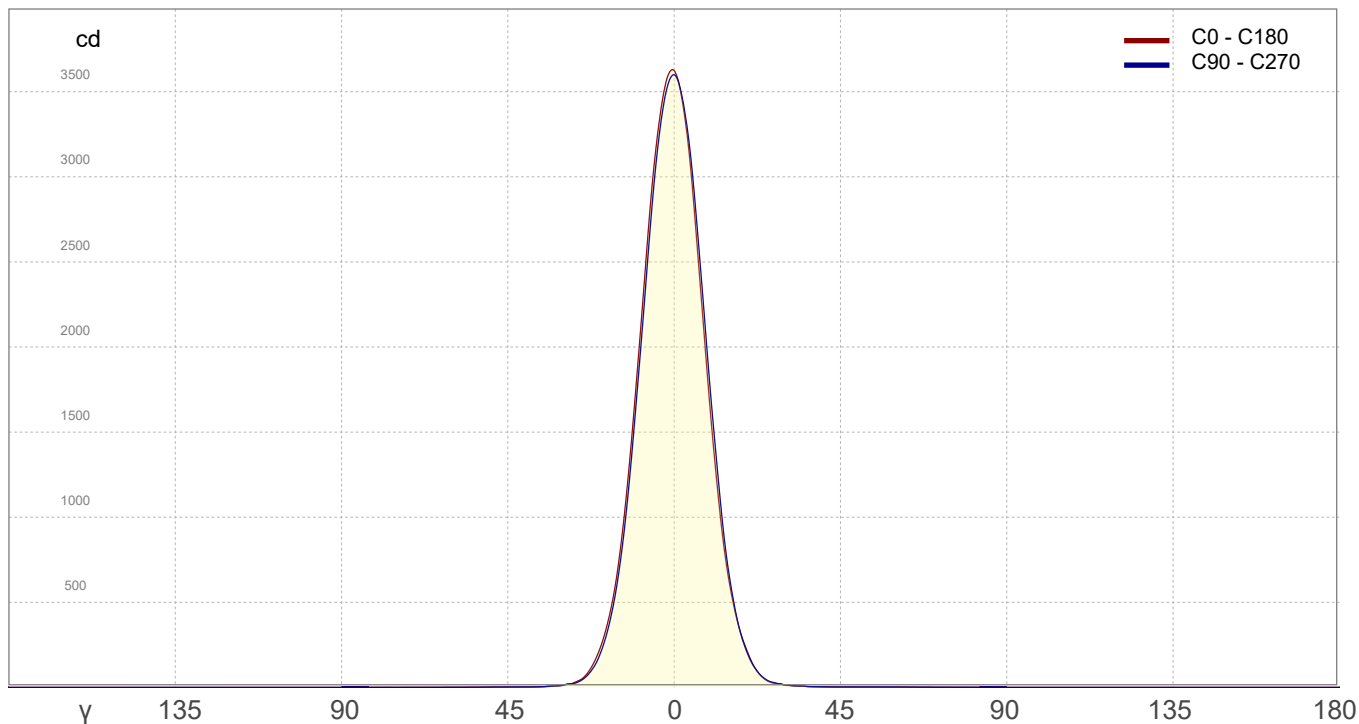

IESNA TM-15-07 Luminaire Classification System For Outdoor Luminaires

BUG rating B1 U0 G0

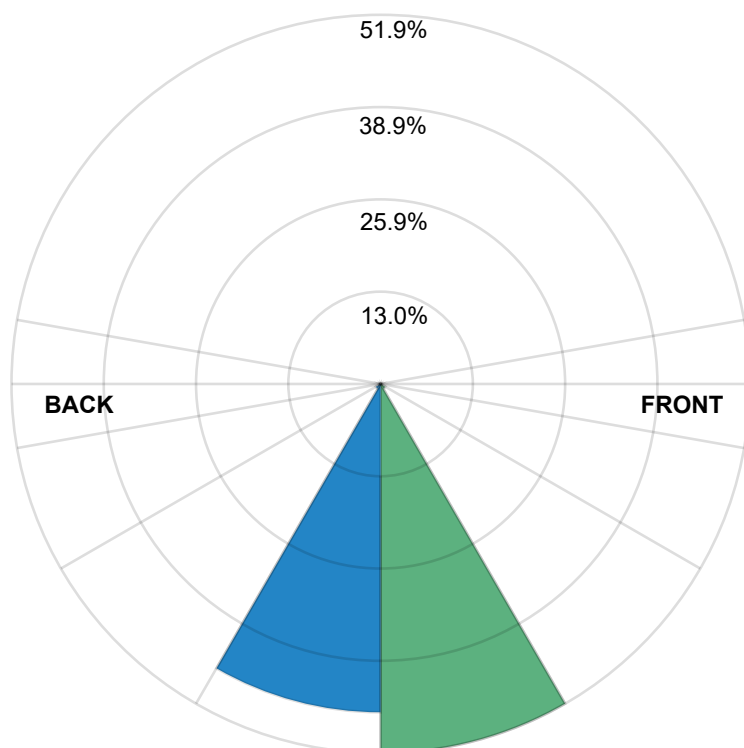

Forward Light

Low (0-30°)	247.8 lm	51.9%
Medium (30-60°)	3.7 lm	0.8%
High (60-80°)	0.8 lm	0.2%
Very High (80-90°)	0.2 lm	0.1%

Back Light

Low (0-30°)	220.4 lm	46.1%
Medium (30-60°)	3.7 lm	0.8%
High (60-80°)	1.0 lm	0.2%
Very High (80-90°)	0.2 lm	0.0%

Uplight

Low (90-100°)	0.0 lm	0.00%
High (100-180°)	0.0 lm	0.0%

Total

Sum	477.8 lm	100,0%
-----	----------	--------