

Light measurement report



Laboratory and Equipment

Test lab	n/a
Spectrometer Manufacturer and Model	n/a, n/a – n/a
Measurement date	6/26/2026

Measurement Conditions

Tested c-planes	8
Tested gamma angles	181 – 1.00°
Input Power	6.3 W


Tested Light Source

Luminaire	2021/12/22 14:54:35
Basic Luminous Shape	PANEL
Item No.	
Manufacturer	Moon On Noon


Main Light Measurement Results

Output – Total Lumen (Up% / Down%)	494.8 lm – 0.0002% / 100%
Efficiency	78.55 lm/W
Peak Intensity	1440 cd
Correlated Color Temperature, CCT	3000 K
Color Rendering Index	CRI 85.0

Polar light distribution diagram

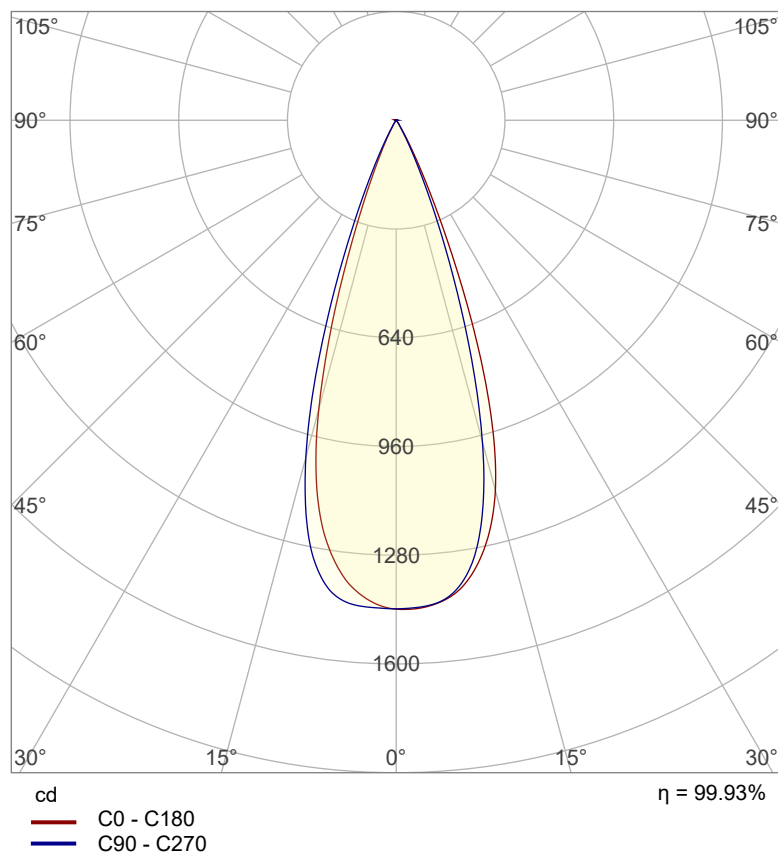


Beam details

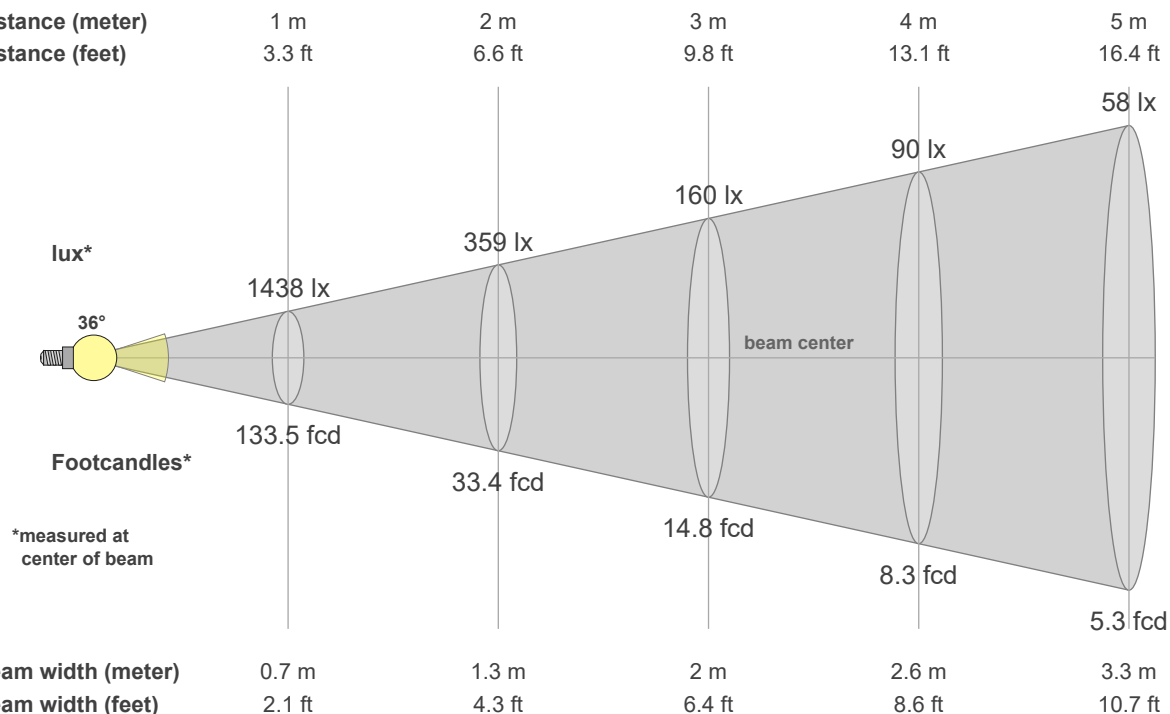


Luminaire budgetary diagram


LAMPS (number of lamps)

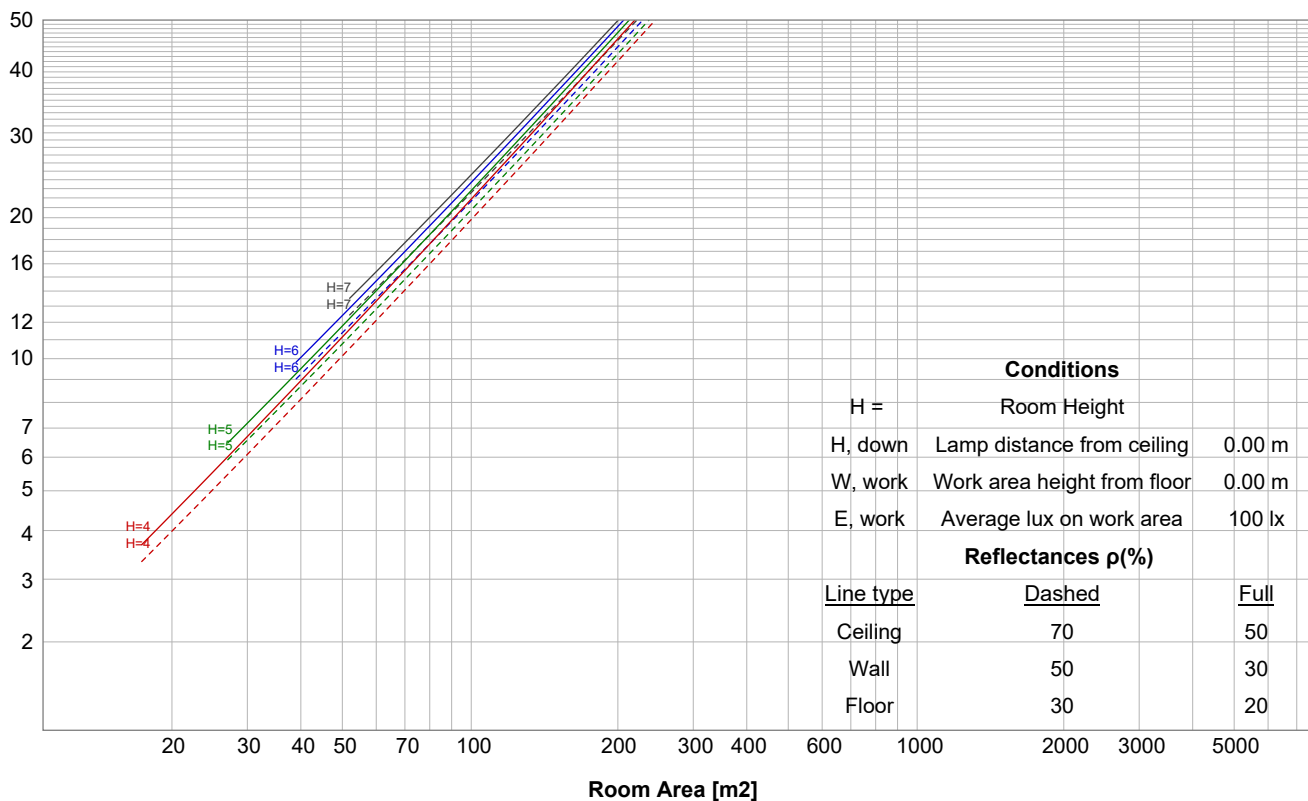


Iso-intensity Diagram (Iso-candela)

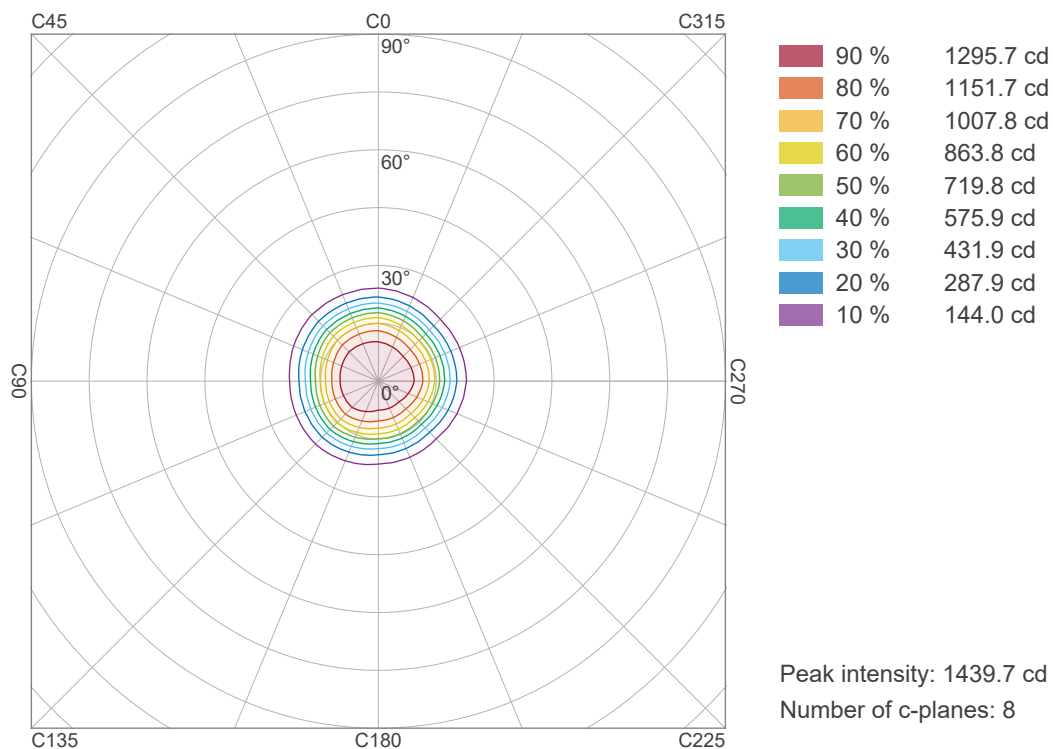

Iso-illuminance Diagram (Iso-lux)

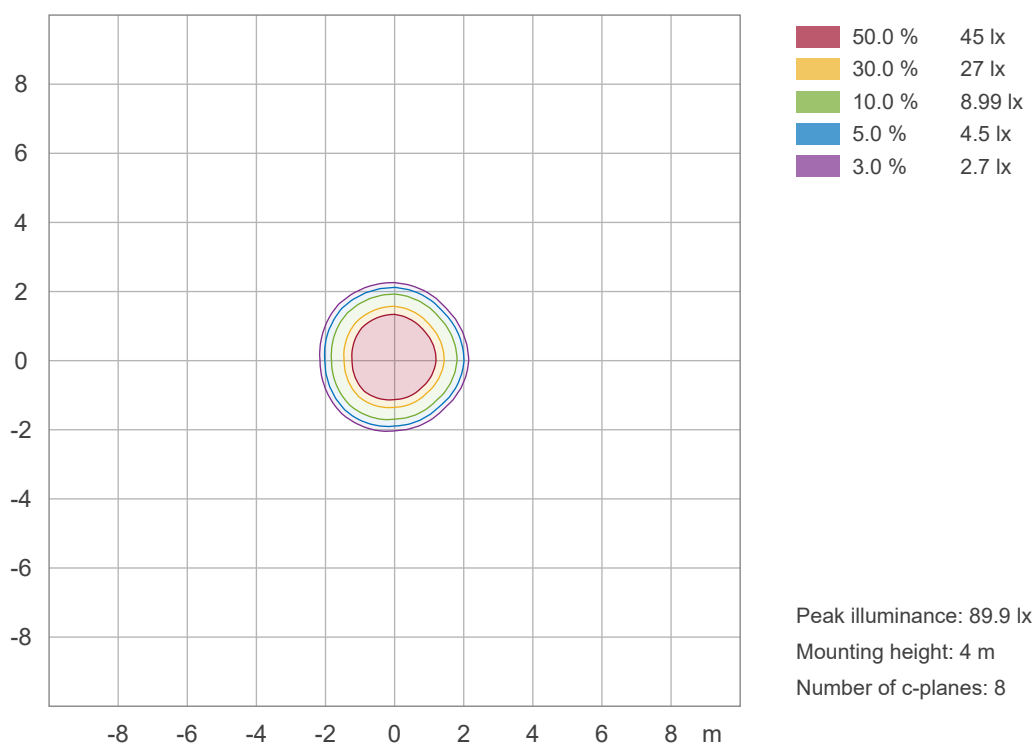


Linear intensity distribution diagram

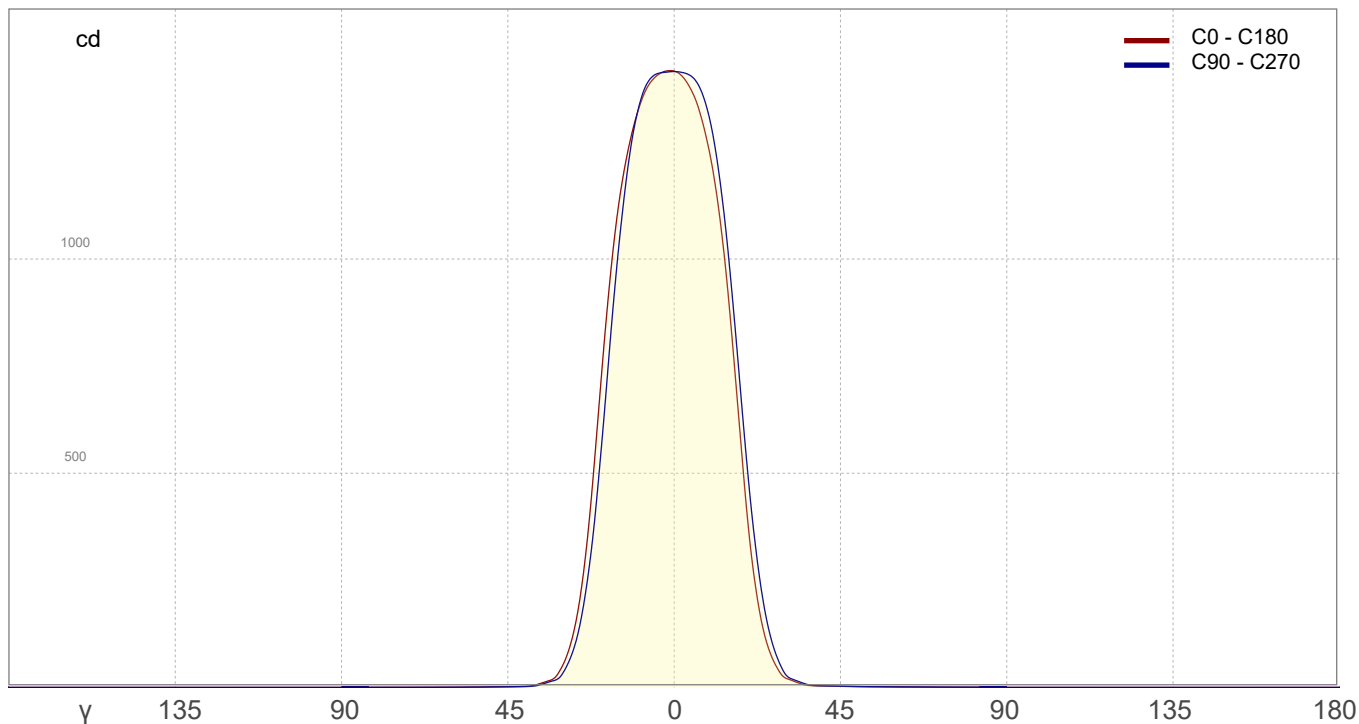

IESNA TM-15-07 Luminaire Classification System For Outdoor Luminaires

BUG rating B1 U0 G0

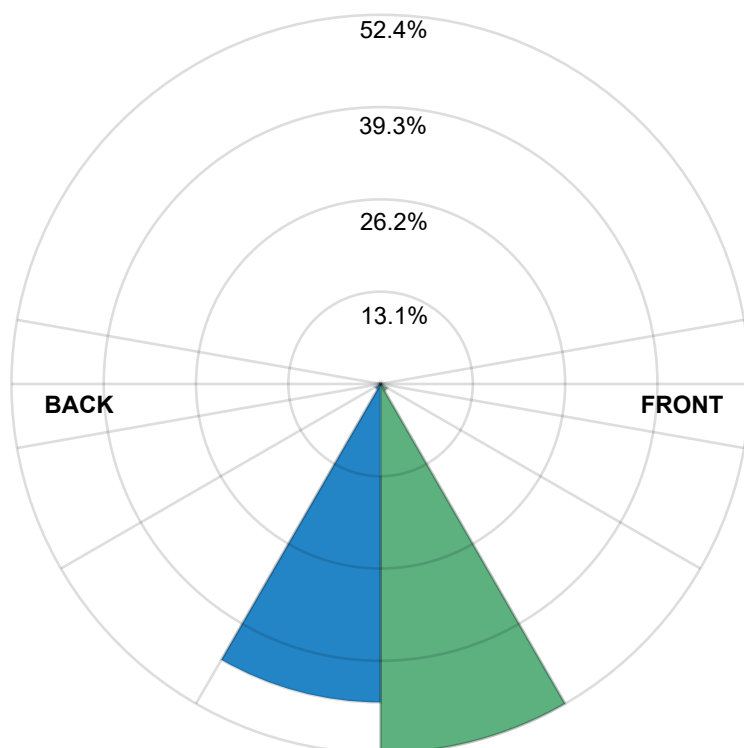

Forward Light

Low (0-30°)	259.4 lm	52.4%
Medium (30-60°)	5.7 lm	1.1%
High (60-80°)	0.5 lm	0.1%
Very High (80-90°)	0.2 lm	0.0%

Back Light

Low (0-30°)	223.8 lm	45.2%
Medium (30-60°)	4.4 lm	0.9%
High (60-80°)	0.6 lm	0.1%
Very High (80-90°)	0.2 lm	0.0%

Uplight

Low (90-100°)	0.0 lm	0.00%
High (100-180°)	0.0 lm	0.0%

Total

Sum	494.8 lm	100,0%
-----	----------	--------