

Light measurement report



Laboratory and Equipment

Test lab	n/a
Spectrometer Manufacturer and Model	n/a, n/a – n/a
Measurement date	6/29/2026

Measurement Conditions

Tested c-planes	12
Tested gamma angles	181 – 1.00°
Input Power	6.75 W


Tested Light Source

Luminaire	2023/4/18 11:39:03
Basic Luminous Shape	PANEL
Item No.	
Manufacturer	Moon On Noon


Main Light Measurement Results

Output – Total Lumen (Up% / Down%)	369.3 lm – 0.0052% / 99.99%
Efficiency	54.7 lm/W
Peak Intensity	2052 cd
Correlated Color Temperature, CCT	3000 K
Color Rendering Index	CRI 85.0

Polar light distribution diagram

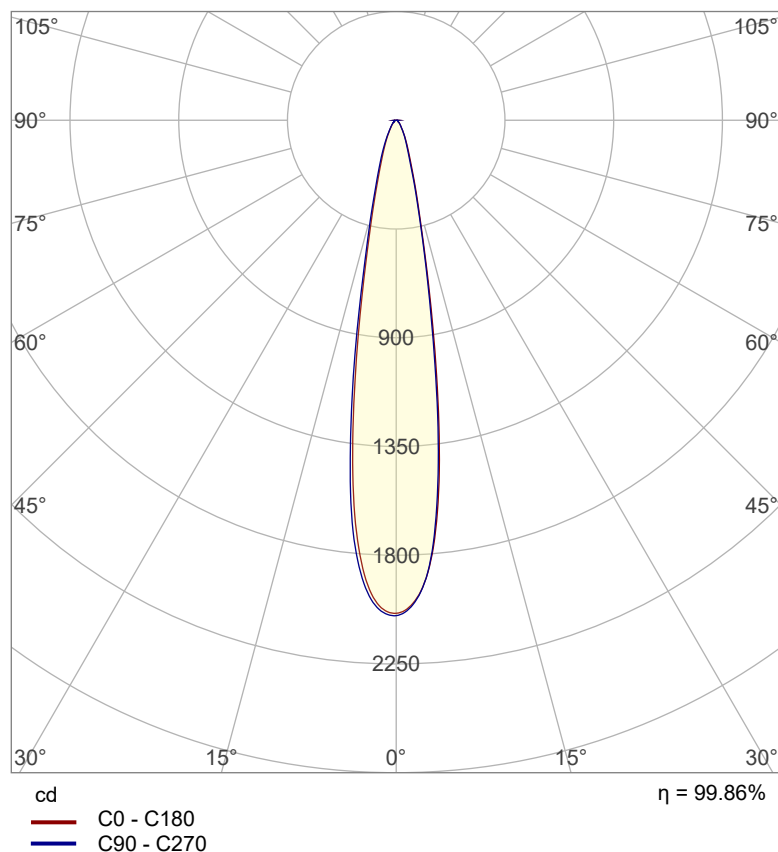


Beam details

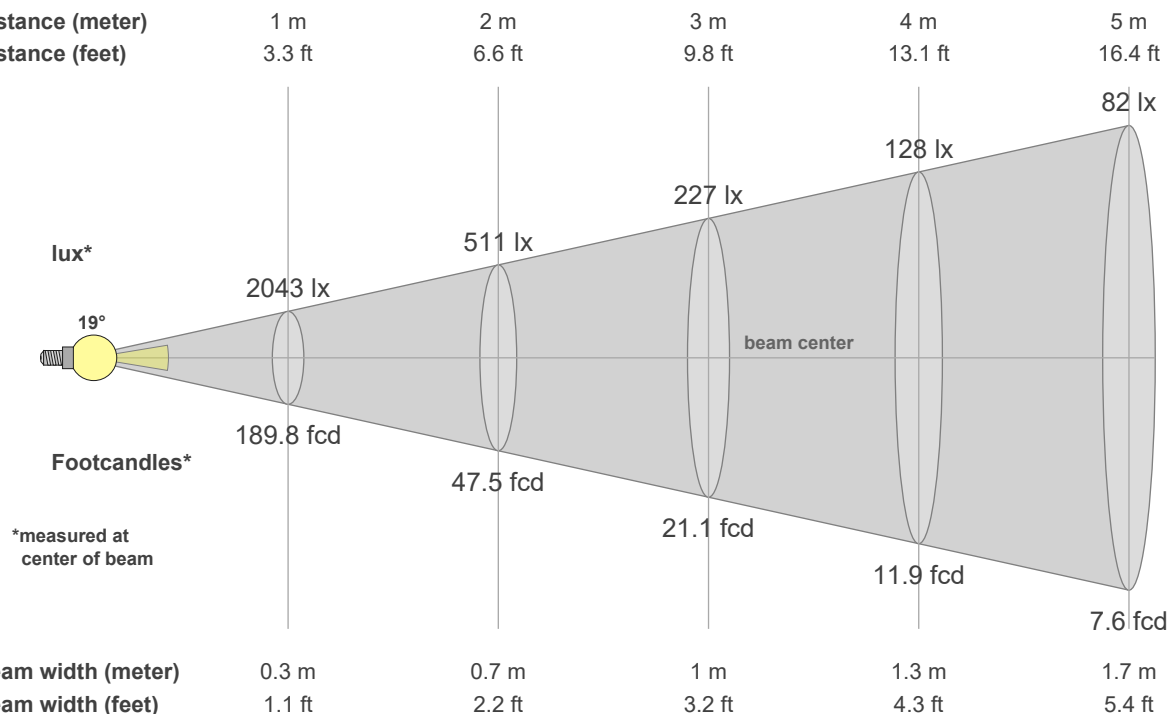


Luminaire budgetary diagram


LAMPS (number of lamps)

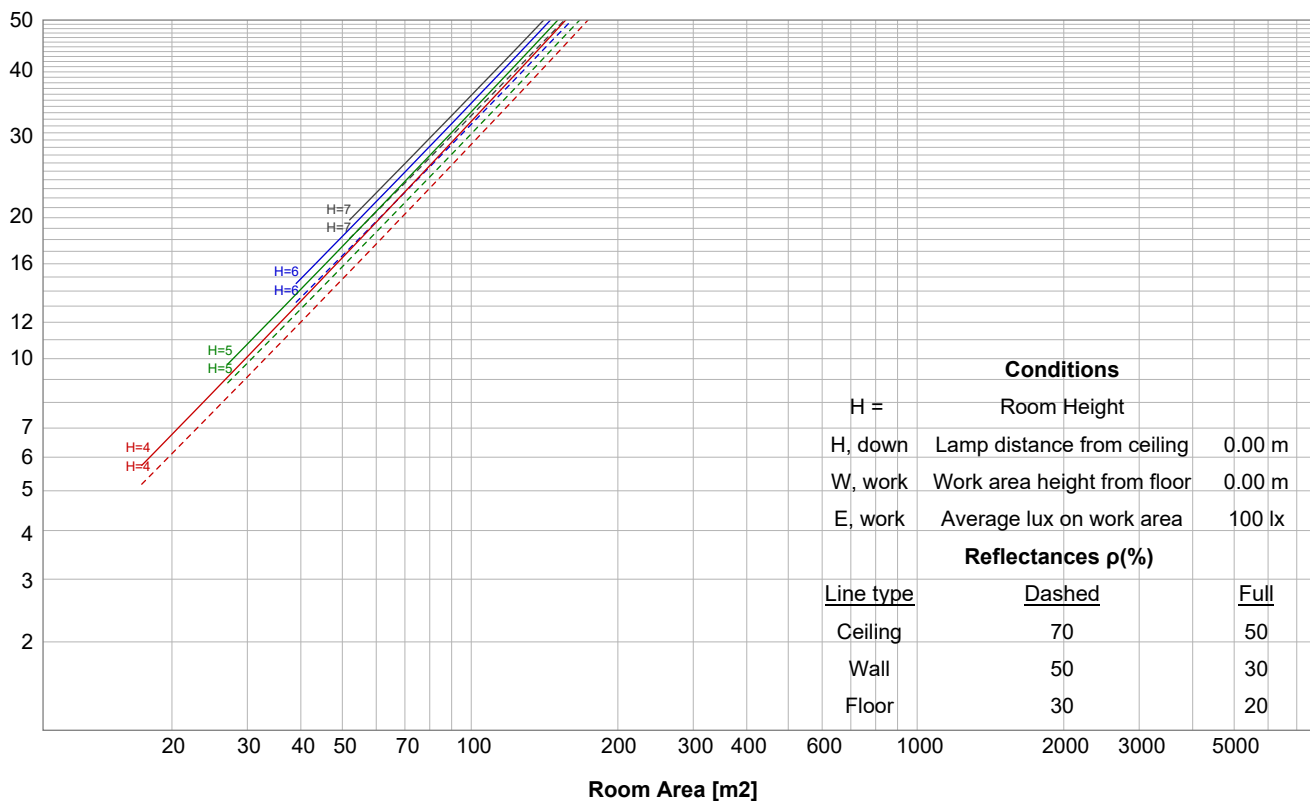


Iso-intensity Diagram (Iso-candela)

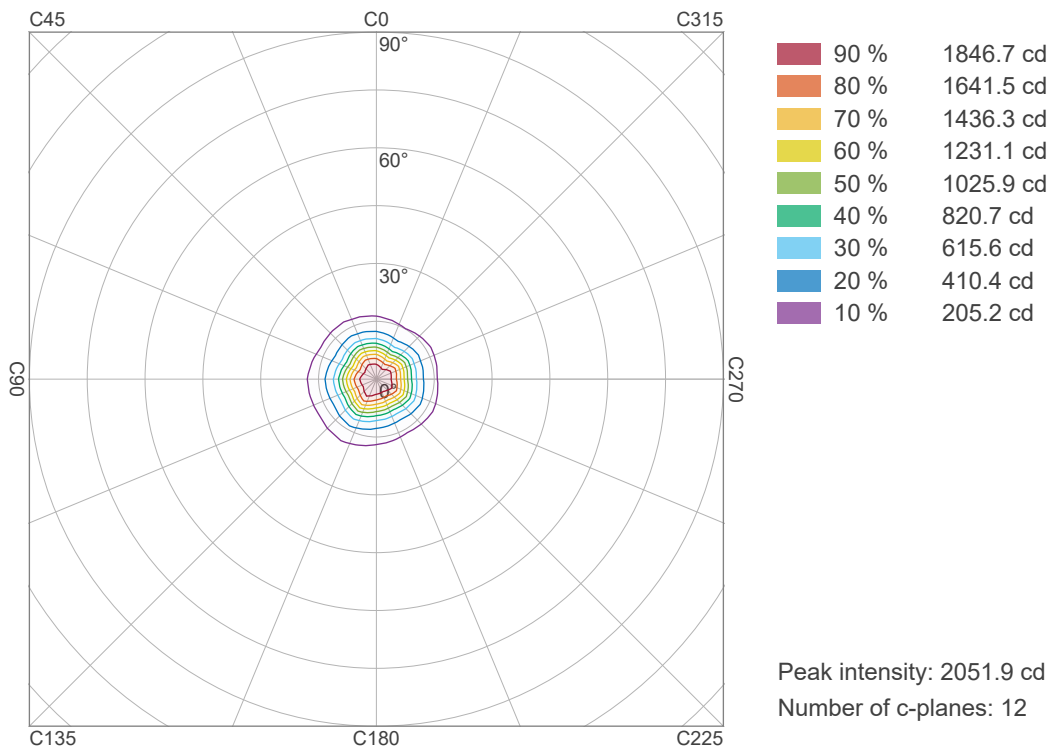

Iso-illuminance Diagram (Iso-lux)

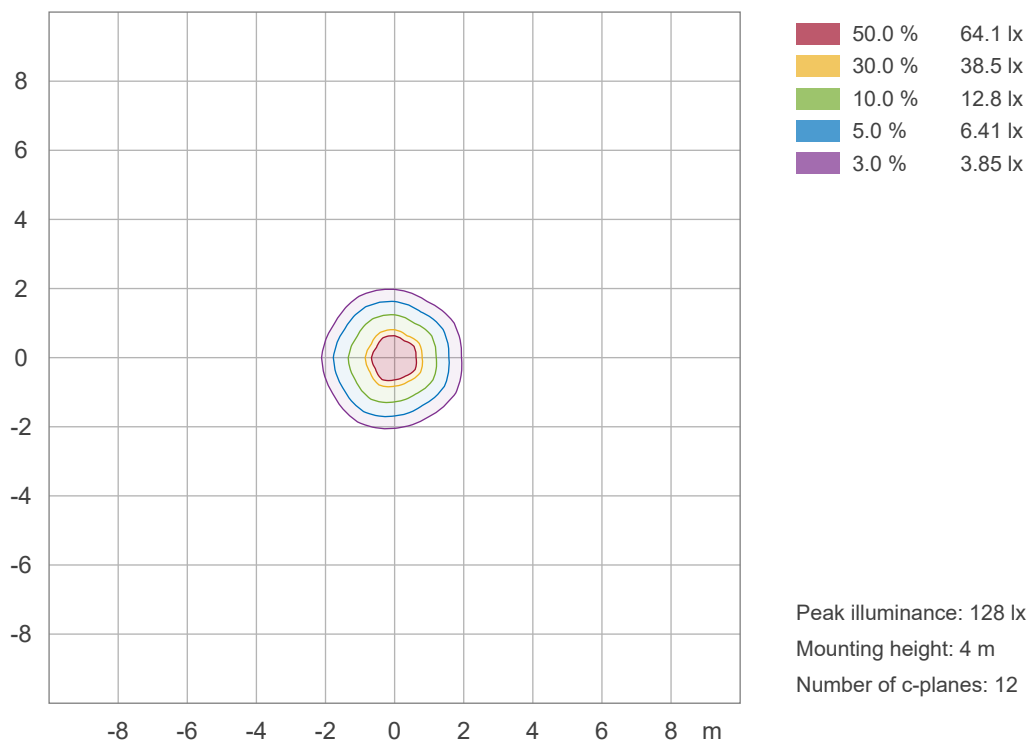


Linear intensity distribution diagram

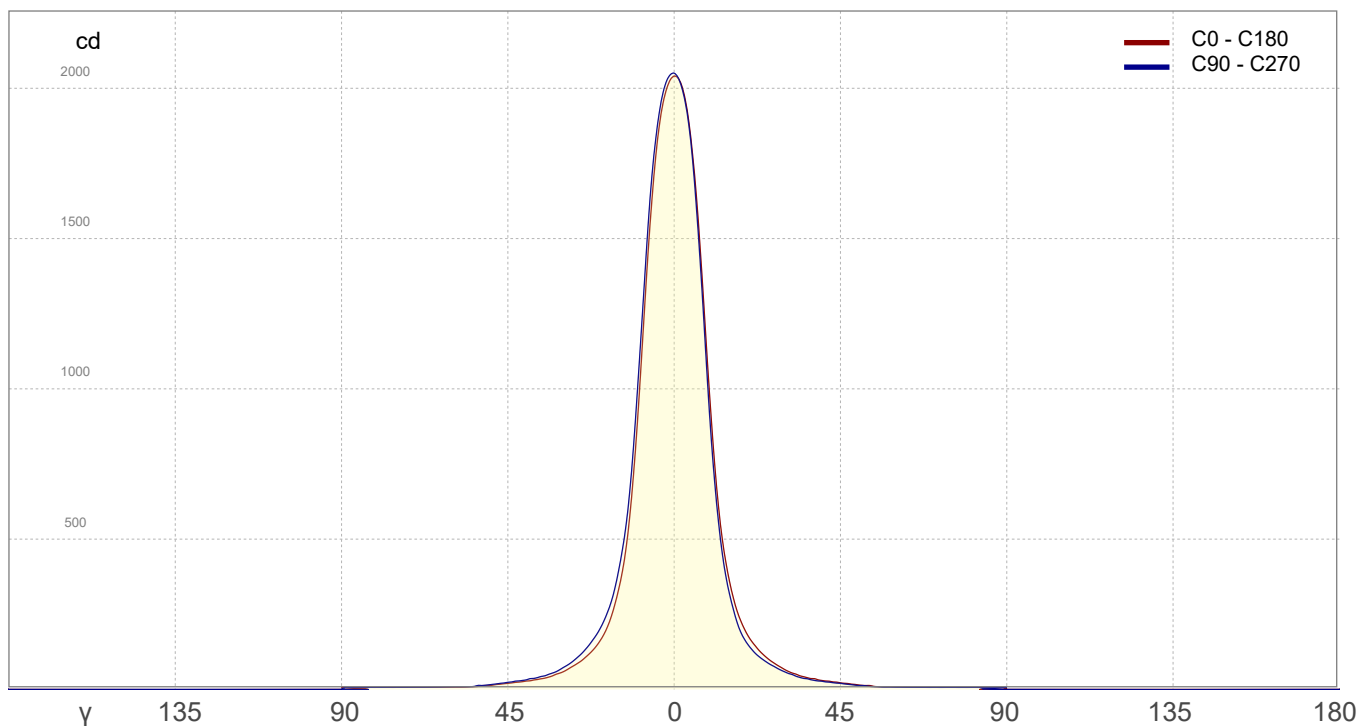

IESNA TM-15-07 Luminaire Classification System For Outdoor Luminaires

BUG rating B1 U0 G0

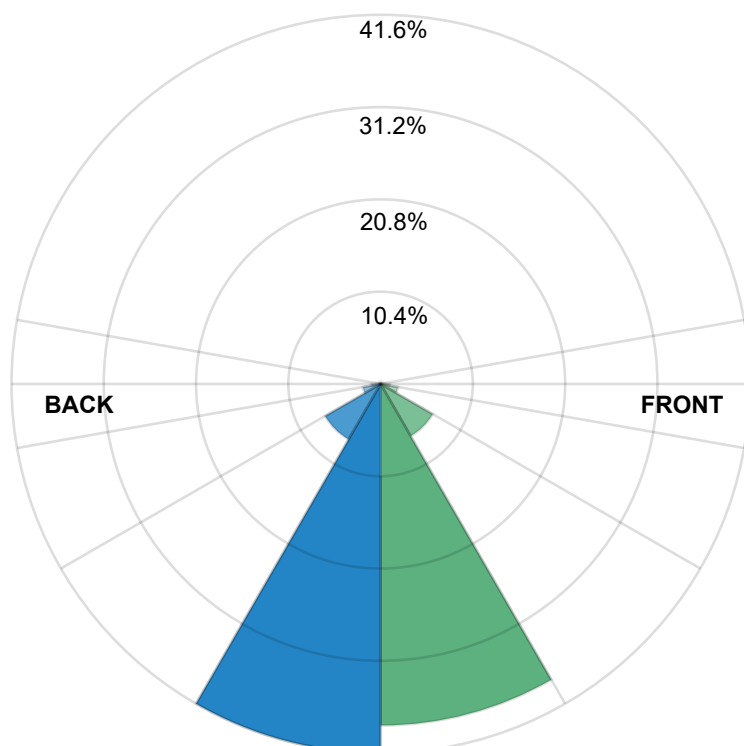

Forward Light

Low (0-30°)	141.9 lm	38.4%
Medium (30-60°)	25.0 lm	6.8%
High (60-80°)	7.4 lm	2.0%
Very High (80-90°)	3.7 lm	1.0%

Back Light

Low (0-30°)	153.4 lm	41.6%
Medium (30-60°)	26.6 lm	7.2%
High (60-80°)	7.5 lm	2.0%
Very High (80-90°)	3.7 lm	1.0%

Uplight

Low (90-100°)	0.0 lm	0.00%
High (100-180°)	0.0 lm	0.0%

Total

Sum	369.3 lm	100,0%
-----	----------	--------